


Appendix D - Data Tables and Figures

Page Left Intentionally Blank

2.0 Alternatives Considered
Section 2.1 Alternatives Development Process

Appendix D: Data Tables and Figures


Appendix Figure 2.1-1: Inner Core BeltLine Alternatives Analysis – B3 Alternative

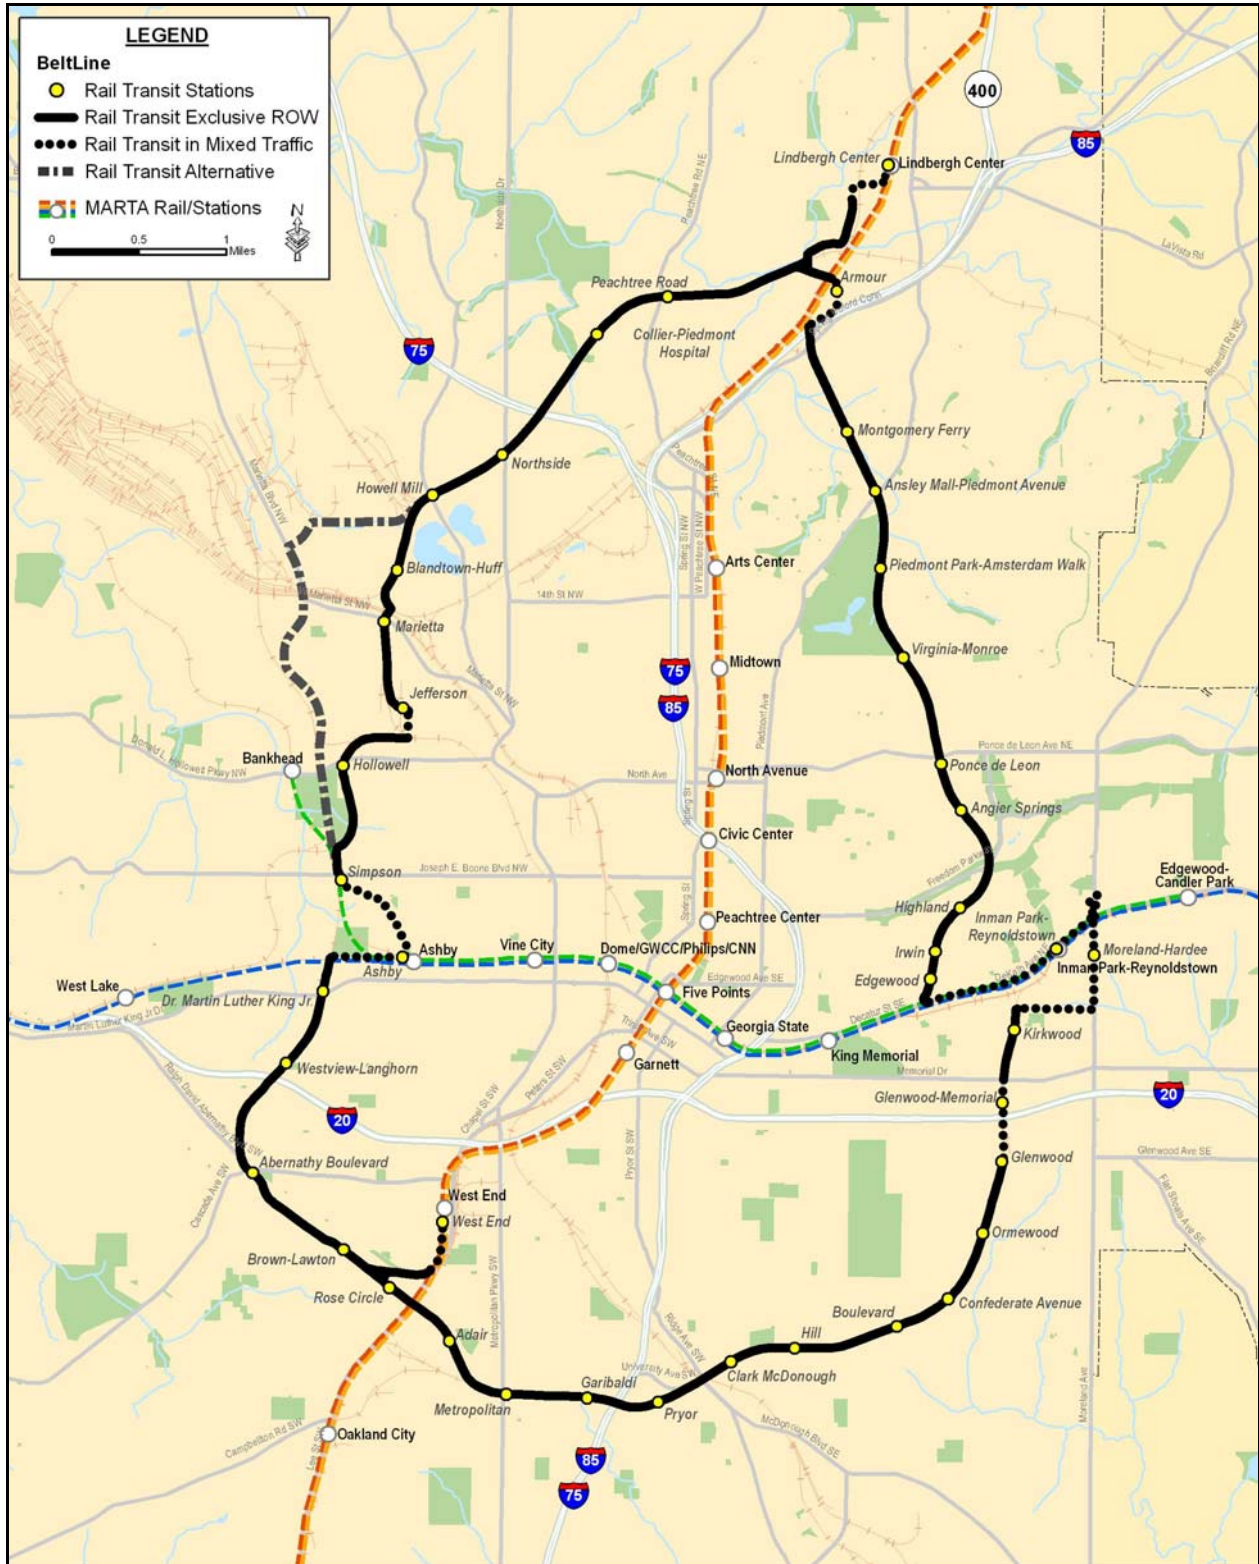

2.0 Alternatives Considered

Section 2.1 Alternatives Development Process

Appendix Figure 2.1-2a: Transit and Trails Alternatives Identified During Scoping (Northeast Zone)

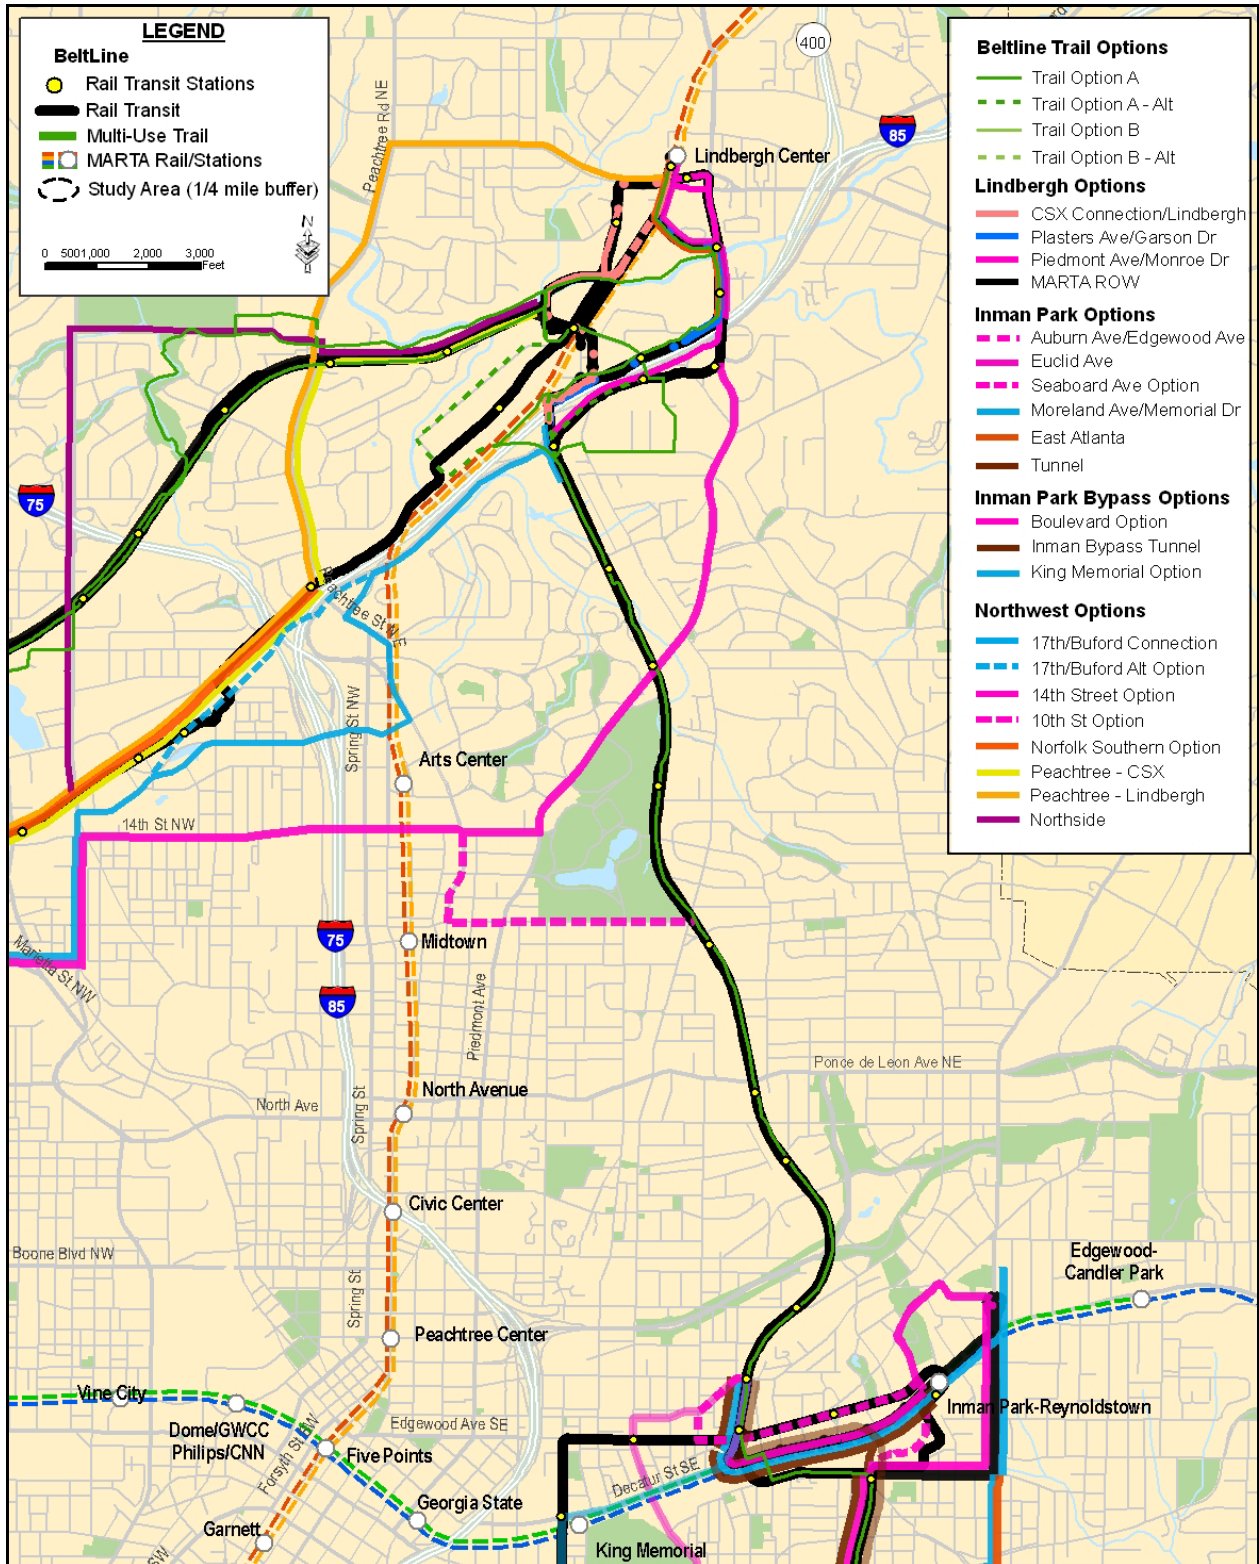


Source: AECOM/JJG Joint Venture

2.0 Alternatives Considered

Section 2.1 Alternatives Development Process

Appendix Figure 2.2-2b: Transit and Trails Alternatives Identified During Scoping (Southeast Zone)

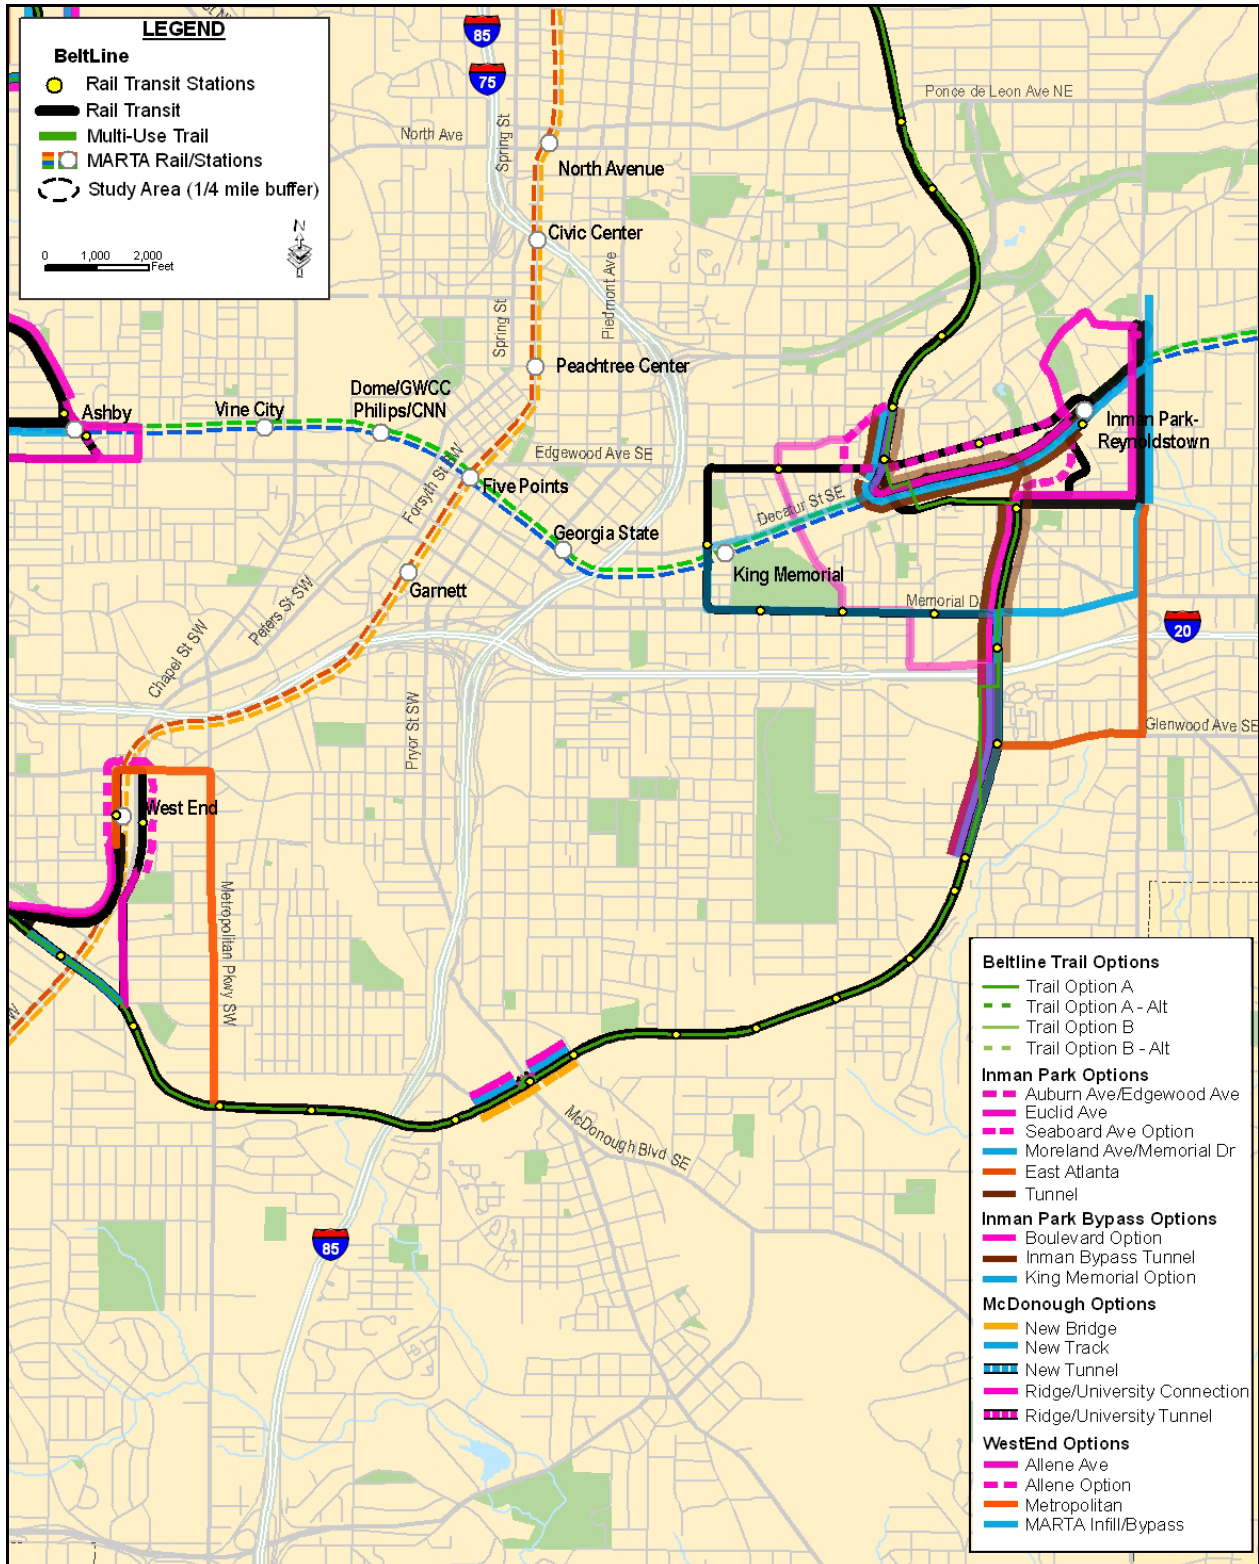


Source: AECOM/JJG Joint Venture

2.0 Alternatives Considered

Section 2.1 Alternatives Development Process

Appendix Figure 2.2-2c: Transit and Trails Alternatives Identified During Scoping (Southwest Zone)

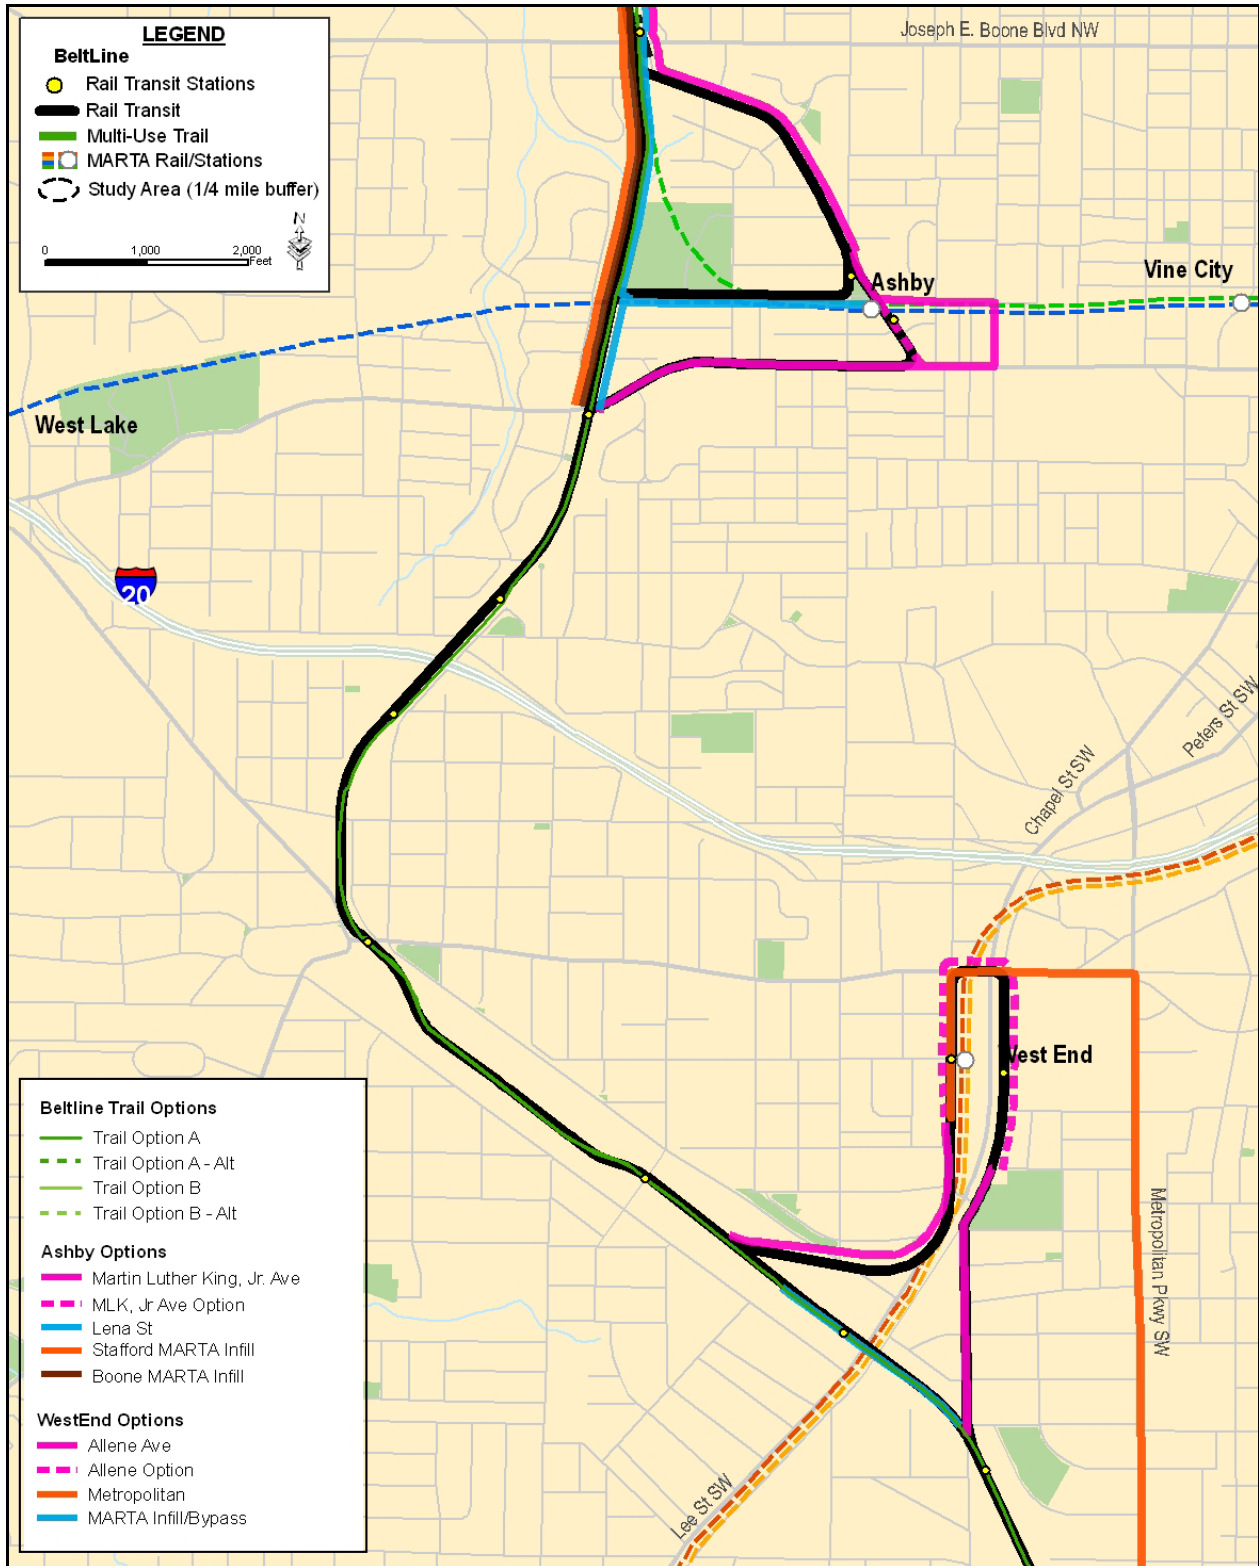


Source: AECOM/JJG Joint Venture

2.0 Alternatives Considered

Section 2.1 Alternatives Development Process

Appendix Figure 2.2-2d: Transit and Trails Alternatives Identified During Scoping (Northwest Zone)

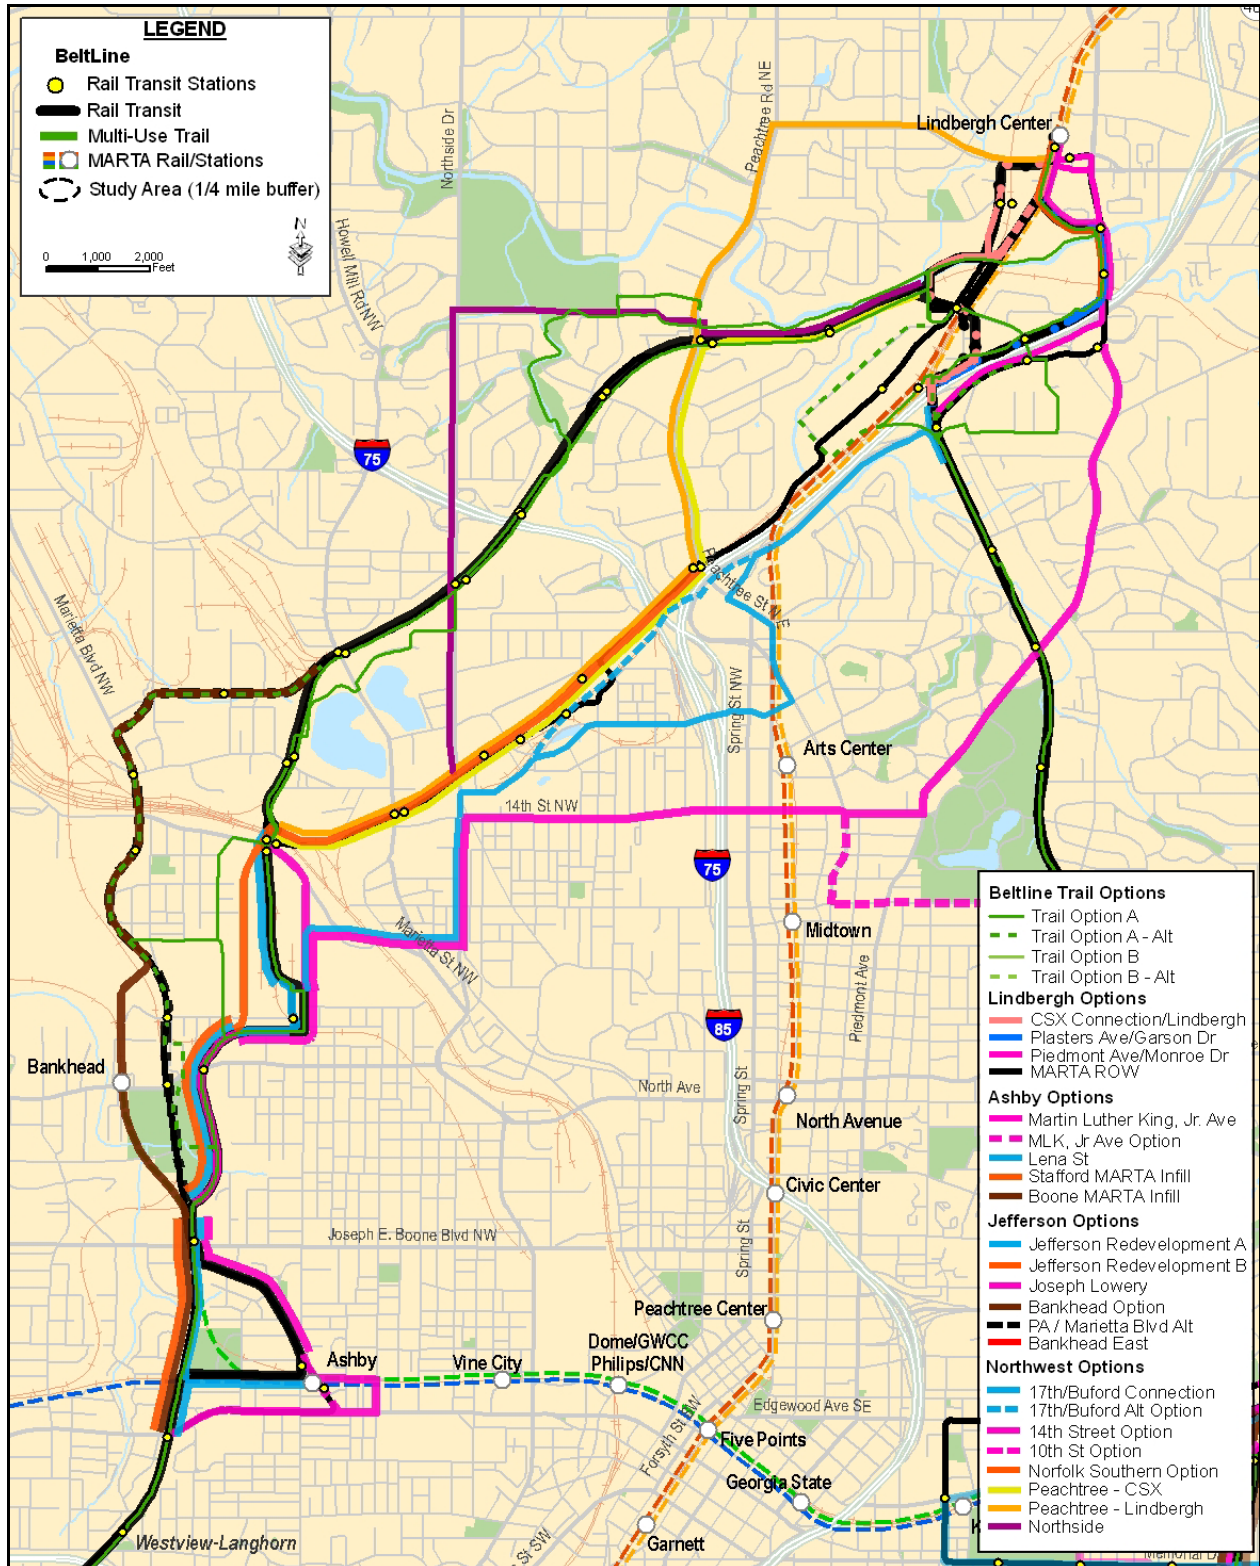

Source: AECOM/JJG Joint Venture

2.0 Alternatives Considered
Section 2.2 No-Build Alternative


Appendix Table 2.2-1: Other *Envision6* RTP/TIP Projects that Interface with the Atlanta BeltLine

Project Type	Location	Status	Project Description
Roadway Maintenance / Operations	Multi-Jurisdictional	Programmed	I-75 / I-85 (downtown connector) resurfacing and guardrail upgrade
Fixed Guideway Transit Capital	Multi-Jurisdictional	Programmed	Commuter rail service – Atlanta / Griffin / Macon (stations and park-and-ride lots for Lovejoy section)
		Programmed	Lindbergh Center / Emory bus high-speed premium transit service
	Long Range	I-20 east BRT	
	City of Atlanta	Long Range	Atlanta Streetcar - phase 2 north Atlanta Streetcar - phase 2 south
Arterial BRT	Multi-Jurisdictional	Programmed	SR 13 (Buford Highway) arterial BRT
	Multi-Jurisdictional	Long Range	Memorial Drive BRT
Studies	Multi-Jurisdictional	Programmed	I-75 / I-575 Northwest Corridor - general obligation bond funds for preliminary engineering
			I-75/I-575 Northwest Corridor - GRV bond funds for preliminary engineering
			I-75 / I-575 Northwest Corridor - bond funds (backed by anticipated toll revenue) for preliminary engineering
			I-75 / I-575 Northwest Corridor - bond funds (backed by anticipated 5309 New Starts allocations) for preliminary engineering
Transit Facilities	Multi-Jurisdictional	Programmed	I-75 / I-575 Northwest Corridor - general obligation bond funds for I-75 BRT
			I-75 / I-575 Northwest Corridor - GRV bond funds for I-75 BRT
			I-75 / I-575 Northwest Corridor - 5309 New Starts Funds for I-75 BRT
Roadway Operational Upgrades	City of Atlanta	Programmed	US 78 / 278 (Donald Lee Hollowell Parkway)
Roadway Capacity	City of Atlanta	Long Range	University Avenue
Pedestrian Facility	City of Atlanta	Programmed	Ralph David Abernathy Boulevard pedestrian and intersection improvements
Multi-Use Bike / Pedestrian Facility	City of Atlanta	Programmed	Marietta Boulevard pedestrian improvements
Bridge Upgrade	City of Atlanta	Programmed	US 19 / SR 9 (Peachtree Rd, CSX RR)

Source: ARC, 2007, *Envision6* RTP and TIP

2.0 Alternatives Considered Section 2.2 No-Build Alternative


Appendix Figure 2.2-2: No-Build Alternative Projects

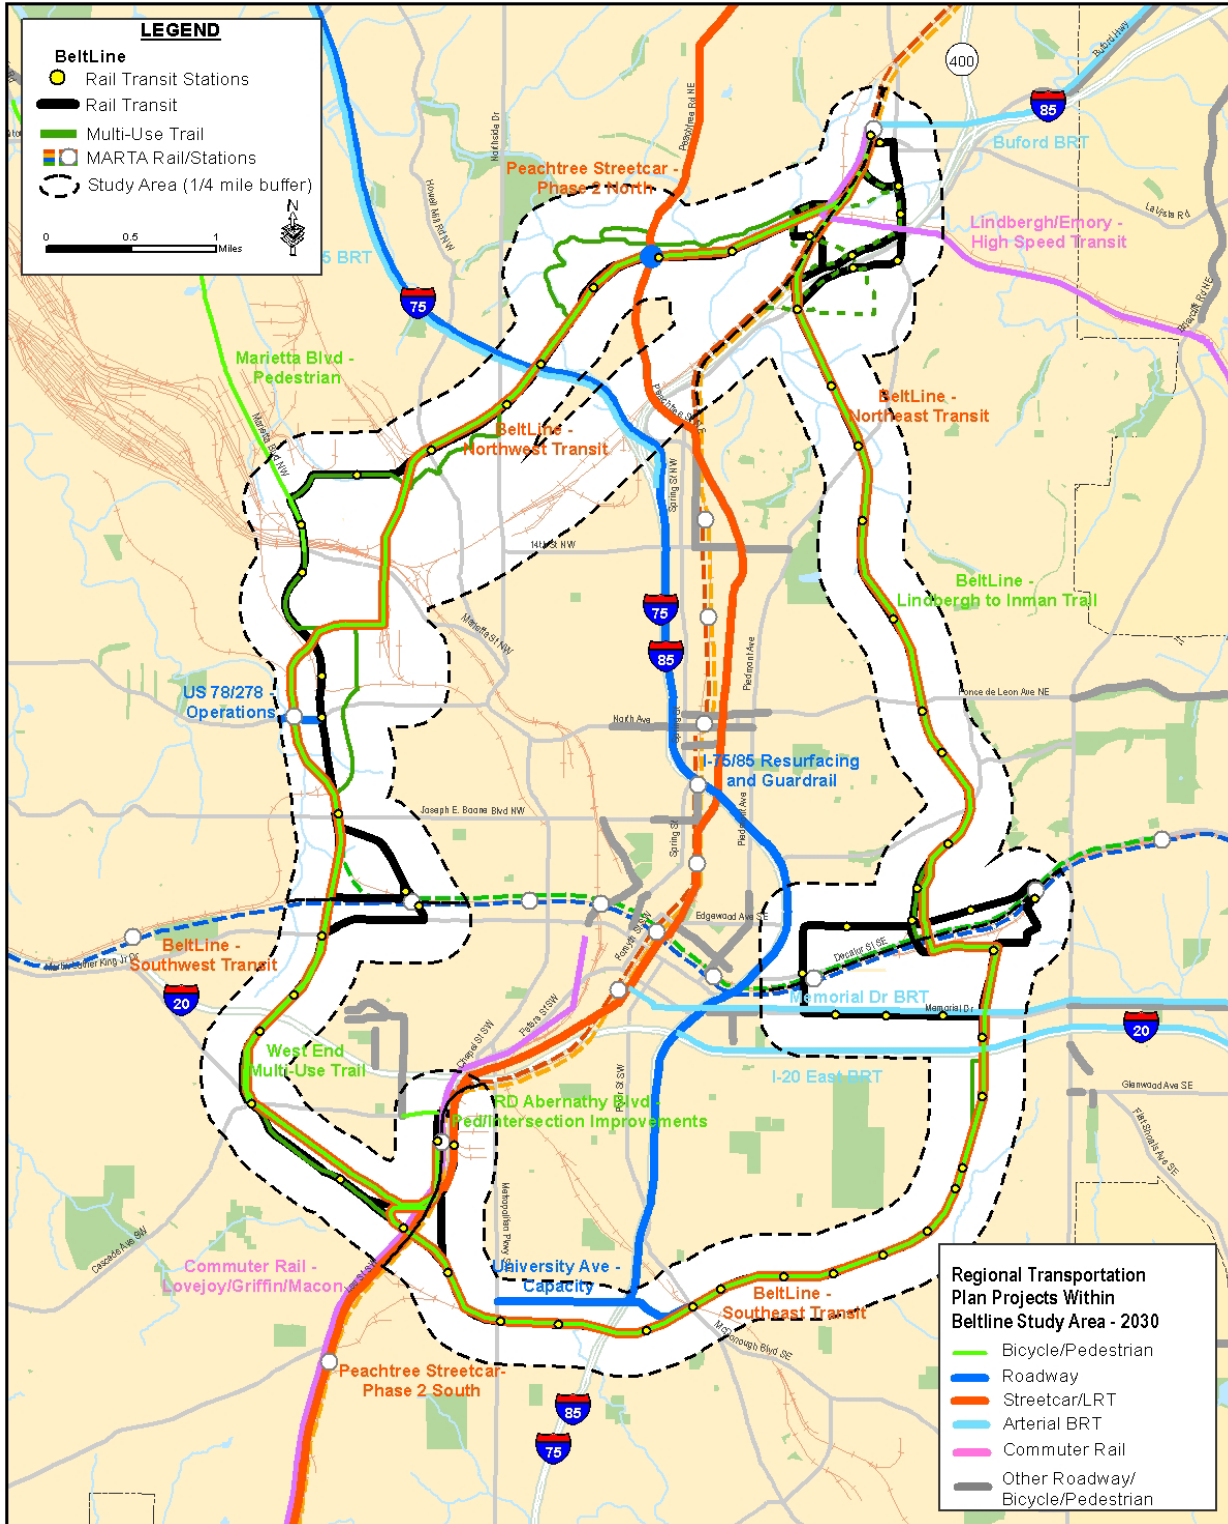

Source: Atlanta Regional Commission 2007

3.0 Affected Environment Section 3.3 Neighborhoods and Community Facilities

Figure 3.3-1: Community Facilities

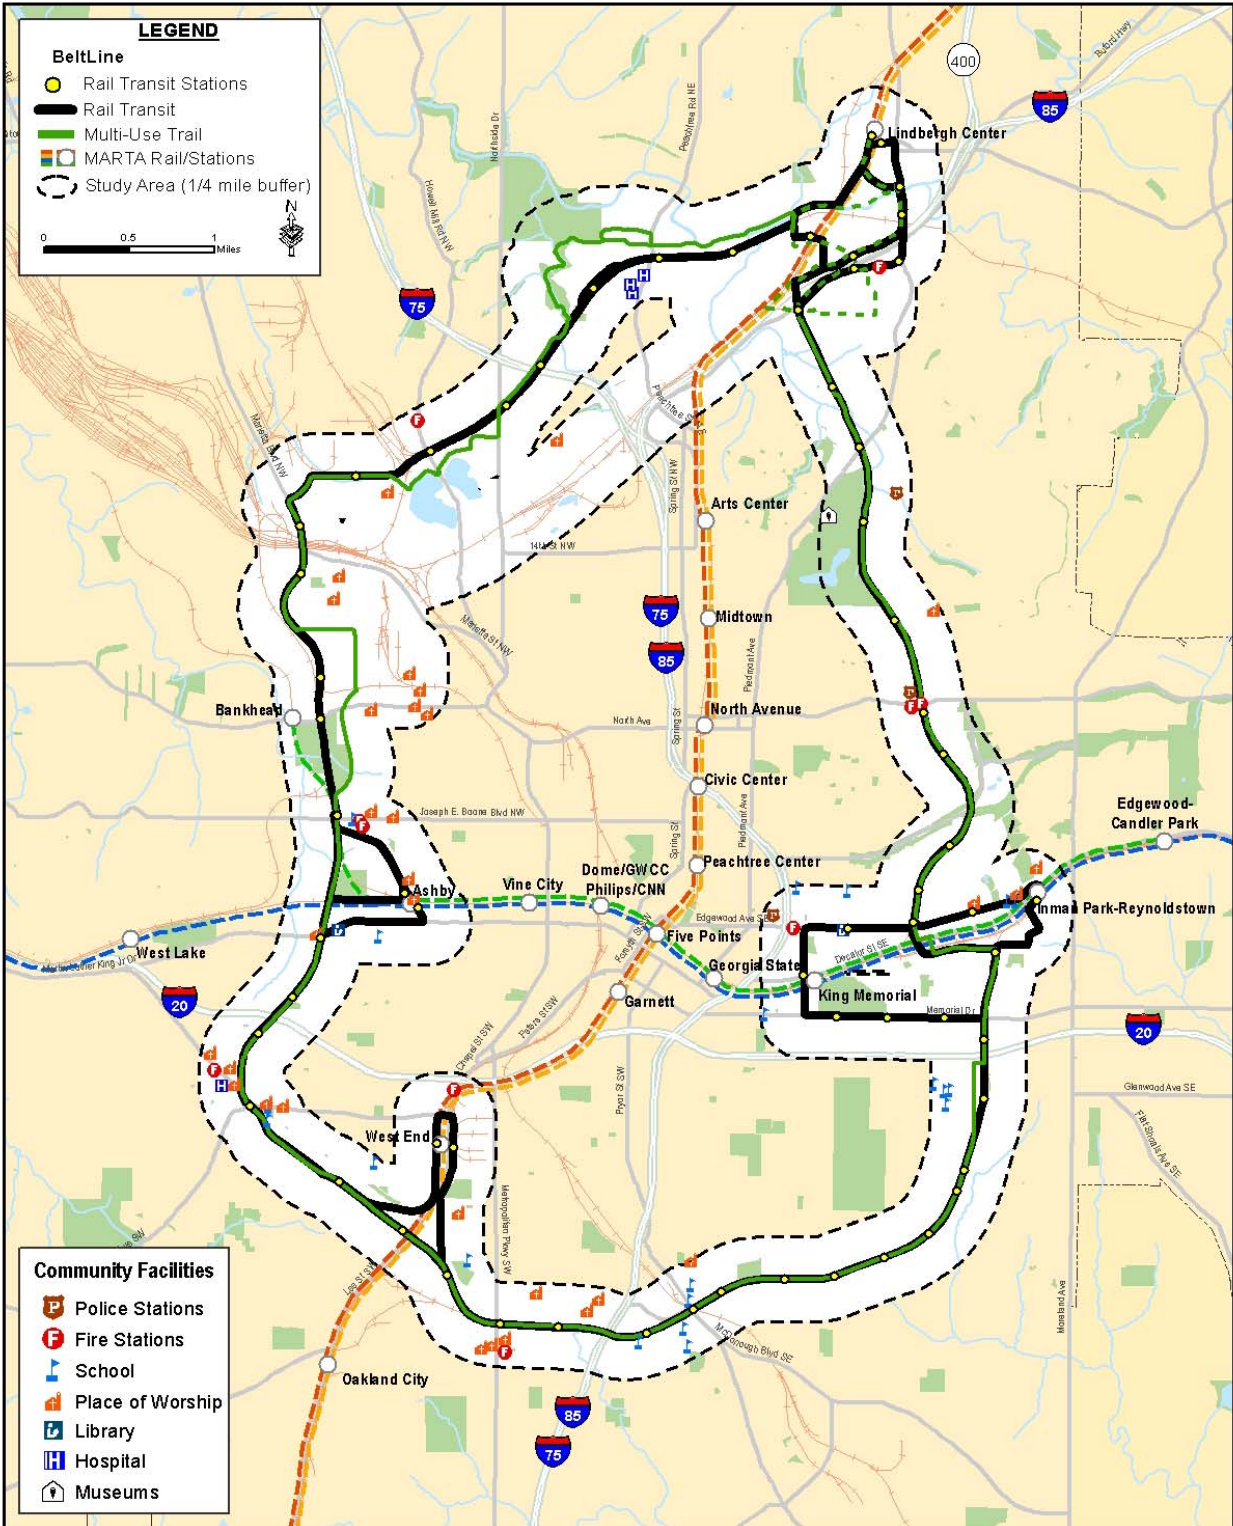

Source: ARC and USGS


3.0 Affected Environment
Section 3.3 Neighborhoods and Community Facilities

Table 3.3-1: Community Facilities

Northeast Zone	
Atlanta Botanical Gardens	Hope Elementary School
Atlanta Bureau of Fire Station #4	Inman Middle School
Atlanta Bureau of Fire Station #29	Inman Park United Methodist Church
Atlanta Fulton Public Library Martin Luther King, Jr. Branch	Martin Luther King, Jr. Community Center
Atlanta Police Dept Midtown Precinct	New Mount Sinai Baptist Church
Atlanta Police Dept Zone 5 Mini Precinct	Saint Paul's Lutheran Church
Atlanta School (The)	Virginia Avenue Baptist Church
East Atlanta Primitive Baptist Church	Walden Middle School
Grady High School	
Southeast Zone	
Adair Park Church	Jessie Mae Jones Elementary School
Atlanta Charter Middle School	Jessie Mae Jones Middle School
Atlanta Bureau of Fire Station #20	New Hope Baptist Church
Atlanta Healing Temple	Nur Private Academy
Atlanta Youth Academies	Oglethorpe Elementary School
Capitol View United Methodist Church	Saint John AME Church
Carver High School	Saint Malachi Baptist Church
Cook Elementary School	Slater Elementary School
Early Church of God in Christ	Southside Comprehensive High School
Gateway Diversion Center	Tech High Elementary School
Guice Elementary	United Baptist Church
Southwest Zone	
Atlanta Bureau of Fire Station #17	Pilgrim Travelers Baptist Church
Atlanta Bureau of Fire Station #7	St Mary's Overcoming Church of God Pentecostal
Atlanta Fulton Public Library Washington Park-McPheeters Library	West End Academy
Booker T. Washington High School	West End Church of Christ
Brown Middle School	Westhills Presbyterian Church
Calvary United Methodist Church	Westhills Senior Citizens Center
Hinsley Temple Church of God in Christ	
Kipp Ways Academy Elementary School	
Northwest Zone	
Atlanta Bureau of Fire Station #16	Longley Avenue Christian Church
Atlanta Bureau of Fire Station #23	Loring Heights Baptist Church
Bellwood Church	New Saint James Baptist Church
Centenary United Methodist Church	Northwest Baptist Church
Emmanuel Church of God	Pentecostal Church Number 2
Fulton County Drug Court Human Services Dept	Piedmont Hospital
Fulton County Jail	Saint Paul's Church
Grace Temple Church	Shepherd Center, Inc.
Heavenly Jerusalem Missionary Baptist Church	Temple of God
Herndon Elementary School	Temple of Israel Church

3.0 Affected Environment Section 3.6 Cultural Resources and Archaeological Resources


Figure 3.6-1a: Archaeological Sensitivity Areas (Northeast Zone)

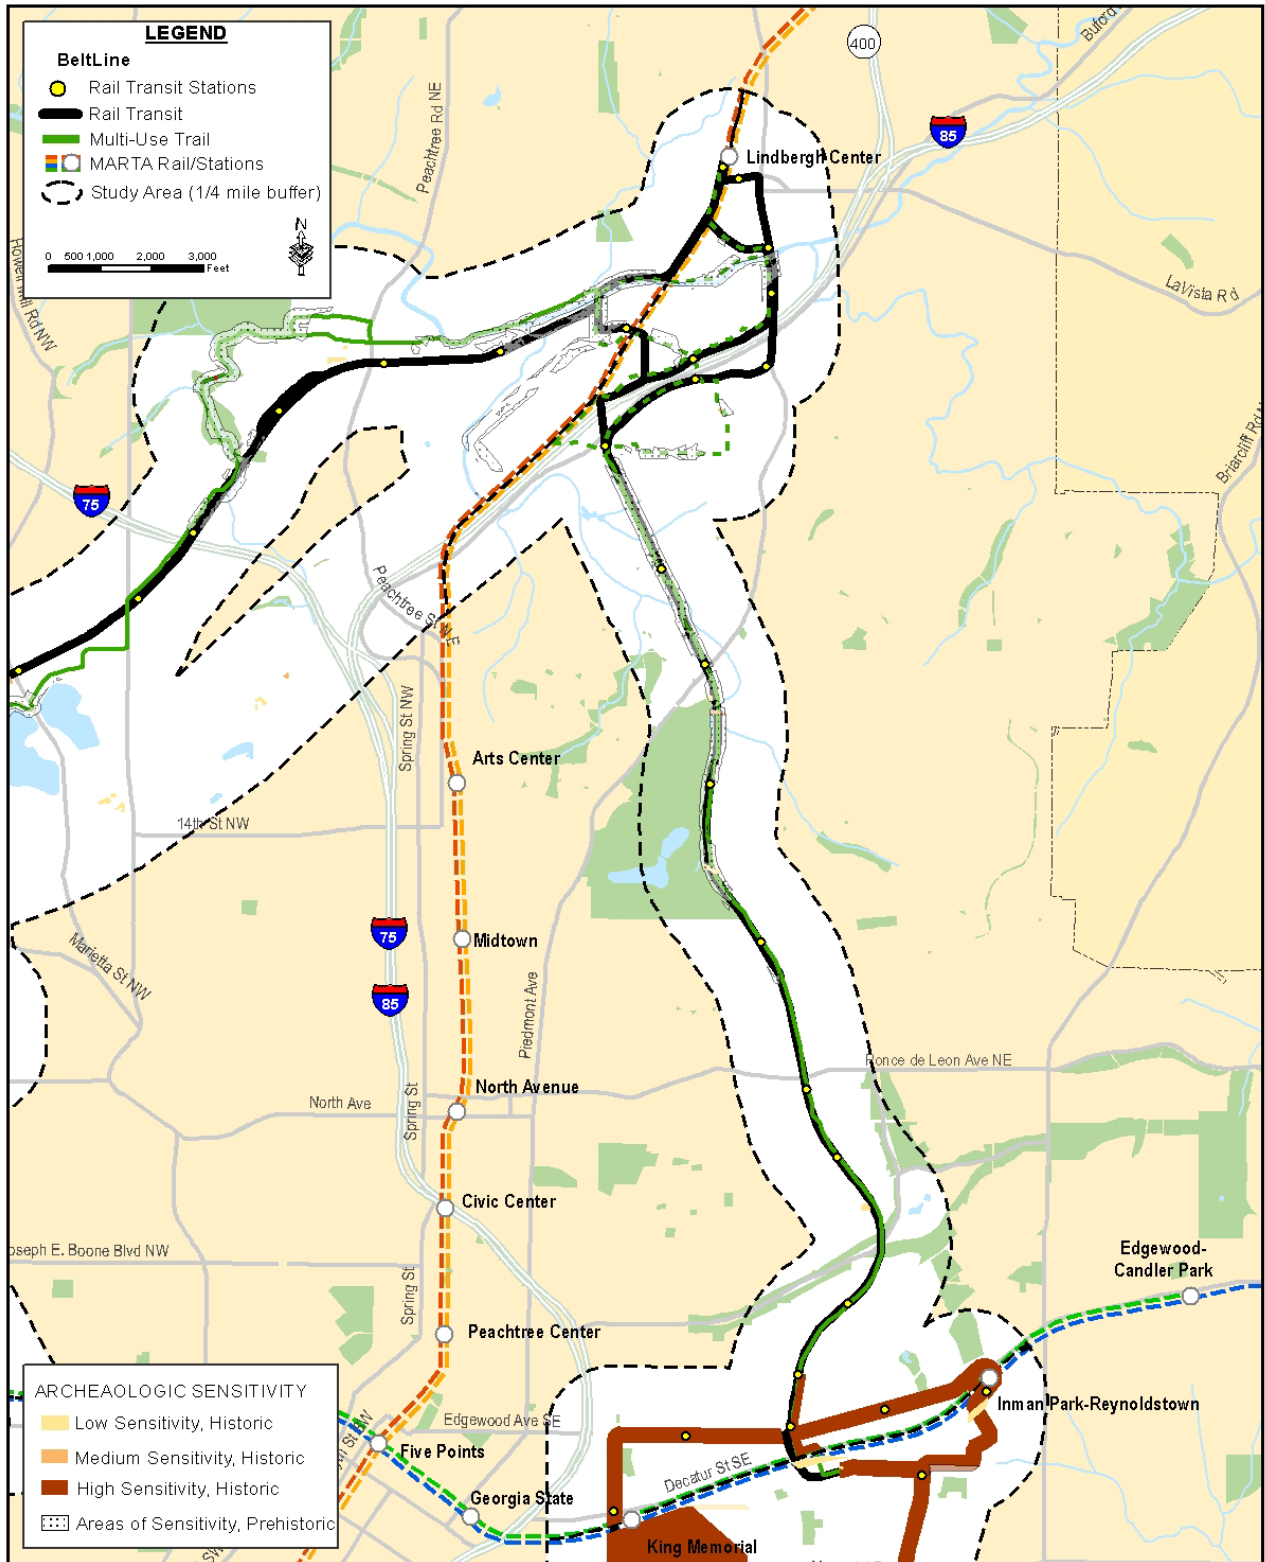

Sources: NRHP, GRHP, AUDC, and ARC.

3.0 Affected Environment Section 3.6 Cultural Resources and Archaeological Resources


Figure 3.6-1b: Archaeological Sensitivity Areas (Southeast Zone)

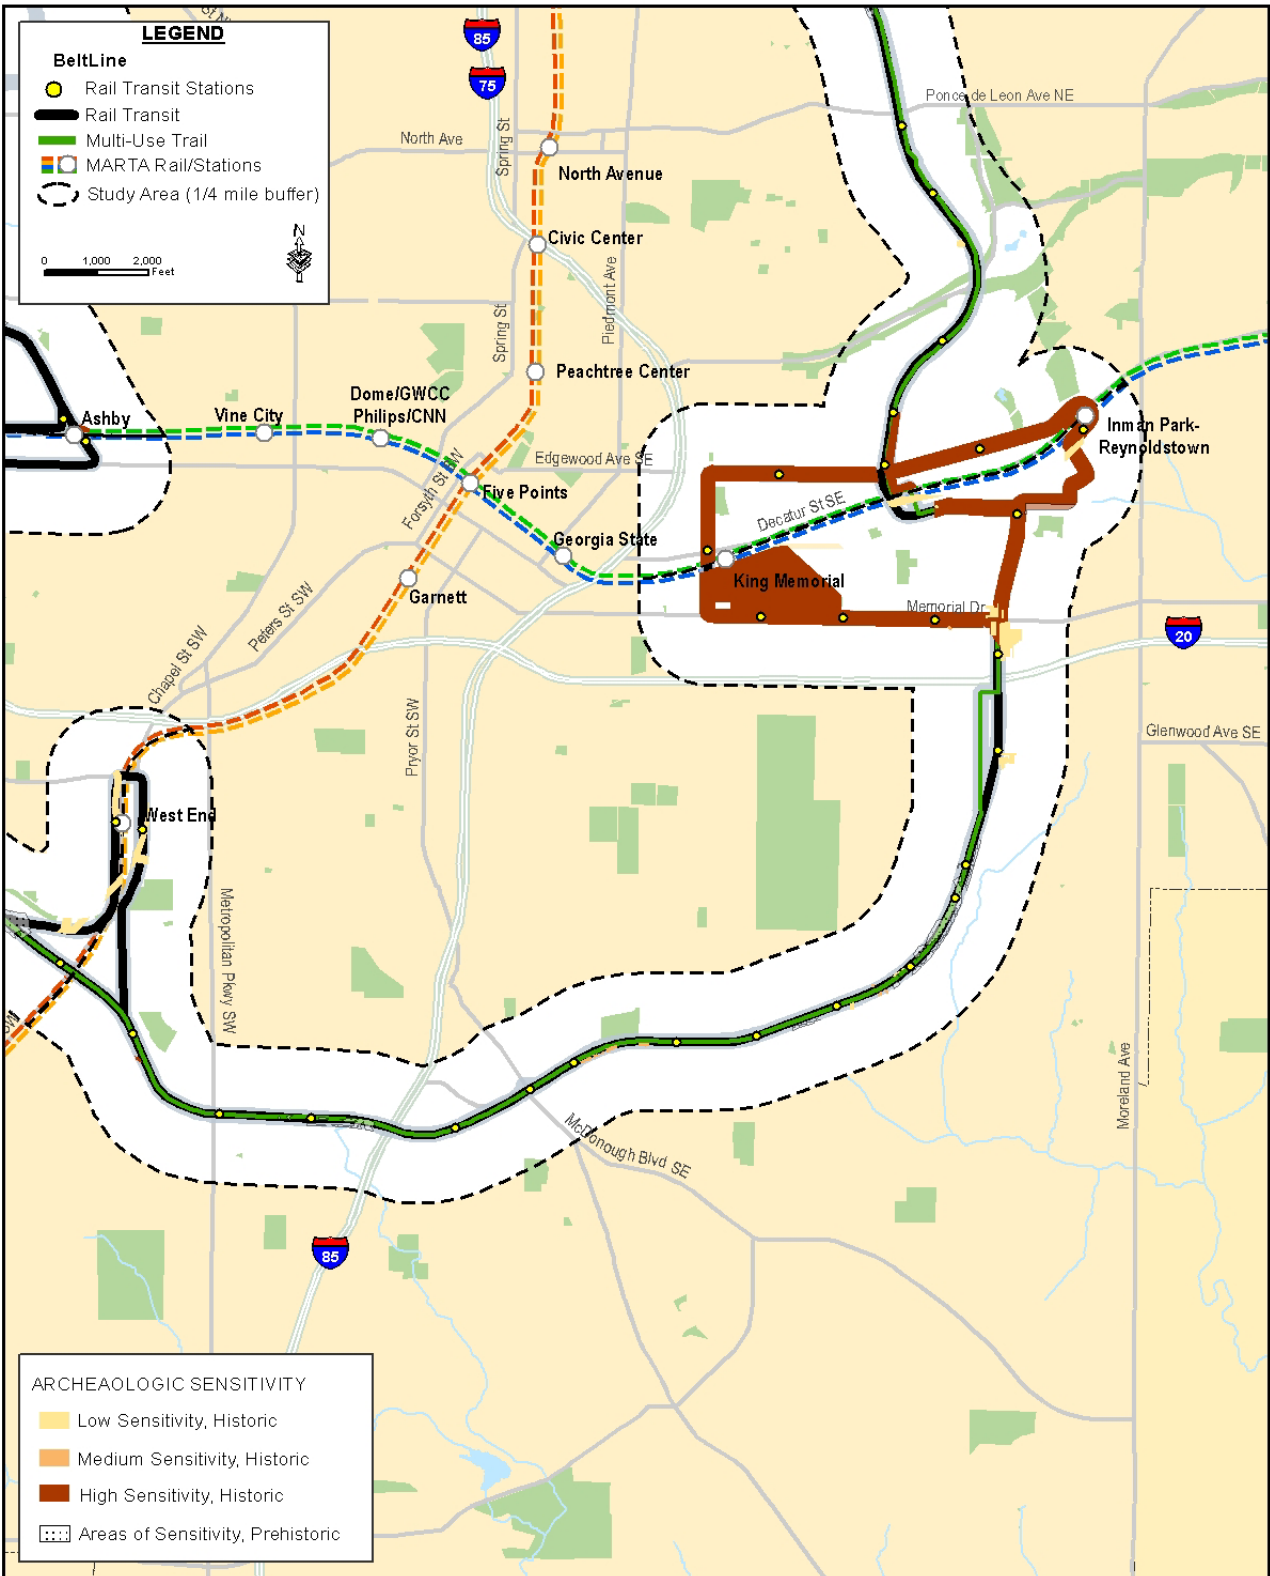

Sources: NRHP, GRHP, AUCD, and ARC.

3.0 Affected Environment Section 3.6 Cultural Resources and Archaeological Resources

Figure 3.6-1c: Archaeological Sensitivity Areas (Southwest Zone)

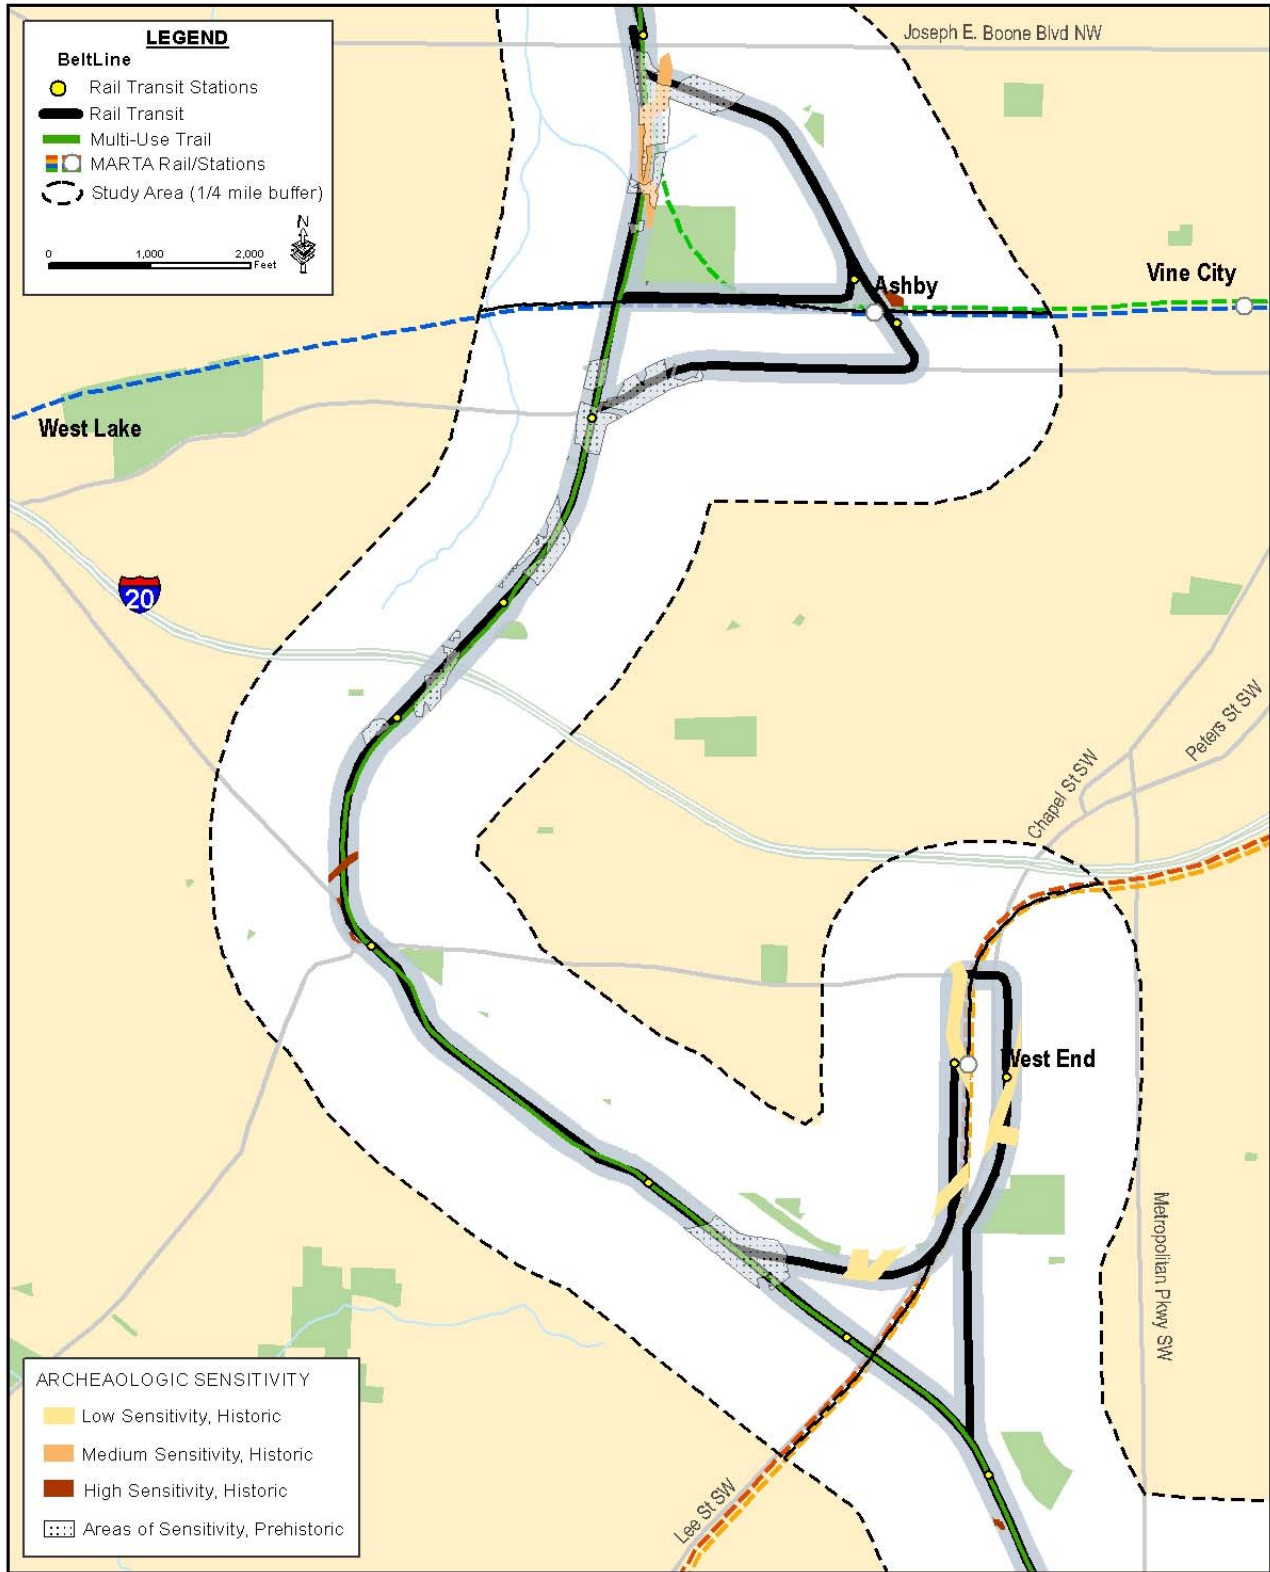

Sources: NRHP, GRHP, AUDC, and ARC.

3.0 Affected Environment
Section 3.7 Parks and Recreational Resources

Table 3.7-1: Parks and Recreational Resources

Park Name	Address	Classification	Total Park Acreage	Acreage within 150-foot buffer	Acreage within ¼ mile study area
Northeast Zone					
Ansley Park	Maddox Drive / East Park Lane NE	Neighborhood Park	6.11	-	1.34
Avery-East Park Lane Triangle	Avery Drive / East Park Lane NE	Garden Park	0.05	-	0.05
Beverly-Avery Triangle	Beverly Road / Montgomery Ferry Drive NE	Garden Park	0.08	-	0.08
Beverly-Polo Triangle	Beverly Road / Polo Drive NE	Garden Park	0.02	-	0.02
Delta Park	Edgewood Avenue /Delta Place NE	Garden Park	0.22	0.22	0.22
Dobbs Park		Community Park	0.18	-	0.18
Freedom Park	Moreland Avenue / North Avenue	Regional Park	120.26	1.55	55.56
Maddox-Avery Triangle	Maddox Drive /East Park Lane NE	Garden Park	0.05	-	0.05
McClatchey Park	Avery Drive /Westminster Drive NE	Neighborhood Park	4.91	-	4.91
Montgomery Ferry-Golf Circle Triangle	Montgomery Ferry Road / Golf Circle NE	Garden Park	0.02	-	0.02
Historic Fourth Ward Park	Morgan Street / Dallas Street	Neighborhood Park	17.79	0.91	16.21
Piedmont-Avery Triangle	Piedmont Road / Elliot Circle NE	Garden Park	0.04	-	0.04
Piedmont Heights Park	400 Park Drive NE	Garden Park	0.03	-	0.03
Piedmont Park	400 Park Drive NE	Regional Park	170.95	7.42	117.52
Prado-Piedmont Beauty Spot	The Prado /Piedmont Road NE	Garden Park	0.12	-	0.12
Selena S. Butler Park*	98 William Holmes Borders Drive NE	Neighborhood Park	3.63	1.46	3.63
Smith Park	1571 Piedmont Avenue NE / 1547 Monroe Drive	Garden Park	0.41	-	0.41
Springvale Park	Euclid Avenue / Waverly Way NE	Neighborhood Park	4.27	0.57	4.27
Southeast Zone					
Adair Park I	742 Catherine Street SW	Neighborhood Park	6.22	-	6.22
Adair Park II	866 Murphy Avenue SW	Neighborhood Park	10.01	1.40	10.01
Bonnie Brae Park	Tift Avenue /Bonnie Brae Avenue SW	Garden Park	0.22	-	0.22
Boulevard Crossing	1179 Boulevard SE	Neighborhood Park	22.01	0.77	21.58
Cabbagetown Park	701 Kirkwood Avenue SE	Neighborhood Park	3.66	-	3.66
Daniel Stanton Park	213 Haygood Avenue SE	Neighborhood Park	8.12	1.20	8.12
Dill Avenue Park	Manford Road / Mellview Avenue SE	Garden Park	0.09	-	0.09
Esther Peachey Lefever Park	Wylie Street /Powell Street SE	Block Park	0.70	-	0.70
Hill Triangle	Hill Street / Memorial Drive SE	Garden Park	0.07	-	0.07
Lang-Carson Park*	100 Flat Shoals Avenue SE	Neighborhood Park	3.20	-	3.20
Manigault Street Playlot	1000 Manigault Street SE	Community Park	0.22	-	0.22
Rawson-Washington Park	Connally Street / Kelly Street NE	Neighborhood Park	4.48	-	0.14
South Atlanta Park	Gammon Street SE / Bisbee Avenue	Neighborhood Park	5.53	-	1.15
Southwest Zone					
Atwood Street Park	Atwood Street /White Street SW	Garden Park	0.05	-	0.05
Enota Place Playlot	Enota Place / Sells Avenue SW	Block Park	0.16	-	0.16
Gordon-White Park	Gordon Street / White Street SW	Garden Park	1.85	0.08	1.85
Green Leaf Circle	Next to 202 Napoleon Drive SW (off Westview Drive)	Garden Park	0.99	0.29	0.99
Napoleon Circle	Napoleon Drive SW	Garden Park	0.05	0.05	0.05
Queen and White Beauty Spot	Queen Street / White Street SW	Garden Park	0.04	-	0.04
Rose Circle Park	Rose Circle / White Street SW	Community Park	2.85	0.036	2.85
Rose Circle Triangle	Rose Circle / Lee Street SW	Garden Park	0.21	0.21	0.21

3.0 Affected Environment
Section 3.7 Parks and Recreational Resources


Park Name	Address	Classification	Total Park Acreage	Acreage within 150-foot buffer	Acreage within ¼ mile study area
South Gordon Triangle	South Gordon Street / Ralph David Abernathy Boulevard SW	Garden Park	0.01	0.01	0.01
Stafford Street Circle	14 Stafford Street NW (near Oleander Street NW)	Garden Park	0.04	-	0.04
Stafford Street Park	Stafford Street / Jasper Street SW	Garden Park	0.12	0.12	0.12
Willard and Gordon Park	Willard Avenue / S. Gordon Street	Garden Park	0.07	-	0.07
Northwest Zone					
25th Street Beauty Spot	25th Street, Alden Avenue/ Standish Ave NW	Garden Park	0.11	-	0.11
Ardmore Park	Ardmore Road off Collier Road	Block Park	1.68	0.45	1.68
Ashby Circle Playlot	Ashby Circle off Mayson Turner Road NW	Block Park	0.87	-	0.87
Ashby Triangle	Ashby Circle NW / Ashby Terrace NW	Garden Park	0.04	-	0.04
Bobby Jones Golf Course	384 Woodward Way NW	Community Park	149	11.65	74.35
Knight Park	1194 Church Street NW	Neighborhood Park	2.68	-	2.68
Loring Heights Park	Loring Drive / Garden Lane NW	Neighborhood Park	1.94	-	1.94
Maddox Park	1115 Donald Lee Hollowell Parkway NW / Marietta Boulevard	Community Park	53.16	19.48	53.16
Mayson Turner-Ashby Street Triangle	Joseph E. Lowery Boulevard NW / Lena Street (at Ashby MARTA rail station)	Community Park	1.27	1.27	1.27
Peachtree Hills Park*	308 Peachtree Hills Avenue NE	Neighborhood Park	7.51	-	7.00
Spring Valley Park	Spring Valley Road /Meredith Drive	Conservation Park	3.55	-	1.86
Tanyard Creek Park	Collier Road /Walthall Drive NW	Community Park	16.82	11.17	16.82
Washington Park*	102 Ollie Street /Lena Street	Community Park	19.92	5.22	19.92

*Denotes a recreation center in the park

Source: City of Atlanta Department of Parks, Recreation, & Cultural Affairs

3.0 Affected Environment Section 3.7 Parks and Recreational Resources


Figure 3.7-1a: Parks (Northeast Zone)

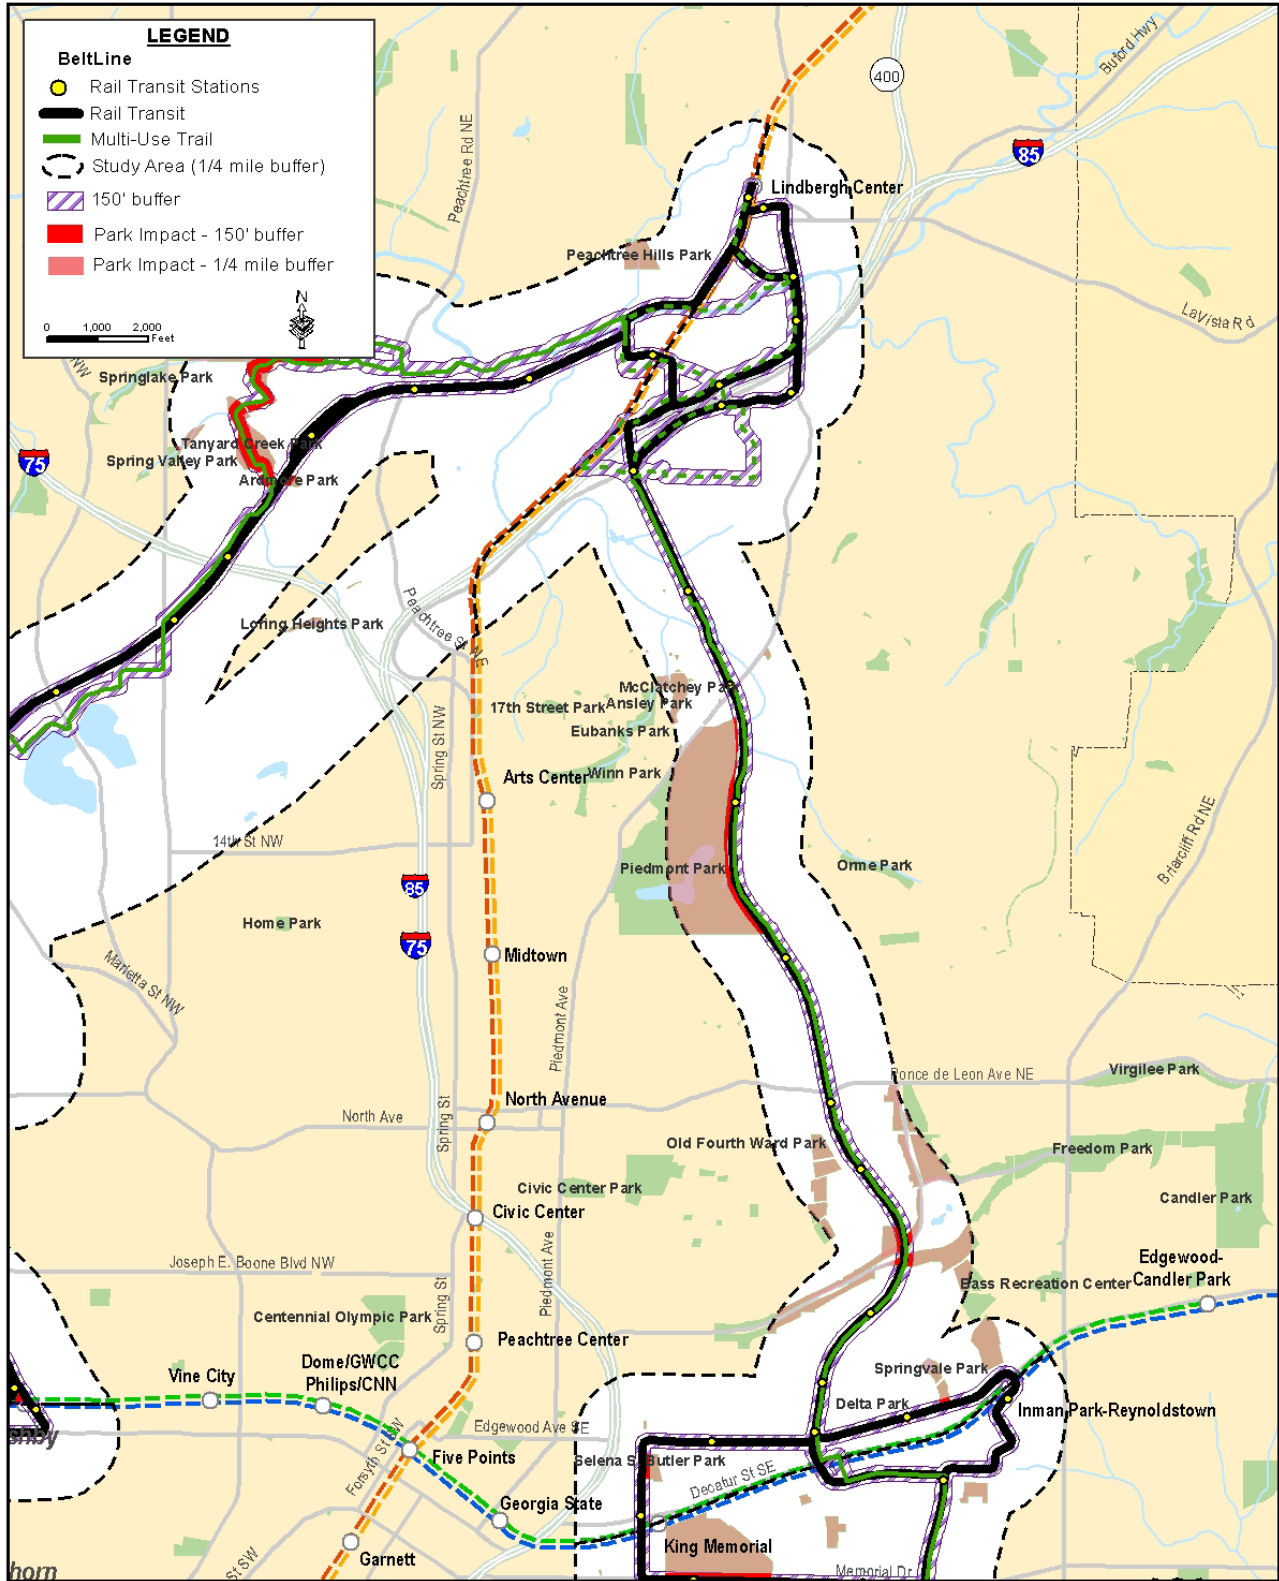

Source: City of Atlanta, Office of Parks, Recreation & Cultural Affairs

3.0 Affected Environment Section 3.7 Parks and Recreational Resources


Figure 3.7-1c: Parks (Southwest Zone)

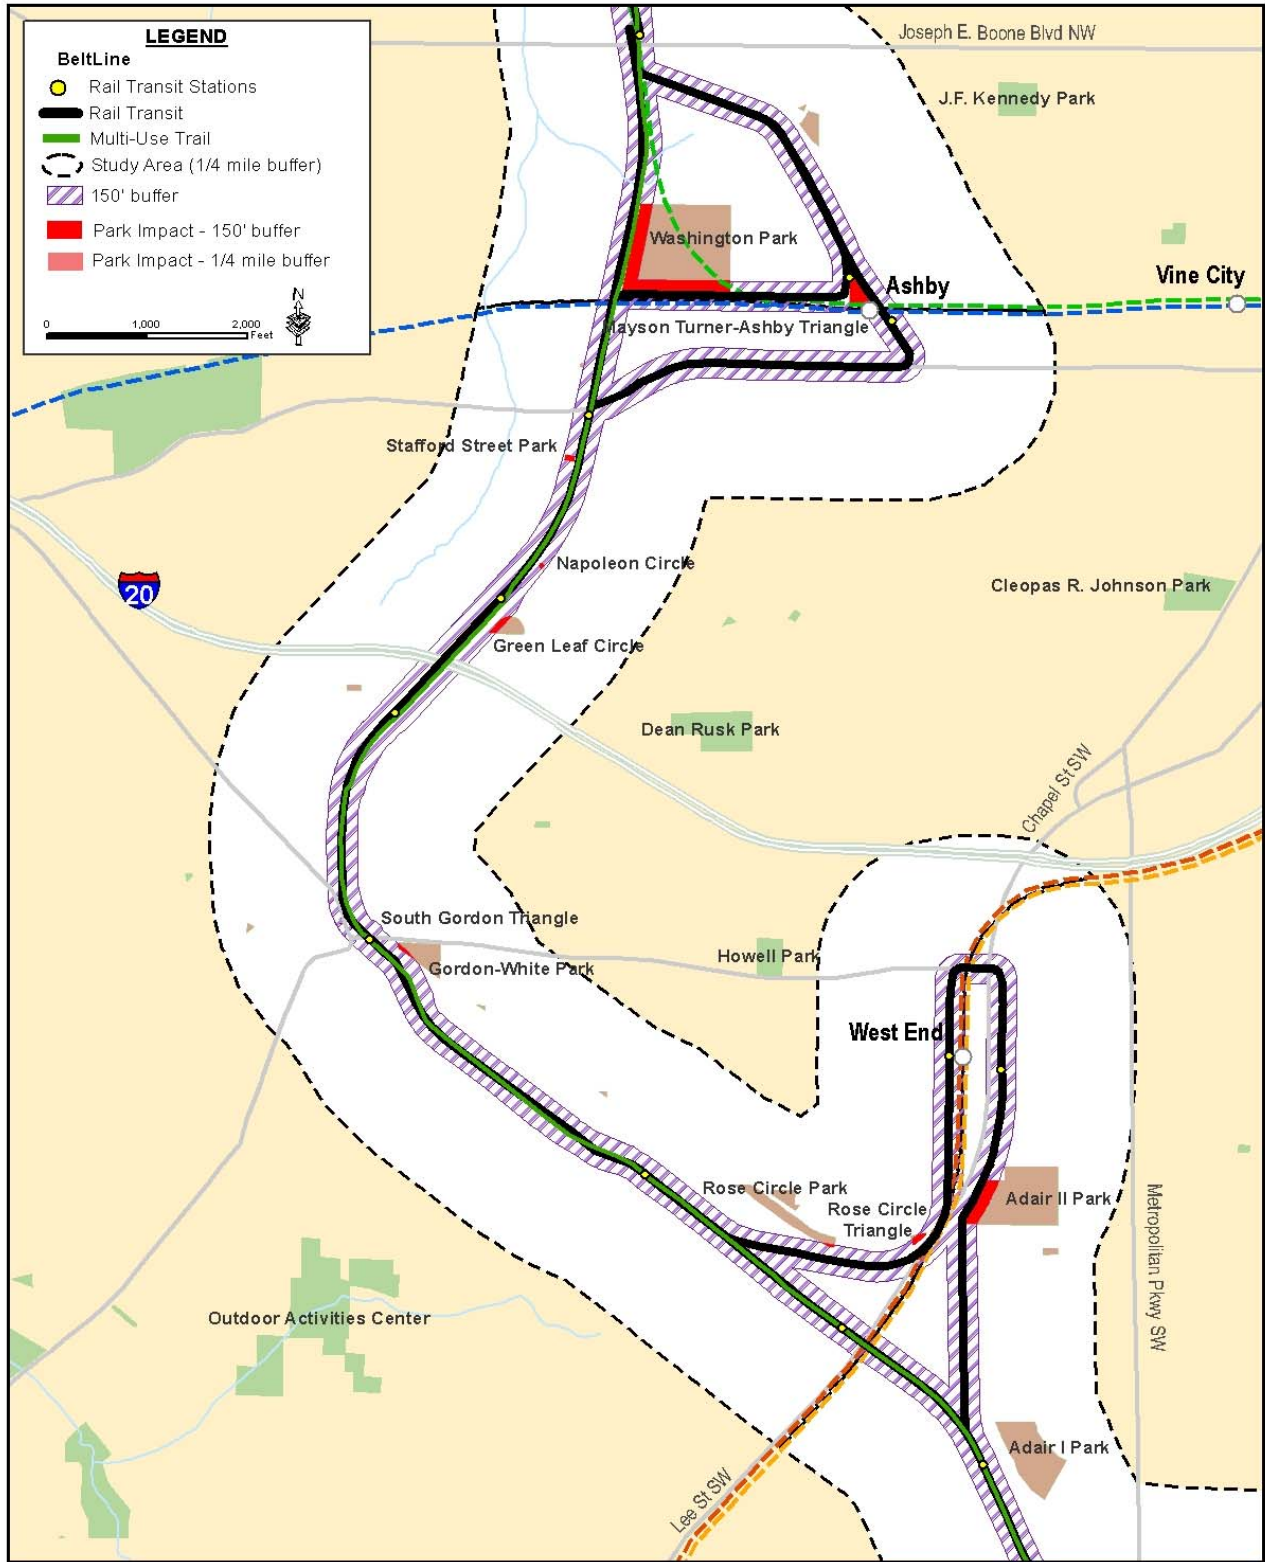

Source: City of Atlanta, Office of Parks, Recreation & Cultural Affairs

3.0 Affected Environment Section 3.7 Parks and Recreational Resources

Figure 3.7-1d: Parks (Northwest Zone)

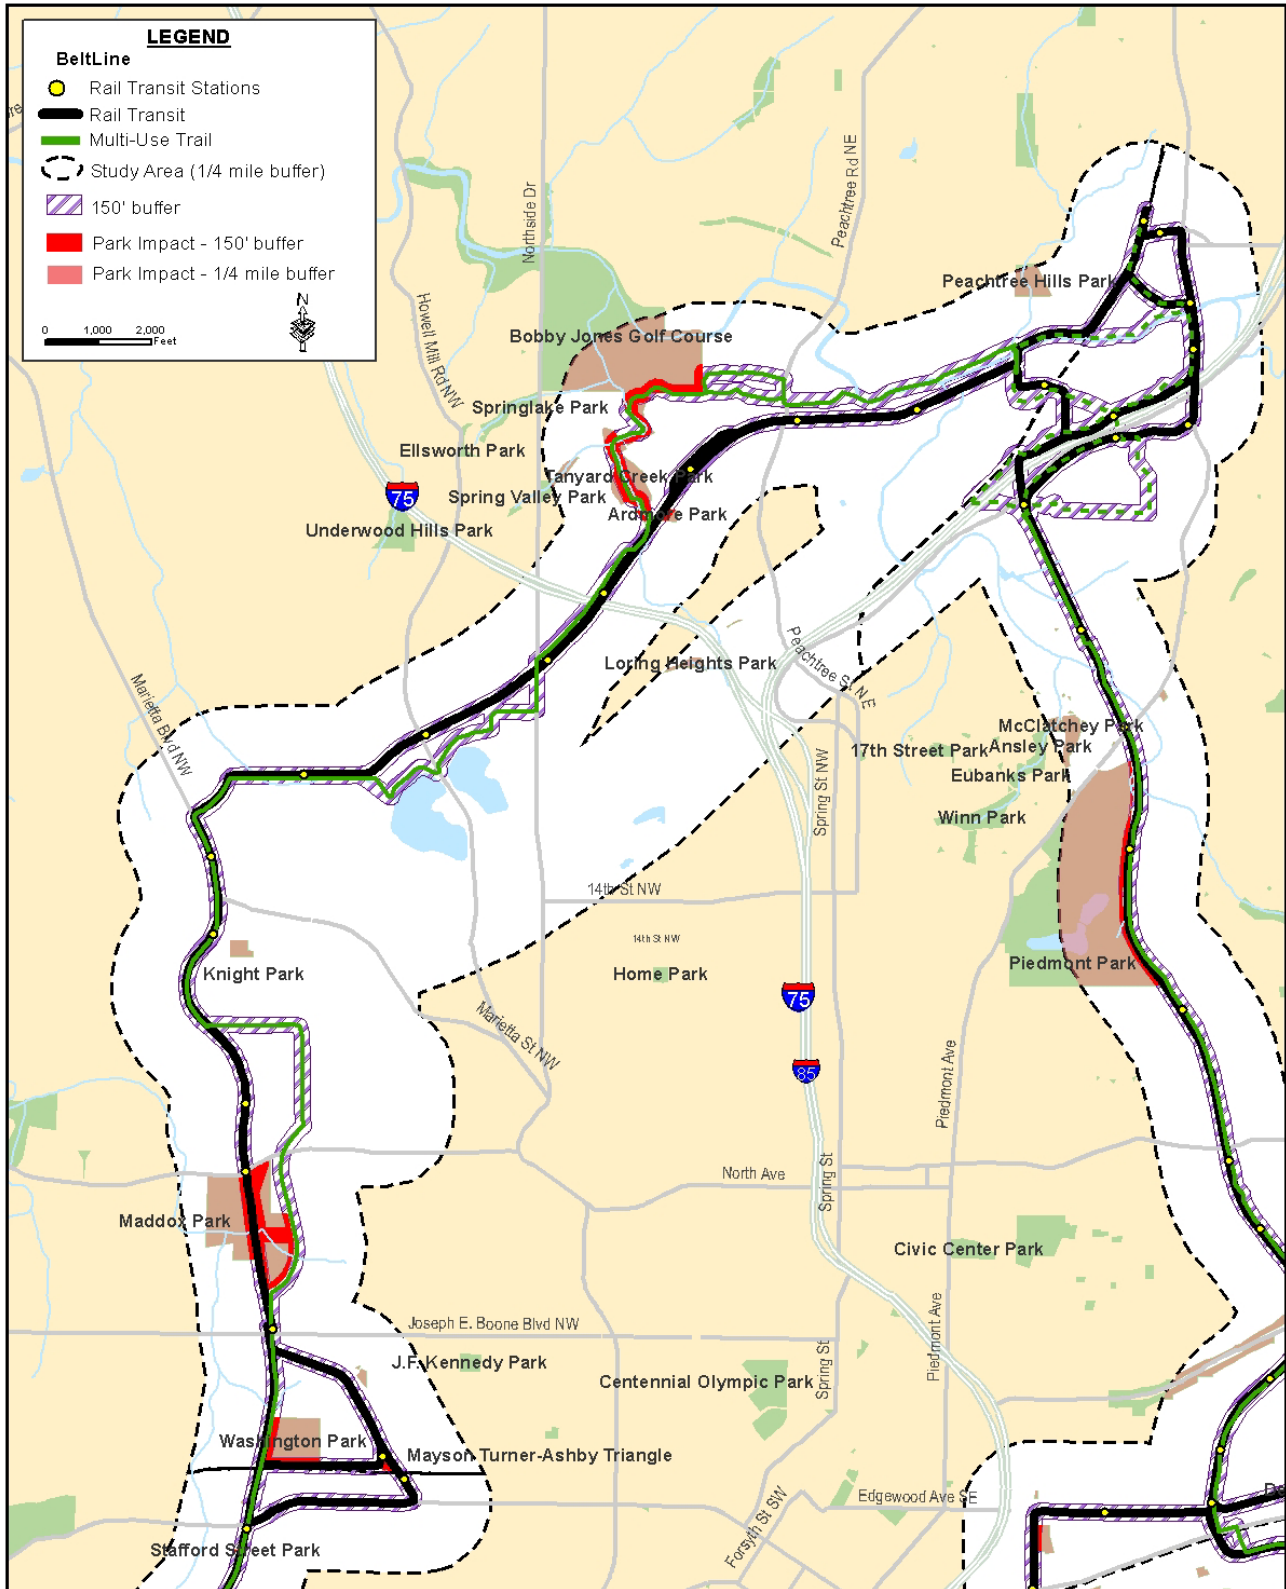

Source: City of Atlanta, Office of Parks, Recreation & Cultural Affairs

3.0 Affected Environment
Section 3.9 Contaminated and Hazardous Materials

Table 3.9-1a: Preliminary Contaminated Sites and/or Hazardous Materials Sites Within 300-Foot Buffer Area (Northeast Zone)

Final REC ID No.	EDR Ref. No.	Site Name/Owner	Address/Location	Database(s)	Facility/Case ID No.	Comments/Area of Concern(s)
NE-1	8	MARTA LINDBERGH STATION (NNP)	2420 PIEDMONT ROAD NE	TIER 2	FATR200724KS4708BQFG	Date Tier 2 Signed: 2/20/2008.
NE-2	6	MARTA HEADQUARTERS	2424 PIEDMONT ROAD NE	RCRA-CESQG	GAD981268691	Conditionally Exempt Small Quantity Generator. No violations found.
				FINDS	1000395161	FINDS provides a single point of access for sites regulated or monitored by the EPA.
	8	MARTA WACHOVIA (HQ ANNEX)	2400 PIEDMONT ROAD NE	TIER 2	FATR20073J9LNK00X45Q	Date Tier 2 Signed: 2/20/2008.
				LUST	600198	5/14/2003 and 06/16/1998: Confirmed Releases-No Further Action (NFA).
NE-3	10	HOME DEPOT HD0176	515 GARSON DRIVE	RCRA-NonGen	GAR000037796	Non-Generators do not presently generate hazardous waste. No Violations Found.
		SAM'S CLUB #6643	515 GARSON DRIVE NE	ICIS	04-2000-0161	Civil Judicial Action.
				FINDS	1007465126	FINDS provides a single point of access for sites regulated or monitored by the EPA.
NE-4	7	LINDBERGH DRIVE & PEACHTREE HILLS AVENUE	Corner of Lindbergh Dr and Peachtree Hills	UST	10000784	Status not reported.
	7	MONOCLONAL TECHNOLOGY	Peachtree Hills at Lindbergh Dr	SPILLS	S101530561 [†]	Spill Date: 01/10/1995.
NE-5	9	ALLIED READYMIX INC-PLANT #63	469 PEACHTREE HILLS AVENUE	UST	09060530	11/06/2002: Removed (1) 8,000-gal. Diesel UST.
				LUST	09060530	11/20/2002, Confirmed Release-NFA.
				ICIS	04-2003-2011	EPCRA 325 Action For Penalty.
				SPILLS	S103538486 [†]	Cement Dust, Nancy and Peachtree Creeks.
	NA	ALLIED READYMIX, INC.		AIRS	041312100023	FINDS provides a single point of access for sites regulated or monitored by the EPA. State Facility Identifier: 312100023.
NE-6	17	READY MIX USA, LLC	340 Armour Dr NE	FINDS	1010462741	AFS - AIRS Facility.
	17	FLEET TRANSPORT CO INC	340 ARMOUR DRIVE	LUST	600184	10/7/1993 and 12/3/1996: Confirmed releases-NFA.
				UST	600184	Removed (1) 6,500-gal gas and (1) 10,000-gal Diesel USTs. Date not provided.
				RCRA-NonGen	GAD042875856	Non-Generators do not presently generate hazardous waste. No violations found.
				FINDS	1000223652	FINDS provides a single point of access for

3.0 Affected Environment
Section 3.9 Contaminated and Hazardous Materials

Final REC ID No.	EDR Ref. No.	Site Name/Owner	Address/Location	Database(s)	Facility/Case ID No.	Comments/Area of Concern(s)
						sites regulated or monitored by the EPA.
	17	(CSX YARD) 340 ARMOUR DRIVE NE	340 ARMOUR DRIVE NE	HMIRS	98010710	12/16/1997: 20 gals of Sulfuric Acid spilled.
				SPILLS	S102329069 [†]	Spill Date: 06/13/1996. Ferric Chloride.
				HMIRS	97020863	11/8/1997: 500 gals of Sulfuric Acid.
				HMIRS	96061282	06/13/1996: 3,375 gals of Ferric Chloride. Bottom center of rail car (GATX 61121) began leaking.
				HMIRS	94090015	8/15/1994: 10 gal of Ferric Chloride. Discharge line on rail car cracked internally near top of car.
				ERNS	96495582	6/13/1996: Rail car developed a crack on car.
NE-7	17	SIGNAL MOUNTAIN CEMENT COMPANY	348 Armour Dr	AIRS	041312100179	State Facility Identifier: 312100179.
				FINDS	1005831059	FINDS provides a single point of access for sites regulated or monitored by the EPA.
		GENERAL PORTLAND INC	348 Armour Dr	AIRS	041312100501	State Facility Identifier: 312100501.
				FINDS	1004463157	FINDS provides a single point of access for sites regulated or monitored by the EPA.
		BUZZI UNICEM USA	348 Armour Dr NE	TIER 2	FATR20074VZWDY0027TL	Date Tier 2 Signed: 1/10/2008.
NE-8	17	Lafarge Bldg Materials INC	342 Armour Dr	UST	600857	(2) 10,000-gal diesel USTs in use.
		Armour Dr Concrete Plant	342 Armour Dr	TIER 2	FATR200724KSU5002WZW	Date Tier 2 Signed: 2/15/2008.
NE-9	15	MARTA ARMOUR DEMO PROJECT	468 ARMOUR CIRCLE NE	RCRA-NonGen	GAD984321539	Non-Generators do not presently generate hazardous waste. No violations found.
				FINDS	1000860306	FINDS provides a single point of access for sites regulated or monitored by the EPA.
	NA	MARTA RAIL SERVICE FACILITY (CN451)	ARMOUR CIRCLE	GA NON-HSI	S105174708 [†]	Report Date: 10/1/2001. Contamination: Lead.
NE-10	16	500 PLASAMOUR DRIVE	500 PLASAMOUR DRIVE	ERNS	2005632652	12/13/2005: 10 or more gallons of gear oil entered a storm drain and a sheen reached Peachtree Creek next to the facility.
	NA	MARTA	500 PLASAMOUR DRIVE	TIER 2	FATR20075N42XK00EE3L.	Date Tier 2 Signed: 2/20/2008.
				SPILLS	S107493179 [†]	Date Recieved 12/14/2005: 16 gallons of Gear Oil spilled into Peachtree Creek.
NE-11	16	490 PLASAMOUR	490 PLASAMOUR DRIVE	SPILLS	S105712481 [†]	Spill Date: 02/25/2001. 395 gallons of sewage spilled into Peachtree Creek.
NE-12	16	GRACO INC	460 PLASAMOUR DRIVE	RCRA-NonGen	GAD045473121	Non-Generators do not presently generate hazardous waste. No violations found.
NE-12	16			FINDS	1000176469	FINDS provides a single point of access for sites regulated or monitored by the EPA.
NE-13	20	ATLANTA SEWER DEPT	500 PLASTER	SPILLS	S104000870 [†]	Spill Date: 01/22/1999. Raw Sewage,

3.0 Affected Environment
Section 3.9 Contaminated and Hazardous Materials

Final REC ID No.	EDR Ref. No.	Site Name/Owner	Address/Location	Database(s)	Facility/Case ID No.	Comments/Area of Concern(s)
			AVENUE			Peachtree Creek.
NE-14	19	FORMER PLASTER GAS & FOOD	496 PLASTER AVENUE	LUST	09000379	7/21/1989: Confirmed Release Received-NFA.
				FINDS	1006790353	FINDS provides a single point of access for sites regulated or monitored by the EPA.
				UST	9000379	(4) 4,000-gal gas USTs and (2) 500 waste oil USTs removed in 7/1989. (3) 10,000-gal gas, (1) 10,000-gal diesel, (1) 500-gal used oil USTs installed 9/1989.
		SHELL GAS STATION	FIELD SURVEY	NA	Field recon indicated current operating gas station with multiple USTs and pump dispensers.	
NE-15	19	MARTA EP&E DEMOLITION	1428 MAYSON STREET	RCRA-NonGen	GAR000030908	Small Quantity Generator. No violations found.
				FINDS	1007219396	FINDS provides a single point of access for sites regulated or monitored by the EPA.
NE-16	19	GEORGIA POWER	1420 MAYSON STREET NE	SPILLS	S104252727 [†]	Spill Date: 07/19/1999, 1 gallon into Storm Drain.
				ERNS	99641596	07/19/1999: Vandalism / overhead pole-mounted transformer. 30 gal spilled. 1 gal in Creek.
NE-17	19	K&M INCORPORATED	441 Armour PI NE	SPILLS	S101534866 [†]	Spill Date: 01/23/1991, Peachtree Creek.
NE-18	19	LAW ENGINEERING	396 PLASTERS AVENUE	SPILLS	S108468854 [†]	1/22/2007: Spill report of 1/2 to 5 grams of Mercury.
				RCRA-SQG	GAD981269640	Small Quantity Generator. No violations found.
				ERNS	2007824369	1/22/2007: 6 Grams of Mercury spilled.
				FINDS	1000112498	FINDS provides a single point of access for sites regulated or monitored by the EPA.
NE-19	19	CERTIFIED PARTS AND SERVICE COMPANY	1386 MAYSON STREET NE	RCRA-NonGen	GAD004811246	Small Quantity Generator. No violations found.
				FINDS	1000411585	FINDS provides a single point of access for sites regulated or monitored by the EPA.
NE-20	24	215 OTTLEY DRIVE NE	215 Ottley Dr NE	HMIRS	2005030677	3/9/2005: Spillage.
NE-21	24	NATIONAL STARCH & CHEMICAL CORP	195 Ottley Dr NE	UST	600002	06/01/1988: Removed (1) 7,500-gal heating oil UST.
				GA NON-HSI	S105872311 [†]	Information not provided.
	24	PEACH STATE VALET	195 OTTLEY DRIVE NE	CERC-NFRAP	0401301	Not on the NPL. Preliminary Assessment (PA) 05/20/1986 - NFRAP.
				RCRA-NonGen	GAD001884220	Non-Generators do not presently generate

3.0 Affected Environment
Section 3.9 Contaminated and Hazardous Materials

Final REC ID No.	EDR Ref. No.	Site Name/Owner	Address/Location	Database(s)	Facility/Case ID No.	Comments/Area of Concern(s)
				FINDS	1000259928	hazardous waste. No violations found. FINDS provides a single point of access for sites regulated or monitored by the EPA.
NE-22	NA	ACTIVE/FORMER RR TRACKS	ACTIVE/FORMER RR TRACKS	FIELD SURVEY	NA	Former railroad operations; potential for former and undocumented spills and releases. Potential polychlorinated biphenyls (PCBs), metals, semi-volatile organic compounds (SVOCs), herbicides and pesticides, lead-based paint and asbestos containing building materials on/in relic equipment or structures.
NE-23	28	Ansley Mall Shopping Ctr.	PIEDMONT AVENUE @ MONROE DRIVE	GA NON-HSI	S103439746 [†]	Ground Water Pathway Score: 8.1.
	29	ATLANTA SEWER DEPT		SPILLS	S104001296 [†]	Spill Date: 04/16/1999. Sewage, Clear Creek.
	29	CITY OF ATLANTA		SPILLS	S104885239 [†]	Spill Date: 04/04/1996. Raw Sewage, Clear Creek.
				SPILLS	S104885222 [†]	Spill Date: 01/26/1999. Raw Sewage, Clear Creek.
	29	ANSLEY MALL CLEANERS	1544 PIEDMONT ROAD	RCRA-CESQG	GAD984321604	Conditionally Exempt Small Quantity Generator. No Violations Found.
				DRYCLEANERS	404153	Sic Code: 721201.
				FINDS	1004687315	FINDS provides a single point of access for sites regulated or monitored by the EPA.
	29	CITY OF ATLANTA	1544 PIEDMONT AVENUE NE	SPILLS	S104885465 [†]	Spill Date: 07/14/1997. 3,000 gals sewage in Tanyard Creek.
				SPILLS	S104884949 [†]	Sewage, Tanyard Creek.
	29	PIER 1 IMPORTS	1544 Piedmont Ave	FINDS	1004460269	National Compliance Data Base.
29	The Laundry Lounge Inc.	1544 Piedmont Ave #406	DRYCLEANERS	405365	Annual Perc Usage in Gallons: 65.	
NE-24	32	PIEDMONT CLEANING CENTER	1510-A-B Piedmont Rd	DRYCLEANERS	405669	Annual Perc Usage in Gallons: 139.9.
NE-25	32	WEST DISTRIBUTOR SALES/ASSOCIATE	1491 PIEDMONT AVENUE NE	LUST	00600860	10/8/1993: Confirmed Release-NFA.
				UST	00600860	10/07/1993: Removed (1) 2,000-gal diesel UST and (1) 6,000-gal diesel USTs.
				FIELD SURVEY	NA	08/17/2008 Field survey indicated property is vacant.
NE-26	33	DIXIE PLYWOOD CO OF ATLANTA	268 WESTMINSTER DRIVE	UST	600573	5/27/1987: (1) 2,000-gal diesel UST removed.
				FIELD SURVEY	NA	08/17/2008 Field survey indicated property is storage center.
NE-27	34	ABANDONED INDUSTRIAL SITE	586 WORCHESTER DRIVE	LUST	09060301	8/26/1993 and 02/09/1993: Confirmed Releases-NFA.

3.0 Affected Environment
Section 3.9 Contaminated and Hazardous Materials

Final REC ID No.	EDR Ref. No.	Site Name/Owner	Address/Location	Database(s)	Facility/Case ID No.	Comments/Area of Concern(s)
				UST	09060301	3/2/1994: Gas UST Removed.
				FIELD SURVEY	NA	08/17/2008 Field survey indicated redevelopment started.
NE-28	38	1024 MONROE DRIVE	1024 Monroe Dr.	GA NON-HSI	S108782039 [†]	Contamination: Carbon disulfide.
NE-29	NA	Corridor BeltLine Property	Monroe Dr – 10 th St.	BROWNFIELDS	S107780974 [†]	Response Actions Planned (Non-HSI).
NE-30	40	E L THOMPSON & SON INC	600 VIRGINIA AVENUE NE	LUST	00600691	1/22/1996: Confirmed Release-NFA
				UST	00600691	11/22/1995: (1) 2,000-gal gas UST removed.
NE-31	40	Virginia Highlands Community	609 VIRGINIA AVENUE	GA NON-HSI	S109016322 [†]	Report Date: 2/15/2008.
NE-32	41	GA POWER CO METRO TMC	930 PONCE DE LEON PLACE NE	LUST	00600736	7/8/1994: Confirmed Release-NFA.
				UST	00600736	Removed (1) 10,000-gal diesel and (1) 10,000-gal gas USTs. Date not provided.
				GA NON-HSI	1000349226	Contamination: Benzo(b)fluoranthene.
				RCRA-NonGen	GAD000612515	Handler: Non-Generators do not presently generate hazardous waste. No violations found.
				FINDS	1000349226	FINDS provides a single point of access for sites regulated or monitored by the EPA.
	43	GA POWER CO CENTRAL DISTRICT HQTRS	890 PONCE DE LEON PLACE	LUST	00600728	1/4/1996: Confirmed Release-NFA.
				UST	00600728	5/23/1990: (1) 6,000-gal gas UST removed. 08/14/1992, (1) 550-gal used oil UST removed. 02/08/1994, (1) 10,000-gal gas UST removed. 05/23/1990, (1) 10,000-gal diesel UST removed. 01/15/1996, (1) 6,000-gal gas UST closed in place.
				CERC-NFRAP	0401247	Not on the NPL. Preliminary Assessment Completed: 09/01/1982. NFRAP.
				GA NON-HSI	1000349209	Report Date: Not reported.
				RCRA-NonGen	GAD000612507	Handler: Non-Generators do not presently generate hazardous waste. No violations found.
				FINDS	1000349209	FINDS provides a single point of access for sites regulated or monitored by the EPA.
NE-33	45	DIVERSIFIED METAL FABRICATORS	665 PYLANT STREET NE	FINDS	1007213420	FINDS provides a single point of access for sites regulated or monitored by the EPA.
				RCRA-NonGen	GAR000017400	Handler: Non-Generators do not presently generate hazardous waste. No violations found.
NE-34	48	LITHOPLATES INC	742 PONCE DE LEON PLACE	RCRA-NonGen	GAD003272275	Handler: Non-Generators do not presently generate hazardous waste. No violations

3.0 Affected Environment
Section 3.9 Contaminated and Hazardous Materials

Final REC ID No.	EDR Ref. No.	Site Name/Owner	Address/Location	Database(s)	Facility/Case ID No.	Comments/Area of Concern(s)	
						found.	
				FINDS	1000243717	FINDS provides a single point of access for sites regulated or monitored by the EPA.	
NE-35	48	DAVIS & DAVIS INC	726 PONCE DE LEON PLACE NE	LUST	00600431	11/10/1998: Suspected Release-NFA. 11/19/1998: Confirmed Release-NFA.	
				UST	00600431	11/10/1998: (1) 1,000-gal gas UST removed.	
				FIELD SURVEY	NA	08/17/2008 Field survey indicated property under demolition.	
NE-36	50	THE HOME DEPOT #0159	650 PONCE DE LEON	TIER 2	FATR20077a390cfba04b	Date Tier 2 Signed: 02/25/2008.	
				RCRA-SQG	GAR000037697	Small Quantity Generator. No violations found.	
				FINDS	1007733215	FINDS provides a single point of access for sites regulated or monitored by the EPA.	
	50	MIDTOWN PLACE	650 PONCE DE LEON AVENUE NE	LUST	09060782	09/08/1999: Confirmed Release-NFA.	
				UST	09060782	08/05/1999: Removed (1) 3,000-gal used oil UST.	
NE-37	50	SEARS ROEBUCK & CO INC	675 PONCE DE LEON AVENUE NE	AIRS	041312100094	State Facility Identifier: 312100094.	
				FINDS	1004462373	FINDS provides a single point of access for sites regulated or monitored by the EPA.	
		50		CITY OF ATLANTA/BUREAU OF MOTOR	RCRA-NonGen	GAR000022848	Handler: Non-Generators do not presently generate hazardous waste. No violations found.
					LUST	9060297	9/16/2005: Suspected Release-NFA. 08/06/1993: Confirmed Release-NFA.
					UST	9060297	12/1/1993: Removed (1) gas UST and installed (2) 12,000-gal gas USTs.
					FINDS	1004688266	FINDS provides a single point of access for sites regulated or monitored by the EPA.
		50		J & M TRUCK KLEEN	SPILLS	S101531351 [†]	Spill Date: 01/26/1993 Hazardous Material.
			GA NON-HSI	Not Provided	Contamination: Vinyl Chloride.		
NE-38	51	FORD FACTORY SQUARE SITE	699 PONCE DE LEON AVENUE	GA NON-HSI	S104819395 [†]	Contamination: Tetrachloroethene; Trichloroethene; Cis-1,2-dichloroethylene.	
	51	A CLEANER IMAGE	699 PONCE DE LEON AVENUE SUITE 17	RCRA-NonGen	GAD981270671	Handler: Non-Generators do not presently generate hazardous waste. No violations found.	
				FINDS	1000279663	FINDS provides a single point of access for sites regulated or monitored by the EPA.	
NE-39	54	ATLANTA UNIBODY COLLISION CNT	545 N ANGIER AVENUE NE	RCRA-NonGen	GAD981236268	Handler: Non-Generators do not presently generate hazardous waste. No violations	

3.0 Affected Environment
Section 3.9 Contaminated and Hazardous Materials

Final REC ID No.	EDR Ref. No.	Site Name/Owner	Address/Location	Database(s)	Facility/Case ID No.	Comments/Area of Concern(s)
						found.
				FIELD SURVEY	NA	Field survey on 8/17/2008 indicated buildings demolished.
				FINDS	1000153225	FINDS provides a single point of access for sites regulated or monitored by the EPA.
NE-40	57	GA POWER/CENTRAL DIST OP HQ	760 RALPH MCGILL BOULEVARD NE	LUST	00600727	8/29/2000: Suspected Release-NFA. 08/09/1993, Confirmed Release-NFA.
				UST	00600727	(1) 10,000-gal diesel UST in use. (1) 6,000-gal gas UST in use. 02/28/1994: (1) 10,000-gal gas UST removed.
				RCRA-NonGen	GAD981222748	Handler: Non-Generators do not presently generate hazardous waste. No violations found.
				FINDS	1000349295	FINDS provides a single point of access for sites regulated or monitored by the EPA.
				TIER 2	FATR200725M35D0CP931	Date Tier 2 Signed: 02/25/2008.
NE-41	55	A T & T	820 RALPH MCGILL BOULEVARD	FINDS	1000100619	FINDS provides a single point of access for sites regulated or monitored by the EPA.
				RCRA-NonGen	GAD980581631	Handler: Non-Generators do not presently generate hazardous waste. No violations found.
NE-42	55	NATIONAL HEALTHCARE LINEN	821 RALPH MCGILL BOULEVARD	FINDS	1001218370	FINDS provides a single point of access for sites regulated or monitored by the EPA.
				RCRA-NonGen	GAR000007005	Handler: Non-Generators do not presently generate hazardous waste. No violations found.
NE-43	NA	SHEARER TRACT	768 / 777 Highland Ave. NE (800 East Ave.)	GA NON-HSI	S105872232 [†]	Report Date: 10/1/2007. Contamination: Arsenic.
NE-44	63	TAMAX LLC	240 N HIGHLAND AVENUE	RCRA-NonGen	GAR000046987	Handler: Non-Generators do not presently generate hazardous waste. No violations found.
				FINDS	1010436700	FINDS provides a single point of access for sites regulated or monitored by the EPA.
				SPILLS	S105711765 [†]	Spill Date: 10/11/2000, Burning Metal.
				FIELD SURVEY	NA	08/17/2008 Field survey indicated condominiums present.
NE-45	62	FORMER PATTERSON LUMBER COMPANY	768 HIGHLAND AVENUE	SPILLS	S105229689 [†]	Call Date: 12/17/2001. Alleged discharge from approximately 150 abandoned drums.
				UST	600686	6/29/1993: Removed (1) 1,000-gal gas UST.

3.0 Affected Environment
Section 3.9 Contaminated and Hazardous Materials

Final REC ID No.	EDR Ref. No.	Site Name/Owner	Address/Location	Database(s)	Facility/Case ID No.	Comments/Area of Concern(s)
NE-46	65	BLACKBOX	154 KROG STREET	GA NON-HSI	S106678167 [†]	Report Date: 4/4/2004. Contamination: Tetrachloroethene and Lead.
				FIELD SURVEY	NA	08/17/2008 field visit indicate property has been converted to residences/commerical.
NE-47	69	200 KROG STREET SITE	200 KROG STREET	LUST	09060859	2/1/2002: Confirmed Release-NFA.
				UST	9060859	8/10/2001:(1) 2,000-gal gas UST removed.
				FIELD SURVEY	NA	08/17/2008 Field survey indicated property has been converted to residential.
NE-48	69	AUTOMATIC ICEMAKING CO	700 LAKE AVENUE NE	LUST	09060766	4/21/1999: Confirmed Release-NFA.
				UST	9060766	3/30/1999: Removed (1) 1,000-gal gas UST.
NE-49	69	FORMER ATLANTA STOVE WORKS	112 KROG STREET	GA NON-HSI	S104819397 [†]	Report Date: 11/1/1998. Contamination: Cis-1,2-dichloroethylene.
NE-50	72	AUBURN AVENUE WAREHOUSE	659 AUBURN AVENUE	GA NON-HSI	S103439756 [†]	Report Date: 7/1/1998. Contamination: vinyl chloride.
NE-51	75	AC WHITE TRANSFER	628-666 Edgewood Ave.	GA NON-HSI	S108630940 [†]	Report Date: 5/7/2007. Contamination: Tetrachloroethylene.
				UST	600493	12/12/1988: (1) 3,000-gal diesel UST and (1) 3,000-gal gas UST removed. 04/01/2007: (1) 560-gal used oil UST removed.
				UST	00600493	4/16/2007: Confirmed Release-NFA.
NE-52	75	ATLANTA METAL AND BATTERY	75 AIRLINE STREET SE	BROWNFIELDS	S108891726 [†]	Response Actions Planned (Non-HSI).
				SPILLS	1002870534	2/2/2000: Material not known.
				FINDS	GAD042101428	FINDS provides a single point of access for sites regulated or monitored by the EPA.
				AIRS	041312100090	State Facility Identifier: 312100090.
				CERC-NFRAP	406645	Not on the NPL. Preliminary Assessment Completed: 04/14/1998, NFRAP.
				FIELD SURVEY	NA	08/17/2008 Field Visit indicated property is vacant.
NE-53	75	ARAMARK UNIFORM SERVICES	670 DEKALB AVENUE	RCRA-SQG	GAD078118494	Small Quantity Generator. No violations found.
				LUST	00600608	1/8/1991, 01/29/1991: Confirmed Releases-NFA.
				UST	600608	09/01/1989: Removed (1) 8,000-gal gas UST and (1) 14,000-gal diesel UST. (2) other USTs closed in place.
				FINDS	1000404037	FINDS provides a single point of access for sites regulated or monitored by the EPA.
				GA NON-HSI	Not Provided	Ground Water Pathway Score: 9.1.

3.0 Affected Environment
Section 3.9 Contaminated and Hazardous Materials

Final REC ID No.	EDR Ref. No.	Site Name/Owner	Address/Location	Database(s)	Facility/Case ID No.	Comments/Area of Concern(s)
				SHWS	10704	Regulated Substances:Tetrachloroethene, Naphthalene; Cumene; trans-1,2-Dichloroethene;Xylenes; Trichloroethene; Dichloroethylene, N.O.S.
		SERVISCO INC		FINDS	1000433354	FINDS provides a single point of access for sites regulated or monitored by the EPA.
				RCRA-NonGen	GAD981224918	Handler: Non-Generators do not presently generate hazardous waste. No violations found.
	NA	ARAMARK-DEKALB AVENUE SITE	670 AND 690 DEKALB AVENUE	BROWNFIELDS	S108256293 [†]	Issue Date: 10/17/2005. Response Actions Completed (HSI Properties).
				FIELD SURVEY	NA	08/17/2008 Field survey indicated property is vacant.
NE-54	75	DEKALB AVENUE LOFTS	746 DEKALB AVENUE	UST	9060765	(1) 1,000-gal gas UST permanently out of use.
NE-55	76	NATIONAL ENGINES & PARTS CO	820 DEKALB AVENUE NE	FINDS	1000259931	FINDS provides a single point of access for sites regulated or monitored by the EPA.
				RCRA-NonGen	GAD057299935	Handler: Non-Generators do not presently generate hazardous waste. No violations found.
NE-56	76	OIL SPILL	840 DEKALB AVENUE	SPILLS	S102602549 [†]	Spill Date: 02/19/1996. Transformer Oil into Storm Drain.
NE-57	NA	LEVEL 3 COMMUNICATIONS	874 DeKalb St. – Bldg. #1	TIER 2	FATR200726DKQ700EX9B	Date Tier 2 Signed: 2/11/2008.
	76	WILTEL COMMUNICATIONS	874 DEKALB AVENUE	FINDS	1007151870	ICIS (Integrated Compliance Information System).
NE-58	76	SPRINT COMMUNICATIONS COMPANY LP	890 DEKALB AVENUE NE	UST	9060075	5/1/2001: Removed 1,000-gal Diesel UST. 03/06/2001: (1) 2,000-gal Diesel UST in use.
				FINDS	1006796165	FINDS provides a single point of access for sites regulated or monitored by the EPA.
				TIER 2	FATR20071YS5HR01H5LY	Date Tier 2 Signed: 1/31/2008.
				LUST	09060075	5/8/2001: Confirmed Release-NFA.
NE-59	74	BATHROOM DESIGNS	964 DEKALB AVENUE	FINDS	1004464017	FINDS provides a single point of access for sites regulated or monitored by the EPA.
				AIRS	041312100815	State Facility Identifier: 312100815.
NE-60	71	1055 DEKALB AVENUE NE	1055 DEKALB AVENUE NE	ERNS	2003707840	Incident date: 12/11/2003. Transportation Accident. 15 gals of Fuel Oil.
				SPILLS	S106123297 [†]	Incident date: 12/11/2003. Transportation Accident. 15 gals of Fuel Oil.
	71	MARTA INMAN PARK	1055 DEKALB	TIER 2	FATR200724KRAC075M3G	Date Tier 2 Signed: 2/20/2008.

3.0 Affected Environment
Section 3.9 Contaminated and Hazardous Materials

Final REC ID No.	EDR Ref. No.	Site Name/Owner	Address/Location	Database(s)	Facility/Case ID No.	Comments/Area of Concern(s)
		STATION (EEM)	AVENUE NE			
NE-61	77	RYDER INTERNATIONAL LOGISTICS	173 Boulevard SE (CSX RAIL YARD)	SPILLS	S102329136 [†]	Spill Date: 09/05/1996, Diesel.
	77	CSX TRANSPORTATION	173 Boulevard @ CSX Transportation	SPILLS	1001531235	Spill Date: 06/17/1999, Oily Water.
NE-62	25	CITY OF ATLANTA	2000 Monroe PL NE	SPILLS	S104885476	3/9/2000: Raw Sewage in Peachtree Creek.
NE-63	25	WATL STUDIO	1 MONROE PLACE	TIER 2	FATR20085NWS8N00FR3N	Date Tier 2 Signed: 2/26/2009.
NE-64	25	ANACOMP INC	2115 MONROE DRIVE NE	RCRA-NonGen	GAD984298018	No violations found.
				FINDS	110005696755	FINDS provides a single point of access for sites regulated or monitored by the EPA.
NE-65	25	EXXON CO USA 46687	2195 MONROE DRIVE	RCRA-NonGen	GAD984315457	No violations found.
				FINDS	110005702196	FINDS provides a single point of access for sites regulated or monitored by the EPA.
		J C - E T (MONROE) LLC	2195 MONROE DRIVE NE @ I-85	LUST	00600901	1/27/1992 and 9/19/1994: Confirmed Releases-NFA.
				UST	600901	03/14/1988: Removed (3) 6,000-gal Gas USTs; (1) 550-gal Used Oil UST; (1) 1,000-gal and (1) 550-gal Other USTs.
				UST	600901	Currently in-use: (1) 12,000-gal (1) 10,000-gal, and (1) 6,000-gal Gas USTs; (1) 6,000-gal Diesel UST.
NE-66	19	PLASTER BRIDGE ASSOCIATES	2120 PLASTER BRIDGE ROAD	SPILLS	S107493035	11/2/2005: 94 ppb of Methylene Chloride found inside building during Phase II investigation.
				GA NON-HSI	Not Provided	Report Date: 11/1/2005. Contamination: Lead, Methylene Chloride.
NE-67	16	CAROLINA LUMBER & SUPPLY CO	2135 PLASTER BRIDGE ROAD NE	LUST	00600694	12/11/1998: Confirmed Release-NFA.
				UST	600694	11/1/1998: Removed (1) 500-gal Gas UST.
NE-68	16	CAYESTEEL	2145 PLASTER BRIDGE ROAD NE	LUST	00600020	6/7/1996: Confirmed Release-NFA.
				UST	600020	05/14/1996: Removed (1) 2,000-gal Gas UST.
NE-69	10	KERR-MCGEE #6003	2125 Piedmont Rd	LUST	00600795	3/10/2009: Confirmed Release-NFA.
NE-70	10	ROLLINS, INC	2170 PIEDMONT ROAD NE	RCRA-NonGen	GAR000039438	No violations found.
				FINDS	110013660494	FINDS provides a single point of access for sites regulated or monitored by the EPA.
				UST	600303	1/1/1989: Removed (1) 8,000-gal, (2) 10,000-gal, (1) 4,000-gal Gas USTs. 07/06/1989: (1) 8,000-gal Gas UST currently in-use.

3.0 Affected Environment
Section 3.9 Contaminated and Hazardous Materials

Final REC ID No.	EDR Ref. No.	Site Name/Owner	Address/Location	Database(s)	Facility/Case ID No.	Comments/Area of Concern(s)
		ORKIN EXTERMINATING COMPANY, INC.		FINDS	110011797421	FINDS provides a single point of access for sites regulated or monitored by the EPA.
		DETTELBACH PESTICIDE CORP.		FINDS	110011864606	FINDS provides a single point of access for sites regulated or monitored by the EPA.
NE-71	2	PIEDMONT ROAD SITE	2399 Piedmont Rd.	GA NON-HSI	S104819446	Contamination: Not reported.
NE-72	2	Professional Cleaners	2405 Piedmont Rd.	DRYCLEANERS	S109506142	Selected SIC Code: 721201.
NE-73	2	EXXON RAS 46888	635 LINDBERGH DRIVE	FINDS	110005692330	FINDS provides a single point of access for sites regulated or monitored by the EPA.
				RCRA-NonGen	GAD984289728	Facility has received notices of violations.
				LUST	00601132	7/31/2002: Suspected Release-No Further Action (NFA). 6/14/1991, 11/5/1998 and 8/23/2002: Confirmed Releases-NFA.
				UST	601132	(1) 10,000-gal, (1) 12,000-gal, (1) 8,000-gal Gas USTs currently in-use. 08/12/1998: Removed (1) 1,000-gal Used Oil UST.
		CITY OF ATLANTA		SPILLS	S104888773	Sewage into Peachtree Creek. Date not provided.
				SPILLS	S102602494†	Spill date: 10/18/1995.

3.0 Affected Environment
Section 3.9 Contaminated and Hazardous Materials

Table 3.9-1b: Preliminary Contaminated Sites and/or Hazardous Materials Sites Within 300-Foot Buffer Area (Southeast Zone)

Final REC ID No.	EDR Ref. No.	Site Name/Owner	Address/Location	Database(s)	Facility/Case ID No.	Comments/Area of Concern(s)
SE-1	3	VACANT LOT	1124/1164 DEKALB AVENUE	UST	9060405	11/25/1994: Removed 1,000-gal Gas and 8,000-gal Diesel UST.
				FIELD SURVEY	NA	1124 DeKalb Ave is currently Inman Station Townhomes. 1164 DeKalb Ave appears to be vacant/wooded lot adjacent to Roger Jordan Auto Repair.
SE-2	13	GIANT FOOD MARKET	29 MORELAND AVENUE	UST	10000508	03/11/2003: (1) 8,000-gal Gas UST Currently In Use.
	Orphan			GA NON-HSI	S108310381 [†]	Report Date: Dec 2006. Contamination: Tetrachloroethene.
				FIELD SURVEY	N/A	Site is an Active Citgo Gas Station.
SE-3	13	BIG H FOOD STORE #52	10 MORELAND AVENUE	FINDS	110013634031	FINDS provides a single point of access for sites regulated or monitored by the EPA.
	13			UST	9044102	As of 4/1/1999: (3) 6,000-gal Gas USTs Currently In Use.
				FIELD SURVEY	NA	Site is currently abandoned.
SE-4	14	JOHN T BENTON	19 WEATHERBY STREET SE	UST	600422	Removed (1) 1,000-gal Diesel, (1) 500-gal Diesel, (1) 6,000-gal Gas, (1) 8,000-gal Empty, (1) 2,000-gal Empty, (1) 5,000-gal Diesel USTs (Date Unknown).
				UST	600422	08/21/2001: (1) 10,000-gal Diesel UST and (1) 10,000-gal Gas UST upgraded and In Use.
				FINDS	110013493941	FINDS provides a single point of access for sites regulated or monitored by the EPA.
				FIELD SURVEY	NA	Abandoned; pump island present, black surface staining.
SE-5	17	GEORGE JOHNS	64 Flat Shoals Ave. (Corner of Wiley)	SPILLS	S102329046 [†]	Spill Date: 05/02/1996 - Mineral Spirits.
SE-6	NA	STEIN STEEL	Between Flat Shoals Ave & Kenyon St.	FIELD SURVEY	NA	Active site; drums, maintenance garage, surface staining observed.
SE-7	18	878 FULTON TERRACE SE	878 FULTON TERRACE SE	FINDS	110037171271	FINDS provides a single point of access for sites regulated or monitored by the EPA.
				FIELD SURVEY	NA	Abandoned building.
SE-8	NA	VACANT LOT; COMMERCIAL	Across from 232 Holtzclaw St	FIELD SURVEY	NA	Apparent former industrial/distribution property.
SE-9	19	BELLSOUTH	248 CHESTER	LUST	00601047	9/28/1993: Confirmed Release-NFA.

3.0 Affected Environment
Section 3.9 Contaminated and Hazardous Materials

Final REC ID No.	EDR Ref. No.	Site Name/Owner	Address/Location	Database(s)	Facility/Case ID No.	Comments/Area of Concern(s)
		TELECOMMUNICATIONS/ CHESTER AVE SOC F1169 /CENTRAL OFFICE	AVENUE SE	UST	601047	9/23/1993: Removed (1) 12,000-gal Gas UST. 02/07/2002: Removed (1) 7,500-gal Diesel UST.
				UST	9060352	3/19/1992: Removed (1) 7,500-gal Diesel UST.
		BST ATLNAGACA F1169		FINDS	110032747598	FINDS provides a single point of access for sites regulated or monitored by the EPA.
				RCRA-NonGen	GAR000001529	Historic activities include LQG and SQG at Site.
SE-10	19	LEGGETT & PLATT INCORPORATED - MAST	905 MEMORIAL DRIVE, SE	TIER 2	FATR20082SJSZ9002J45	Date Tier 2 Signed: 01/14/2009. Showcase, Partition, Shelving, and Locker Manufacturing.
		FINDS		110001420506	FINDS provides a single point of access for sites regulated or monitored by the EPA.	
		RCRA-CESQG		GAD061422507	Conditionally Exempt Small Quantity Generator.	
		UST		9000626	7/5/1990: Removed (4) 4,000-gal Gas, (2) 8,000-gal Hazardous Substance, (1) 500-gal Used Oil, (2) 8,000-gal Other, (2) 2,000-gal Empty USTs. 01/04/1991: (1) 1,000-gal Diesel, (2) 1,000-gal Gas USTs Currently In-Use.	
		MASTERRACK		AIRS	041312100546	State Facility Identifier: 312100546.
SE-11	27	Sterling Engine Products Pioneer Plastics	915 GLENWOOD AVENUE SE	HIST FTTS	Not Reported	Final Order Date: 03/31/1988. Violations(s): PCB Use, Labelling, Records Maintenance.
		PIONEER PLASTICS CORP		FINDS	110001764653	FINDS provides a single point of access for sites regulated or monitored by the EPA.
				LUST	00600239	3/18/1992: Confirmed Release NFA-Remediation.
				UST	600239	3/1/1998: Removed (1) 1,000-gal Gas UST.
				RCRA-NonGen	GAD984273490	Non-Generators do not presently generate hazardous waste.
				FIELD SURVEY	NA	Currently operated as US Electric.
SE-12	25	Glenwood Concrete Plant	885 GLENWOOD AVENUE SE	TIER 2	FATR20085N3YU205CBJP	Date Tier 2 Signed: 2/20/2009.
		WILLIAMS BROS/CONCRETE PLANT #2		UST	600158	11/1/1993: Removed (1) 10,000-gal Diesel UST.
		LAFARGE GLENWOOD AVE CONCRETE PLANT		FINDS	110022447716	FINDS provides a single point of access for sites regulated or monitored by the EPA.
				AIRS	041312100522	State Facility Identifier: 312100522.
		LAFARGE GENERAL		FINDS	110009356268	FINDS provides a single point of access for

3.0 Affected Environment
Section 3.9 Contaminated and Hazardous Materials

Final REC ID No.	EDR Ref. No.	Site Name/Owner	Address/Location	Database(s)	Facility/Case ID No.	Comments/Area of Concern(s)
		MAINTENANCE SHOP		LUST	09060087	sites regulated or monitored by the EPA. 5/5/2000: Confirmed Release-NFA.
				UST	9060087	11/22/1999: Removed (1) 3,000-gal Other, (3) 1,000-gal Other, (1) 750-gal Used Oil, (1) 150-gal Used Oil USTs.
				TIER 2	FATR20085NJ43L00SL7N	Date Tier 2 Signed: 2/24/2009.
				RCRA-CESQG	GAD981230436	Conditionally Exempt Small Quantity Generator.
		BLUE CIRCLE WILLIAMS BROTHERS		AIRS	041312100073	State Facility Identifier: 312100073.
				FINDS	110001751015	FINDS provides a single point of access for sites regulated or monitored by the EPA.
SE-13	25	BLUE CIRCLE WILLIAMS BROTHERS	864 GLENWOOD AVENUE, I-20	FINDS	110001424968	FINDS provides a single point of access for sites regulated or monitored by the EPA.
				AIRS	041312100708	State Facility Identifier: 312100708.
				FIELD SURVEY	NA	Currently operated as Lafarge Corporation.
SE-14	NA	FORMER RAILROAD ALIGNMENT	FORMER RAILROAD ALIGNMENT	FIELD SURVEY	NA	Former railroad operations; potential for former & undocumented spills and releases. Potential polychlorinated biphenyls (PCBs), metals, semi-volatile organic compounds (SVOCs), herbicides and pesticides, lead-based paint and asbestos containing building materials on/in relic equipment or structures.
SE-15	57	Helig Meyers Furniture/Sterchi	650 Hamilton Ave.	UST	601280	5/15/1996: Removed (1) 550-gal Gas UST.
SE-16	54	BOULEVARD COLD STORAGE	1015 BOULEVARD SE	FINDS	110018917341	FINDS provides a single point of access for sites regulated or monitored by the EPA.
				TIER 2	FATR20086CY1YF004WAY	Date Tier 2 Signed: 1/30/2009.
SE-17	74	CITY OF ATLANTA	360 ENGLEWOOD AVENUE SE	SPILLS	S102272915 [†]	7/21/1992: Quantity and location not reported.
				SPILLS	S102272951 [†]	12/15/1992: Quantity and location not reported.
				SPILLS	S102272952 [†]	12/17/1992 Sewage into South River.
				SPILLS	S102272874 [†]	4/7/1992: Sewage into Proctor Creek.
				SPILLS	S102272995 [†]	03/20/1995: Sewage into Peachtree Creek.
				SPILLS	S103538479 [†]	Sewage into Nancy Creek. Date not provided.
	64	T.W. OWENS TRUCKING CO.	1100 HILL STREET	SPILLS	S101538552 [†]	Spill Date: 10/22/92. Gasoline/Fuel Oil into Storm Drain.
	71	BMTS HILL ST/SATELLITE STATION	1146 HILL STREET	LUST	00600285	6/17/1999: Confirmed Release-NFA.
				FINDS	110013488742	FINDS provides a single point of access for sites regulated or monitored by the EPA.
				UST	600285	12/1/1998: Removed (2) 6,000-gal Gas, (1)

3.0 Affected Environment
Section 3.9 Contaminated and Hazardous Materials

Final REC ID No.	EDR Ref. No.	Site Name/Owner	Address/Location	Database(s)	Facility/Case ID No.	Comments/Area of Concern(s)
						20,000-gal Diesel, (2) 3,000-gal Other, (1) 500-gal Gas USTs.
				UST	600285	4/30/1999: (1) 20,000-gal Diesel, (1) 12,000-gal Gas, (1) 3,000-gal Other USTs Currently In Use.
				FIELD SURVEY	NA	Large property, occupying most of area between Englewood Ave (south), Hill Street (west), and proposed BeltLine (north). Apparently all are a part of the City of Atlanta property. A UST island is locate on smaller area, adjacent to Hill Street.
SE-18	75	METRO CARBONATION SALES & SERVICE	410 ENGLEWOOD AVENUE	UST	600042	10/1/1991: Removed (1) 10,000-gal Gas UST.
				FIELD SURVEY	NA	Rescue All Ministries currently present on property.
SE-19	75	WINNING IMAGE	430 ENGLEWOOD AVENUE SE	RCRA-NonGen	GAD984318162	Historically Conditionally Exempt Small Quantity Generator.
				FINDS	110005703756	FINDS provides a single point of access for sites regulated or monitored by the EPA.
				FIELD SURVEY	NA	Building currently abandoned.
SE-20	75	DIXIE HAULING	450 ENGLEWOOD AVENUE	SPILLS	S101537999 ^f	Spill Date: 09/28/1992. Gasoline/Fuel Oil.
				FIELD SURVEY	NA	Property is currently a vacant lot.
SE-21	75	ROYAL AIRLINE LINEN OF ATLANTA	460 ENGLEWOOD AVENUE SE	RCRA-NonGen	GAR000020495	Historically CESQG, SQG, and LQG. Facility Has Received Notices of Violations.
				FINDS	110016751031	FINDS provides a single point of access for sites regulated or monitored by the EPA.
				FIELD SURVEY	NA	Property currently operates as National Dust.
SE-22	75	CITY WIDE WRECKER SERVICE	480 ENGLEWOOD AVENUE	LUST	10001296	3/29/2007: Confirmed Release-NFA.
				UST	10001296	Status: Not reported.
SE-23	75	B P S CORES INC	504 ENGLEWOOD AVENUE SE	RCRA-NonGen	GAD981269350	Historically Small Quantity Generator.
		B P S ALLIED		FINDS	110029199515	FINDS provides a single point of access for sites regulated or monitored by the EPA.
				FIELD SURVEY	NA	Property is currently a vacant lot.
SE-24	75	SOUTHEAST ENGINES	502 ENGLEWOOD AVENUE	RCRA-NonGen	GAD984322727	Facility Has Received Notices of Violations.
				FINDS	110005706156	FINDS provides a single point of access for sites regulated or monitored by the EPA.
	75	SOUTHEAST ENGINES & PARTS INC	500 ENGLEWOOD AVENUE	RCRA-NonGen	GAR000008284	Historically Small Quantity Generator.
				FINDS	110005711603	FINDS provides a single point of access for sites regulated or monitored by the EPA.

3.0 Affected Environment
Section 3.9 Contaminated and Hazardous Materials

Final REC ID No.	EDR Ref. No.	Site Name/Owner	Address/Location	Database(s)	Facility/Case ID No.	Comments/Area of Concern(s)
				FIELD SURVEY	NA	Property is currently a vacant lot.
SE-25	75	GEORGIA TRUCKING COMPANY	540 ENGELWOOD AVENUE	UST	600690	2/2/2006: Removed (2) Diesel USTs (size unknown).
				LUST	00600690	2/15/2006: Confirmed Release-NFA.
				FINDS	110013489233	FINDS provides a single point of access for sites regulated or monitored by the EPA.
				FIELD SURVEY	NA	Property is currently a vacant lot.
SE-26	61	FLOWERS BAKERY OF ATLANTA, LLC	1039 GRANT STREET	FINDS	110006814910	FINDS provides a single point of access for sites regulated or monitored by the EPA.
				UST	10001398	Status: Not reported.
				AIRS	041312100704	State Facility Identifier: 312100704.
				FIELD SURVEY	NA	Abandoned building present at property and adjoining property.
SE-27	61	DEAN FOODS	385 GRANT CIRCLE SUITE B	FINDS	110015750347	FINDS provides a single point of access for sites regulated or monitored by the EPA.
		PET DAIRY	385 GRANT CIRCLE SE	SPILLS	S102230744 [†]	Spill Date: 06/23/1996. Ammonia.
		FRENCH'S ICE CREAM		ERNS	93326687	Spill Date: 06/18/1993. 3,500 lbs of Ammonia.
		LAND O SUN DAIRIES INCORPORATED		FINDS	110000525496	FINDS provides a single point of access for sites regulated or monitored by the EPA.
		385 GRANT CIRCLE		FINDS	110037167179	FINDS provides a single point of access for sites regulated or monitored by the EPA.
FIELD SURVEY	NA	Address appears to now be 375 Grant Circle.				
SE-28	NA	PROLIANCE	400 GRANT CIRCLE	FIELD SURVEY	NA	Current industrial site bordering proposed Atlanta BeltLine.
SE-29	68	US PLATING & BUMPER SERVICE INC	78 MILTON AVENUE, SE	AIRS	041312100650	State Facility Identifier: 312100650.
				FINDS	110001422283	FINDS provides a single point of access for sites regulated or monitored by the EPA.
				CERC-NFRAP	0405958	01/16/1994: Preliminary Assessment Completed.
		U.S. PLATING BURN SITE	SHWS	10264	This site has a known release of Chromium in soil at levels exceeding the reportable quantity. Other substances on site: Nickel; Carbon disulfide; Barium; Lead; Cyanides and Arsenic.	
			BROWNFIELDS	S103224252 [†]	Cleanup Completed: 6/15/2005.	
			FIELD SURVEY	NA	Current vacant lot.	
SE-30	68	SMITH PLANING MILL	72 MILTON AVENUE SE	FINDS	110001764617	FINDS provides a single point of access for sites regulated or monitored by the EPA.
				AIRS	041312100529	State Facility Identifier: 312100529.

3.0 Affected Environment
Section 3.9 Contaminated and Hazardous Materials

Final REC ID No.	EDR Ref. No.	Site Name/Owner	Address/Location	Database(s)	Facility/Case ID No.	Comments/Area of Concern(s)		
		LAWRENCE SMITH PLY MILL INC		FINDS	110013568914	FINDS provides a single point of access for sites regulated or monitored by the EPA.		
				UST	9060466	(1) Diesel UST currently in use. Date and size not reported.		
				FIELD SURVEY	NA	Current vacant lot.		
SE-31	68	UNKNOWN LUST	79 MILTON AVENUE SE	SPILLS	S102444143†	Spill Date: 12/17/1996. Gasoline.		
				FIELD SURVEY	NA	Property identified as City of Atlanta Dept. of General Services Transportation/Logistics		
SE-32	NA	JB DISTRIBUTION COMPANY	95 Milton Ave.	FIELD SURVEY	NA	Apparent automotive/truck repair facility.		
SE-33	72	STANDARD TRUCKING CO	125 MILTON AVENUE SE	RCRA-NonGen	GAD981275241	No violations found.		
				FINDS	110005688522	FINDS provides a single point of access for sites regulated or monitored by the EPA.		
				RCRA-NonGen	GAD981276165	Historically Small Quantity Generator.		
				LUST	00600904	10/7/1991: Confirmed Release-Cleanup Initiated. 6/14/2005: Confirmed Release-Cleanup Initiated.		
				UST	600904	Removed (1) 8,000-gal Diesel, (1) 8,000-gal Other, (1) 11,000-gal Gas USTs (Date Unknown). 06/02/2005: Removed (1) 12,000-gal Diesel UST.		
				113 MILTON AVENUE SE	113 MILTON AVENUE SE	FINDS	110037166009	FINDS provides a single point of access for sites regulated or monitored by the EPA.
				118 MILTON AVENUE SE	118 MILTON AVENUE SE	FINDS	110037166107	FINDS provides a single point of access for sites regulated or monitored by the EPA.
				108 MILTON AVENUE SE	108 MILTON AVENUE SE	FINDS	110037165901	FINDS provides a single point of access for sites regulated or monitored by the EPA.
		FIELD SURVEY	NA			Abandoned building. Monitoring wells present. Apparent all one contiguous property.		
SE-34	NA	ABANDONED BUILDING	140 MILTON AVENUE	FIELD SURVEY	NA	Former apparent tractor trailer storage facility.		
SE-35	73	MIDTOWN BAKERS	1155 Hank Aaron Dr	US Brownfields	1006882115	Completed date: 6/30/1998.		
SE-36	73	TEXACO FOOD MART	1169 HANK AARON DRIVE	LUST	10000669	6/16/2004: Confirmed Release-NFA.		
				UST	10000669	07/25/2007: Removed (1) 12,000-gal Gas, (1) 8,000-gal Gas, (1) 4,000-gal Diesel USTs.		
				FIELD SURVEY	NA	Site currently vacant. Ridge Avenue is now a cul de sac.		
SE-37	NA	VACANT LOT	Across from Ridge	FIELD SURVEY	NA	Apparent former industrial/distribution		

3.0 Affected Environment
Section 3.9 Contaminated and Hazardous Materials

Final REC ID No.	EDR Ref. No.	Site Name/Owner	Address/Location	Database(s)	Facility/Case ID No.	Comments/Area of Concern(s)
			Ave cul-de-sac			property.
SE-38	67	Former American Iron & Metal Site	1111 RIDGE AVENUE SW	GA NON-HSI	S105489067 [†]	Contamination: Chlorobenzene; Lead
		AMERICAN IRON & METAL CO INC		FINDS	110001764573	FINDS provides a single point of access for sites regulated or monitored by the EPA.
		ATLANTA TRANSFER STATION		AIRS	041312100517	Information not provided.
				SWF/LF	PBR-060-208TS	Transfer of c&d material.
FIELD SURVEY	NA	Property currently contains an abandoned building.				
SE-39	73	1171 RIDGE AVENUE SW	1171 RIDGE AVENUE SW	FINDS	110037166090	FINDS provides a single point of access for sites regulated or monitored by the EPA.
SE-40	73	SSS COMPANY	56-71 UNIVERSITY AVENUE SW	FINDS	1004687630	FINDS provides a single point of access for sites regulated or monitored by the EPA.
				RCRA-SQG	GAR000007781	No violations found.
SE-41	83	47 UNIVERSITY AVENUE	47 UNIVERSITY AVENUE	FINDS	110037167213	FINDS provides a single point of access for sites regulated or monitored by the EPA.
SE-42	83	GENERAL OIL RECOVERY INC	70 UNIVERSITY AVENUE	RCRA-NonGen	GAD981018955	No Violations Found.
				FINDS	110005671362	FINDS provides a single point of access for sites regulated or monitored by the EPA.
SE-43	83	80 UNIVERSITY AVENUE	80 UNIVERSITY AVENUE	FINDS	110037171048	FINDS provides a single point of access for sites regulated or monitored by the EPA.
SE-44	83	WEAVER TRUCKING	99 UNIVERSITY AVENUE	SPILLS	S101538155 [†]	11/03/1992: Oil. Quantity not reported.
		ALL WASTE PAINT CLEN		SPILLS	S101535852 [†]	2/18/1991: Quantity and material not reported.
SE-45	81	CUMMINS SOUTH, INC.	100 UNIVERSITY AVENUE	GA NON-HSI	S107668155 [†]	Report Date: Mar 2006. Contamination: 1,1-Dichloroethane.
		CUMMINS POWER SOUTH LLC		LUST	09000410	10/3/1989 & 11/9/1990: Confirmed Release-NFA.
				UST	9000410	09/13/1989: Removed (1) 750-gal Other, (1) 750-gal Diesel USTs. 11/7/1990: Removed (1) 550-gal Used Oil, (1) 1,000-gal Used Oil USTs.
		RCRA-CESQG		GAD984312884	No violations found.	
		FINDS		110005701552	FINDS provides a single point of access for sites regulated or monitored by the EPA.	
SE-46	81	PROPERTY OF BALCO REALTY, INC.	1269 PRYOR ROAD	GA NON-HSI	S104819452 [†]	Contamination: PCB; Lead; Barium; Chromium; Cadmium.
				FIELD SURVEY	NA	Property currently contains an abandoned building.

3.0 Affected Environment
Section 3.9 Contaminated and Hazardous Materials

Final REC ID No.	EDR Ref. No.	Site Name/Owner	Address/Location	Database(s)	Facility/Case ID No.	Comments/Area of Concern(s)
SE-47	81	3156 CLAIRE GSM	1275 PRYOR ROAD	TIER 2	FATR22008FAWS0147350	Date Tier 2 Signed: 1/16/2009.
		1275 PRYOR ROAD		SPILLS	S105229682 [†]	12/12/2001: Spill of Paint and Oil at Sandy's Body Shop.
				FIELD SURVEY	NA	Property is currently vacant.
SE-48	NA	VACANT LOT/COMMERCIAL	South of tracks on Pryor Rd.	FIELD SURVEY	NA	Apparent former industrial/distribution property.
SE-49	76	GREAT DANE TRAILERS INC	660 UNIVERSITY AVENUE, SW	FINDS	110001425459	FINDS provides a single point of access for sites regulated or monitored by the EPA.
				AIRS	041312100733	State Facility Identifier: 312100733.
SE-50	77	FREIGHT DIRECT	554 UNIVERSITY AVENUE SW	SPILLS	S101643910 [†]	9/2/1994: Anti-Freeze into Storm Drain.
				SPILLS	S102602026 [†]	9/2/1994: Anti-Freeze into Storm Drain.
				FIELD SURVEY	NA	Property currently operates as Metro Truck and Tire Service. Abandoned building and monitoring wells observed on site.
SE-51	78	BROWN TRANSPORT CORP	352 UNIVERSITY AVENUE SW	FINDS	110009354992	FINDS provides a single point of access for sites regulated or monitored by the EPA.
				LUST	00600903	9/18/2000: Confirmed Release-NFA.
				UST	600903	(1) 10,000-gal Gas, (2) 12,000-gal Diesel, (2) 10,000-gal Diesel, (1) 12,000-gal Other, (1) 10,000-gal Other, (1) 2,000-gal Used Oil USTs Currently In Use (Date Unknown).
		SOUTHERN FREIGHT	RCRA-NonGen	GAD033512153	Facility Has Received Notices of Violations.	
			FINDS	110005664147	FINDS provides a single point of access for sites regulated or monitored by the EPA.	
		RCRA-NonGen	GA0000959080	No violations found.		
SE-52	79	278 UNIVERSITY AVENUE	278 UNIVERSITY AVENUE	FINDS	110037167133	FINDS provides a single point of access for sites regulated or monitored by the EPA.
		CAPITAL FORD TRUCK SALES INC	290 UNIVERSITY AVENUE SW	RCRA-NonGen	GAD981220486	No violations found.
				FINDS	110005674948	FINDS provides a single point of access for sites regulated or monitored by the EPA.
			FIELD SURVEY	NA	290 University Ave is now Sampson Food, an active site. Captial Ford contains an abandoned building between Sampson Food and Brown Trucking.	
SE-53	79	BAGGETT TRANSPORTATION/CAPITOL S	260 UNIVERSITY AVENUE SW	FINDS	110013660476	FINDS provides a single point of access for sites regulated or monitored by the EPA.
				LUST	00600307	1/8/1992: Confirmed Release-NFA.
				UST	600307	12/20/1991: Removed (2) 6,000-gal Diesel, (1) 1,000-gal Used Oil, (1) 10,000-gal Diesel

3.0 Affected Environment
Section 3.9 Contaminated and Hazardous Materials

Final REC ID No.	EDR Ref. No.	Site Name/Owner	Address/Location	Database(s)	Facility/Case ID No.	Comments/Area of Concern(s)
						USTs. 06/15/1973: (1) 5,000-gal Other UST Closed In-Ground.
		SOUTHEASTERN STAGES INC		UST	9060839	8/30/2000: (1) 15,000-gal Diesel UST Currently In-Use.
	Orphan			TIER 2	FATR20086BSFU8002RBG	Date Tier 2 Signed: 2/19/2009.
SE-54	76	FAST FILL FOODMART	1241 METROPOLITAN PARKWAY	FINDS	110013507311	FINDS provides a single point of access for sites regulated or monitored by the EPA.
				UST	600792	1/1/1987: Removed (3) 8,000-gal Gas USTs. (1) 15,000-gal Gas UST Permanently Out of Use.
						01/05/1999: (3) 8,000-gal Gas USTs Currently In Use.
						Site is an active Chevron Gas Station.
SE-55	76	CHEVRON FOOD MART	1217 METROPOLITAN PARKWAY	UST	10001026	As of 10/01/2005: (1) 15,000-gal Gas, (1) 10,000-gal Gas, (1) 5,000-gal Diesel USTs in use.
				FIELD SURVEY	NA	Site is an active Texaco Gas Station.
SE-56	85	1275 METROPOLITAN PARKWAY SW	1275 METROPOLITAN PARKWAY SW	FINDS	110037166205	FINDS provides a single point of access for sites regulated or monitored by the EPA.
				FIELD SURVEY	NA	Current vacant lot. An abandoned auto repair facility is adjacent and south of 1275 Metropolitan Parkway.
SE-57	NA	DIXIE PULP AND PAPER	1240 Metropolitan Pkwy	FIELD SURVEY	NA	Active industrial property.
SE-58	63	J & W PALLET & DRUM CO	1121 ALLENE AVENUE	CERCLIS	0407788	08/22/2008: Administrative order on consent.
				ICIS	04-2008-3772	CERCLA 122h Agrmt For Cost Recovery.
				FINDS	110009357695	FINDS provides a single point of access for sites regulated or monitored by the EPA.
				RCRA-NonGen	GAD984310797	No violations found.
SE-59	NA	FORMER INDUSTRIAL BUILDING	Allene Ave. (S. of Proposed Atlanta BeltLine)	FIELD SURVEY	NA	Abandoned building present on property.
SE-60	49	SNAPPINGER WWT PLANT	981 Allene Ave SW	SPILLS	S101643846 [†]	Spill Date: 05/21/1994. Anionic Polyacrylic.
SE-61	63	HARMON BROTHERS CHARTER SERVICE	1160 ALLENE AVENUE SW	FINDS	1011854335	FINDS provides a single point of access for sites regulated or monitored by the EPA.
				UST	9060535	As of 12/02/1998: (1) 10,000-gal Diesel, (1) 4,000-gal Gas, (1) 2,000-gal Gas, (1) 1,000-gal Kerosene USTs in use.

3.0 Affected Environment
Section 3.9 Contaminated and Hazardous Materials

Final REC ID No.	EDR Ref. No.	Site Name/Owner	Address/Location	Database(s)	Facility/Case ID No.	Comments/Area of Concern(s)
				FINDS	110013571599	FINDS provides a single point of access for sites regulated or monitored by the EPA.
				LUST	09060535	1/7/1999: Confirmed Release-NFA.
				FIELD SURVEY	NA	Abandoned building; monitoring wells, drums, staining present.
SE-62	63	SPRINT COMMUNICATIONS COMPANY LP	1190 ALLENE AVENUE	FINDS	110013543638	FINDS provides a single point of access for sites regulated or monitored by the EPA.
				UST	9060043	10/5/2000: (1) 10,000-gal Diesel and (1) 6,000-gal Diesel USTs Currently In Use .
		Sprint - Atlanta, GA LD Switch		TIER 2	FATR20081YS66402BJ5Y	Date Tier 2 Signed: 1/31/2009.
SE-63	63	ESB INC	1246 ALLENE AVENUE SW	ICIS	110001750999	Program ID: CERCLIS GAD078105749. Enforcement Action Type: CERCLA 106 AO For Resp Action/Imm Haz.
				SHWS	10778	This site has a known release of Lead in soil at levels exceeding the reportable quantity. Investigations are being conducted to determine how much cleanup is necessary for source materials, soil, and groundwater.
		ESB INC	1214 ALLENE AVENUE SW	CERCLIS	401568	Removal Only Site (No Site Assessment Work Needed). Alias Name: EXIDE,INC.
				FINDS	110001750999	FINDS provides a single point of access for sites regulated or monitored by the EPA.
				RCRA-CESQG	GAD078105749	Facility Has Received Notices of Violations.
SE-64	47SW	CUSTOM AUTO PARTS	902 MURPHY AVENUE	FINDS	110001971322	FINDS provides a single point of access for sites regulated or monitored by the EPA.
				FIELD SURVEY	NA	Active site; address appears to be 982 Murphy Ave.
SE-65	49SW	Unpaint Corporation Property	920 Murphy Ave.	BROWNFIELDS	S107031932†	Cleanup Completed: 6/9/2005.
SE-66	47SW	EXHIBITS PLUS INC	900 MURPHY AVENUE	FINDS	110001418975	FINDS provides a single point of access for sites regulated or monitored by the EPA.
				AIRS	041312100757	State Facility Identifier: 312100757.
				FIELD SURVEY	NA	Abandoned building.
SE-67	47SW	ABANDONED DRUMS	895 MURPHY AVENUE	SPILLS	S101533152†	Spill Date: 10/19/1993. Substance Unknown.
				FIELD SURVEY	NA	Abandoned building.
		CHURCHILL INC	892 MURPHY AVENUE	FINDS	110001421827	FINDS provides a single point of access for sites regulated or monitored by the EPA.
				AIRS	041312100231	State Facility Identifier: 312100231.
				FIELD SURVEY	NA	Abandoned building 892 & 884 Murphy Street.

3.0 Affected Environment
Section 3.9 Contaminated and Hazardous Materials

Final REC ID No.	EDR Ref. No.	Site Name/Owner	Address/Location	Database(s)	Facility/Case ID No.	Comments/Area of Concern(s)
	43SW	878 MURPHY AVENUE	878 MURPHY AVENUE	LUST	10000846	3/10/2005: Confirmed Release-NFA.
				UST	10000846	UST size and contents not reported.
				FIELD SURVEY	NA	Apparent one facility.
SE-68	34	791 LOWNDES STREET SW	791 LOWNDES STREET SW	FINDS	110037171020	FINDS provides a single point of access for sites regulated or monitored by the EPA.
SE-69	31	UNPAINT CORPORATION	690 MURPHY AVENUE SW	FINDS	110005670121	FINDS provides a single point of access for sites regulated or monitored by the EPA.
				RCRA-NonGen	GAD097393243	Violation Status: No violations found.
SE-70	139	DYNAMIC METALS	584 EDGEWOOD AVENUE	FINDS	110011737923	FINDS provides a single point of access for sites regulated or monitored by the EPA.
				HIST FTTS	198902221726 1	Investigation Type: Section 6 PCB Federal Conducted.
				LUST	10000228	1/23/2003: Confirmed Release - Cleanup Status: Transferred.
				GA NON-HSI	S105872217	Report Date: 4/3/2003. Contamination: vinyl chloride; 1,2-dichloropropane.
				FTTS	199206245281 1	Inspection Date: 06/24/92. Investigation Type: Section 6 PCB Federal Conducted.
HIST FTTS	199206245281 2	Investigation Type: Section 6 PCB Federal Conducted.				
SE-71	139	Mccullough Electric Services	521 Edgewood Ave.	SPILLS	19177	Air release of smelly odor.
SE-72	139	EDGEWOOD COLLISION	494 EDGEWOOD AVENUE NE	SPILLS	52900	6/23/2008: Dumping open paint into dumpster.
		BILLY'S BODY & FENDER REPAIR		FINDS	110005669945	FINDS provides a single point of access for sites regulated or monitored by the EPA.
				RCRA-NonGen	GAD092647791	Violation Status: No violations found.
SE-73	139	FORMER SERVICE STATION	479 EDGEWOOD AVENUE	LUST	09060750	11/13/1998: Confirmed Release - No Further Action (NFA).
				UST	9060750	8/5/1998: Removed (2) 4,000-gal Gas and (1) 150-gal Used Oil USTs.
SE-74	141	EASEWAY FOOD	400 EDGEWOOD AVENUE NE	FINDS	110013511146	FINDS provides a single point of access for sites regulated or monitored by the EPA.
				LUST	00600843	6/7/1990, 7/17/1990 & 10/8/2003: Confirmed Release - NFA.
	144		UST	600843	6/7/2007: (2) 5,000-gal and (1) 8,000-gal Gas Temporary Out-of-Use. 01/01/93: (1) 6,000-gal Gas Permanently Out-of-Use.	
	141	QUICKIE PICKIE SRVC	Edgewood / Jackson	SPILLS	2136	7/17/1990: Gasoline/Fuel Oil.
				SPILLS	0230	2/28/1991: Gasoline/Fuel Oil.

3.0 Affected Environment
Section 3.9 Contaminated and Hazardous Materials

Final REC ID No.	EDR Ref. No.	Site Name/Owner	Address/Location	Database(s)	Facility/Case ID No.	Comments/Area of Concern(s)
			St			
SE-75	144	HOON J KIM/FLEET OIL CO #211	346 EDGEWOOD AVENUE NE	UST	601296	3/22/1993: Removed (3) 6,000-gal Gas USTs.
SE-76	Orphan	15 HILLIARD STREET	15 HILLIARD STREET	BROWNFIELDS	S109504912	Cleanup Plan Date: 2/5/2009.
				GA NON-HSI	Not Provided	Report Date: 2/3/2009.
SE-77	Orphan	ANTOINE GRAVES ANNEX	110 Hilliard St	GA NON-HSI	S109016332	Report Date: 2/5/2009. Contamination - Lead.
SE-78	Orphan	GRAVES HIGH RISE	126 Hilliard St	GA NON-HSI	S109016333	Report Date: 1/20/2009. Contamination - Lead.
SE-79	149	FORMER GRADY HOMES	100 BELL STREET	FINDS	110005720648	FINDS provides a single point of access for sites regulated or monitored by the EPA.
				RCRA-LQG	GAR000025205	Owner/operator name: City of Atlanta Housing Authority. No Violations Found. Waste Name: Lead.
SE-80	151	380 DECATUR STREET	380 DECATUR STREET	BROWNFIELDS	S109350683	Cleanup Plan Date: 10/14/2008. Contamination: Chloroform.
				GA NON-HSI	Not Provided	Report Date: 10/23/2008.
SE-81	151	US CONTRACTING	349 DECATUR STREET	FINDS	110005663228	FINDS provides a single point of access for sites regulated or monitored by the EPA.
				RCRA-NonGen	GA0000000083	No violations found.
				RCRA-NonGen	GAR0000000083	No violations found.
		FRONTIER COMMUNICATIONS INTERNATIONAL		FINDS	110013567336	FINDS provides a single point of access for sites regulated or monitored by the EPA.
				LUST	09060499	1/13/2006: Confirmed Release-NFA.
SE-82	151	DECATUR STREET PROPERTY	317-349 DECATUR STREET	GA NON-HSI	S107150840	Report Date: 6/5/2005. Contamination: Tetrachloroethene and Lead.
SE-83	151	229 GRANT STREET	229 Grant St	BROWNFIELDS	S106780264	Cleanup Completed: 12/23/1999.
			227-229 Grant St	DEL SHWS	S104550862	Delist Date: 2/2/2005.
SE-84	151	T MARZETTI CO ATLANTA DIVISION	261 GRANT STREET	UST	600634	11/1/1998: (1) 8,300-gal Other and (1) 6,000-gal Gas USTs Closed In-Place.
				FINDS	110022448038	FINDS provides a single point of access for sites regulated or monitored by the EPA.
		261 GRANT STREET		SPILLS	S106488069	06/29/2004: Sulfuric Acid release to air.
SE-85	151	HARP TRANSMISSION	350 MEMORIAL DRIVE	FINDS	110005279929	FINDS provides a single point of access for sites regulated or monitored by the EPA.
				RCRA-SQG	GA0000135566	No violations found.
SE-86	151	MILLION CAB CO INC	359 MEMORIAL DRIVE S E	UST	440528	(1) 5,000-gal empty UST Permanently Out-of-Use.
SE-87	151	FORMER GASOLINE STATION SITE	363 MEMORIAL DRIVE SE	LUST	10000843	3/9/2005: Confirmed Release-NFA.
				UST	10000843	Tank ID not reported.

3.0 Affected Environment
Section 3.9 Contaminated and Hazardous Materials

Final REC ID No.	EDR Ref. No.	Site Name/Owner	Address/Location	Database(s)	Facility/Case ID No.	Comments/Area of Concern(s)
SE-88	151	SEWELL SUPPLY CO	273 OAKLAND AVENUE	LUST	00600064	7/17/1997: Confirmed Release-NFA.
		UST		600064	3/1/1990: Removed (1) 1,000-gal Gas and (1) 500-gal Empty UST.	
		273 OAKLAND AVENUE	FINDS	110037167124	FINDS provides a single point of access for sites regulated or monitored by the EPA.	
SE-89	151	EXPRESS CLEANERS	415 Memorial Dr SE # A	DRYCLEANERS	S109505595	Primary SIC code: 721201.
SE-90	151	FRED E RIMER CO INC	307 CHEROKEE AVENUE SE	LUST	09060761	2/18/1999: Confirmed Release-NFA.
				UST	9060761	1/28/1993: (2) 500-gal Gas USTs Closed-in-Place.
SE-91	151	CALAMITY JANE LLC (FORMER SERVICE STATION)	437 MEMORIAL DRIVE	LUST	10001313	4/2/2007: Confirmed Release-NFA.
				GA NON-HSI	S108475724	Report Date: 3/7/2007. Contamination: Trichloroethene.
				UST	10001313	Tank ID Not Reported.
SE-92	157	LARKIN COILS	519 MEMORIAL DRIVE	RCRA-SQG	GAD003274255	No violations found.
				SHWS	10088	Trichloroethene; Chloroform; Carbon tetrachloride; Tetrachlorethene; Dichloroethylene; N.O.S.; 1,1,2,- Trichloroethane; Carbon disulfide; and Dichloromethane detected in groundwater.
				FINDS	110001323522	FINDS provides a single point of access for sites regulated or monitored by the EPA.
				CERC-NFRAP	0401318	Site Inspection completed on 07/28/1989.
				GA NON-HSI	Not Provided	Contamination: Not reported.
SE-93	157	VETERANS RADIATOR SHOP	533 MEMORIAL DRIVE, SE	SPILLS	S101535949	5/28/1991: Unidentified Hazardous Material.
				FINDS	110001765741	FINDS provides a single point of access for sites regulated or monitored by the EPA.
				SPILLS	S1005525348	12/16/2003: Radiator shop reportedly dumping anti-freeze into ditch.
				ERNS	2003708197	
SE-94	157	563 MEMORIAL DRIVE	563 MEMORIAL DRIVE	LUST	10000593	3/10/2004 & 8/17/2006: Confirmed Release-NFA.
				UST	10000593	Status Not Reported.
SE-95	157	BLESSIN TIRE SHOP	600 MEMORIAL DRIVE SE	LUST	09060833	4/18/2000: Confirmed Release-NFA.
				UST	9060833	(1) Diesel UST Upgrade Repair Not Marked. Date not provided.
SE-96	157	FORMER PHILLIPS 66	603 MEMORIAL DRIVE	LUST	09060653	8/7/1997: Confirmed Release-NFA.
				UST	9060653	2/1/1997: Removed (2) 2,000-gal and (1) 4,000-gal Gas USTs.
SE-97	157	AUTO GALLERY	674 MEMORIAL	FINDS	110006398996	FINDS provides a single point of access for

3.0 Affected Environment
Section 3.9 Contaminated and Hazardous Materials

Final REC ID No.	EDR Ref. No.	Site Name/Owner	Address/Location	Database(s)	Facility/Case ID No.	Comments/Area of Concern(s)
			DRIVE			sites regulated or monitored by the EPA.
				RCRA-SQG	GAR000014589	Facility Has Received Notices of Violations.
SE-98	153	CURTIN BODY SHOP	710 MEMORIAL DRIVE SE	FINDS	110005702695	FINDS provides a single point of access for sites regulated or monitored by the EPA.
				RCRA-CESQG	GAD984316513	No violations found.
SE-99	153	TOTAL DISTRIBUTION SVC INC	736 MEMORIAL DRIVE SE	LUST	00600218	8/24/1995: Confirmed Release-NFA.
				UST	600218	4/24/1995: Removed (2) 10,000-gal, (1) 1,000-gal Gas USTs.
SE-100	153	GENERAL GMC TRUCKS INC	745 MEMORIAL DRIVE SE	FINDS	110005675288	FINDS provides a single point of access for sites regulated or monitored by the EPA.
				RCRA-NonGen	GAD981221013	No violations found.
SE-101	153	Atlanta Dairies Cooperative	777 MEMORIAL DRIVE	AIRS	S107749812	State Facility Identifier: 312100083.
		ATLANTA DAIRY LLC		LUST	09060030	7/5/1991: Confirmed Release-NFA.
				UST	9060030	5/14/1990: Removed (2) 8,000-gal Gas, (1) 500-gal Gas, (1) 8,000-gal Diesel, (1) 500-gal Used Oil USTs. 08/01/2007: Installed (1) 15,000-gal Diesel UST.
				SPILLS	30286	11/10/2004: Ammonia spill caused by vandalism.
		FLAGSHIP ATLANTA DAIRY, LLC		FINDS	110000357550	FINDS provides a single point of access for sites regulated or monitored by the EPA.
				SPILLS	S1000153235	5/22/1997: 100 gals of diesel fuel. Clean up the same day.
				RCRA-NonGen	GAD981246044	No violations found.
				TIER 2	FATR20086BB66S002XPR	Date Tier 2 Signed: 2/12/2009.
		ATLANTA DAIRIES	777 Memorial Dr SE	SPILLS	S104884706	10/24/1991: Hazardous Material.
		NEW ATLANTA DAIRIES	777 Memorial Dr. (Parking Lot)	SPILLS	S101530768	6/7/1995: Diesel Fuel Spill. Quantity not reported.
		ATLANTA FLAGSHIP DAIRY, LLC	777 AND 833 Memorial Dr. SE	GA NON-HSI	S107668145	Report Date: 3/6/2006. Contamination: Tetrachloroethene.
SE-102	153	NEXTRAN TRUCK CENTER ATLANTA	780 MEMORIAL DRIVE SE	RCRA-SQG	GAD981266307	No violations found.
				FINDS	110005282568	FINDS provides a single point of access for sites regulated or monitored by the EPA.
				UST	600238	4/6/1990: Removed (1) 550-gal Used Oil UST.
SE-103	153	APD TRANSMISSION PARTS INC	824 MEMORIAL DRIVE SE	FINDS	110005684768	FINDS provides a single point of access for sites regulated or monitored by the EPA.
				UST	9060026	3/1/1986: (1) UST removed. Size and contents not provided.

3.0 Affected Environment
Section 3.9 Contaminated and Hazardous Materials

Final REC ID No.	EDR Ref. No.	Site Name/Owner	Address/Location	Database(s)	Facility/Case ID No.	Comments/Area of Concern(s)
				RCRA-NonGen	GAD981265903	No violations found.
		824-846 MEMORIAL DRIVE	824-846 Memorial Dr	BROWNFIELDS	S108517874	Cleanup Completed: 3/18/2008.
	Orphan	FORMER APD TRANSMISSION	824-846 Memorial Dr	GA NON-HSI	Not Provided	Report Date: 5/8/2008. Contamination - Lead.
SE-104	153	Commercial Office/Warehouse Property	841-845 Memorial Dr	GA NON-HSI	S106854556	Report Date: 2/5/2005. Contamination: cis-1,2-Dichloroethene.
SE-105	153	POLAR BOY INC	878 MEMORIAL DRIVE SE	LUST	04440453	2/15/2001: Confirmed Release-NFA.
		878 MEMORIAL DRIVE		UST	4440453	8/12/1988: Removed (1) 1,000-gal Gas UST. a.k.a. UNOCAL.
				GA NON-HSI	S105037281 [†]	Report Date: Jan 2001. Contamination: Styrene, Soil Releases.
SE-106	153	TIRE MOUNTAIN	269 CHESTER AVENUE	BROWNFIELDS	S108118639	Cleanup Completed : 8/8/2007.
				GA NON-HSI	N/A	Report Date: 1/15/2008. Contamination: 1,1-dichloroethene, Trichloroethene.
SE-107	153	CHESTER AVENUE SITE	225 CHESTER AVENUE	GA NON-HSI	S107668149 [†]	Report Date: April 2006. Contamination: Trichloroethylene.
SE-108	153	MALONE DISPLAYS INC	215 CHESTER AVENUE SE	UST	9060065	2/15/1990: Removed (1) 10,000-gal Gas UST.
SE-109	153	199 CHESTER AVENUE SE	199 CHESTER AVENUE SE	FINDS	110037166982	FINDS provides a single point of access for sites regulated or monitored by the EPA.
SE-110	153	878 FULTON TERRACE SE	878 FULTON TERRACE SE	FINDS	110037171271	FINDS provides a single point of access for sites regulated or monitored by the EPA.
SE-111	153	LEGGETT & PLATT INCORPORATED - MAST	905 MEMORIAL DRIVE, SE	TIER 2	FATR20082SJSZ9002J45	Date Tier 2 Signed: 01/14/2009. a.k.a. Showcase, Partition, Shelving, and Locker Manufacturing.
				FINDS	110001420506	FINDS provides a single point of access for sites regulated or monitored by the EPA.
				RCRA-CESQG	GAD061422507	Conditionally Exempt Small Quantity Generator.
				UST	9000626	7/5/1990: Removed (4) 4,000-gal Gas, (2) 8,000-gal Hazardous Substance, (1) 500-gal Used Oil, (2) 8,000-gal Other, & (2) 2,000-gal Empty USTs.
						01/04/1991: (1) 1,000-gal Diesel, (2) 1,000-gal Gas USTs Currently In-Use.
		MASTERACK		AIRS	041312100546	State Facility Identifier: 312100546.
SE-112	O3	ARAMARK-DEKALB AVENUE SITE	670 AND 690 DEKALB AVENUE	BROWNFIELDS	S108256293	Cleanup Plan Completed: 10/17/05; residential

3.0 Affected Environment
Section 3.9 Contaminated and Hazardous Materials

Table 3.9-1c: Preliminary Contaminated Sites and/or Hazardous Materials Sites Within 300-Foot Buffer Area (Southwest Zone)

Final REC ID No.	EDR Ref. No.	Site Name/Owner	Address/Location	Database(s)	Facility/Case ID No.	Comments/Area of Concern(s)
SW-1	24	V.T. USED TIRES	715 WEST Whitehall St	GA NON-HSI	S105174723 [†]	Report Date: Sep 2001. Contamination: Not Reported.
SW-2	NA	WEST END AUTOMOTIVE	SW Corner Beecher and Lee St.s	FIELD SURVEY	NA	Automotive repair facility.
SW-3	39	MIKE HINDMAN	819 Lee St SW	SPILLS	S101643954 [†]	Spill Date: 07/19/1994. Motor Oil.
SW-4	44	FORMER LEE STREET STATION	889 LEE STREET	LUST	10000114	8/21/2002: Confirmed Release-Monitoring Only.
				UST	10000114	1/1/1981: (1) 10,000-gal Gas UST Closed in Place.
				FIELD SURVEY	NA	Site is a vacant lot.
SW-5	50	918 LEE STREET SW	918 LEE STREET SW	FINDS	110037165509	FINDS provides a single point of access for sites regulated or monitored by the EPA.
				FIELD SURVEY	NA	Site is a vacant lot.
SW-6	49	THE RIGHT STUFF STORE #80	923 LEE STREET	FINDS	110013482935	FINDS provides a single point of access for sites regulated or monitored by the EPA.
		BOOKWORLD USA LLC DBA AKS CHEVRON		LUST	00601121	5/22/1996: Confirmed Release-NFA Remediation.
				UST	601121	12/1/1985: (2) 10,000-gal Gas, (1) 8,000-gal Gas, (1) 8,000-gal Diesel and (1) 4,000-gal Kerosene USTs Currently in Use.
SW-7	50	Excellent Foods Warehouse	933 LEE STREET SW	SPILLS	S102918642 [†]	Anhydrous Ammonia Release.
		ALTERMAN COLD STORAGE		LUST	09060811	1/25/2000: Confirmed Release-NFA.
		West End Cold Storage		UST	9060811	10/1/1999: Removed (1) 8,000-gal Diesel, (1) 8,000-gal Gas, (1) 6,000-gal Gas USTs.
		GES EXPOSITION SVCS FINDS	933-A LEE STREET	SPILLS	S101644270 [†]	7/18/1995: Ammonia Release.
				FINDS	110005706067	FINDS provides a single point of access for sites regulated or monitored by the EPA.
			RCRA-NonGen	GAD984322586	No violations found.	
SW-8	NA	COMMERICAL WAREHOUSE BUILDINGS	WHITE STREET	FIELD SURVEY	NA	This property did not show up on database search. However, locations and descriptions similar to those included below which could not be located via current address.
		41	ADM TRUCKING	818 ASHBY STREET	UST	600191
	46	IRCC OF GEORGIA (FORMERLY PURITAN)	916 ASHBY STREET	GA NON-HSI	S105872224 [†]	Report Date: Jun 2000. Contamination: Vinyl Chloride, Lead.
		INDUSTRIAL RECOVERY CAPITAL COMP		LUST	09060829	2/25/2000: Confirmed Release-NFA.
			UST	9060829	1/5/2000: Removed (1) 8,000-gal Gas UST.	

3.0 Affected Environment
Section 3.9 Contaminated and Hazardous Materials

Final REC ID No.	EDR Ref. No.	Site Name/Owner	Address/Location	Database(s)	Facility/Case ID No.	Comments/Area of Concern(s)
	48	1008 WHITE STREET	1008 WHITE STREET	FINDS	110037165812	FINDS provides a single point of access for sites regulated or monitored by the EPA.
				FIELD SURVEY	NA	Comercial office/warehouse with various businesses.
SW-8 <i>continued</i>	41	AIRPORT DELIVERY SERVICE (ADS MOVING)	858 ASHBY STREET NW	SPILLS	S104874415 [†]	Spill Date: 08/18/2000, Diesel.
		W.E. MARSHALL PETROLEUM PRODUCTS		SPILLS	S104548807 [†]	Spill Date: 06/26/2000, Waste Oil.
				SPILLS	S104874368 [†]	Spill Date: 06/23/2000, Waste Oil.
	41	836 ASHBY STREET, NW	836 ASHBY STREET, NW	ERNS	92261685	03/22/1992: Unknown liquids from MOPAC into Peachtree Creek.
		MOPAC PLANT & BUILDING SERVICES		SPILLS	S101536617 [†]	Spill date: 03/22/1992, Unknown liquids into Peachtree Creek.
				FINDS	110005714566	FINDS provides a single point of access for sites regulated or monitored by the EPA.
				RCRA-CESQG	GAR000013516	No violations found.
46	SIGNAL DELIVERY SRVC	925 ASHBY STREET	SPILLS	S101533551 [†]	Spill Date: 06/05/1991: Gasoline/Fuel Oil into Storm Drain.	
46	981 ASHBY STREET	981 Ashby St	LUST	10000434	9/8/2003: Confirmed Release-NFA.	
SW-9	36	1135 WHITE STREET SW	1135 WHITE STREET SW	FINDS	110037166027	FINDS provides a single point of access for sites regulated or monitored by the EPA.
	34	1100 WHITE STREET	1100 WHITE STREET SW	ERNS	92291362	Spill date: 09/08/1992: 250 gals of Diesel.
		ATLANTA CARRIER CENTER LLC		LUST	09000617	11/28/2000: Confirmed Release-NFA.
				UST	9000617	07/15/1990: Removed (1) 8,000-gal Other, (1) 6,000-gal Other, (1) 1,000-gal Other, (1) 550-gal Other USTs.
		ATLANTA CARRIER CENTER LLC		UST	9000617	4/1/2000: Removed (1) 20,000-gal Diesel UST.
		PENSKE TRANSPORTATION SERVICE		FINDS	110005712782	FINDS provides a single point of access for sites regulated or monitored by the EPA.
	RCRA-NonGen	GAR000010454	No violations found.			
SW-10	31	SUPERMARKET DISTRIBUTION SERVICES	1200 WHITE STREET SW	FINDS	110005700955	FINDS provides a single point of access for sites regulated or monitored by the EPA.
		ADVANCED FOOD		RCRA-NonGen	GAD984311803	No Violations Found.
				SPILLS	S101531449 [†]	Spill Date: 02/18/1993, Gasoline/Fuel Oil into Storm Drain.
				FIELD SURVEY	NA	Property currently identified as Czarnoski Events.
SW-11	54	952 DONNELLY AVENUE SW	952 DONNELLY AVENUE SW	FINDS	110037165554	FINDS provides a single point of access for sites regulated or monitored by the EPA.
SW-12	54	Level 3 Communications	953 DONNELLY	TIER 2	FATR20084X5AY002TFLX	Date Tier 2 Signed: 1/9/2009.

3.0 Affected Environment
Section 3.9 Contaminated and Hazardous Materials

Final REC ID No.	EDR Ref. No.	Site Name/Owner	Address/Location	Database(s)	Facility/Case ID No.	Comments/Area of Concern(s)
		LLC	AVENUE			
SW-13	58	MCI - ATGXGA	999 LEE STREET	TIER 2	FATR200823VS8605WMBT	Date Tier 2 Signed: 01/13/2009.
		WORLDCOM		FINDS	110005720452	FINDS provides a single point of access for sites regulated or monitored by the EPA.
				RCRA-NonGen	GAR000023259	No violations found.
SW-14	54	CONSTRUCTION HAULING INC	948 DONNELLY AVENUE	FINDS	110005683778	FINDS provides a single point of access for sites regulated or monitored by the EPA.
				RCRA-NonGen	GAD981261662	No violations found.
		J&L ASSOCIATES INC		LUST	09060560	12/3/1998: Confirmed Release-NFA.
				UST	9060560	10/01/1998: Removed (1) 10,000-gal Diesel and (1) 2,500-gal Gas USTs.
SW-15	52	988 DONNELLY AVENUE SW	988 DONNELLY AVENUE SW	FINDS	110037165581	FINDS provides a single point of access for sites regulated or monitored by the EPA.
SW-16	42	BELCA FOOD SERVICES	1101 DONNELLY AVENUE SW	SPILLS	S104884791 ^T	Spill Date: 08/18/1994. Anhydrous Ammonia.
				SPILLS	S101527557 ^T	Spill Date: 08/18/1994. Anhydrous Ammonia.
		1101 DONNELLY AVENUE SW		FINDS	110037165974	FINDS provides a single point of access for sites regulated or monitored by the EPA.
				FIELD SURVEY	NA	Abandoned building.
SW-17	51	1035 DONNELLY AVENUE PARTNERSHIP	1035 DONNELLY AVENUE	UST	7060001	3/11/1993: Removed (1) 8,000-gal Diesel UST.
		TERRY ENTERPRISES INC		FINDS	110005720755	FINDS provides a single point of access for sites regulated or monitored by the EPA.
				RCRA-NonGen	GAR000025312	No violations found.
SW-18	NA	FORMER RAILROAD ALIGNMENT	FORMER RAILROAD ALIGNMENT	FIELD SURVEY	NA	Former railroad operations; potential for former and undocumented spills and releases. Potential polychlorinated biphenyls (PCBs), metals, semi-volatile organic compounds (SVOCs), herbicides and pesticides, lead-based paint and asbestos containing building materials on/in relic equipment or structures.
SW-19	18	GEORGIA FOOD MART	1355 R D ABERNATHY BOULEVARD	FINDS	110013527344	FINDS provides a single point of access for sites regulated or monitored by the EPA.
				LUST	00601184	4/16/1992: Confirmed Release-NFA Remediation.
				UST	601184	4/17/1985: (3) 12,000-gal Gas USTs.
				FIELD SURVEY	NA	Active gas station; monitoring wells present.
SW-20	NA	AUTO TRANSMISSION FACILITY/COMMERCIAL BUILDINGS	Intersection of Ralph Gordon and Cascade Rd.	FIELD SURVEY	NA	Based upon field conditions, potential exists to be former Chevron Station #43020.

3.0 Affected Environment
Section 3.9 Contaminated and Hazardous Materials

Table 3.9-1d: Preliminary Contaminated Sites and/or Hazardous Materials Sites Within 300-Foot Buffer Area (Northwest Zone)

Final REC ID No.	EDR Ref. No.	Site Name/Owner	Address/Location	Database(s)	Facility/Case ID No.	Comments/Area of Concern(s)
NW-1	143	MUELLER PROPERTY	NEWCASTLE STREET & MLK JR DRIVE	FINDS	110013414153	FINDS provides a single point of access for sites regulated or monitored by the EPA.
				UST	9000316	(1) UST permanently out of use. Date and contents not provided.
NW-2	143	BP OIL CO	3 ASHBY STREET	FINDS	110005692633	FINDS provides a single point of access for sites regulated or monitored by the EPA.
				RCRA-NonGen	GAD984290288	No violations found.
		BP #24031/GULF #640847	3 JOSEPH E LOWRY BOULEVARD	LUST	09000445	11/8/1989: Confirmed Release-No Further Action (NFA).
				UST	9000445	As of 09/01/1998: (3) 10,000-gal Gas USTs and (1) 10,000-gal Diesel UST currently in use.
NW-3	140	BP #24030/GULF #270645	825 MLK JR DRIVE	UST	600829	(4) 3,000-gal Gas USTs removed. Date not provided.
NW-4	130	ASHBY ST AMOCO FOOD SHOP	949 MAYSON TURNER ROAD	FINDS	110005698655	FINDS provides a single point of access for sites regulated or monitored by the EPA.
				RCRA-NonGen	GAD984301887	No violations found.
		BP/AMOCO #6337	180 GA & CENTRAL	FINDS	110013518737	FINDS provides a single point of access for sites regulated or monitored by the EPA.
				LUST	00600953	12/21/1999, 7/9/2002, 1/2/2004, 4/9/2004, 5/7/2004, 10/29/2004: Suspected Releases-NFA.
				LUST	00600953	6/30/2005: Confirmed Release-Cleanup Initiated.
				LUST	00600953	6/28/2004, 8/30/2004: Suspected Releases.
UST	600953	5/2/2006: Removed (4) 10,000-gal Gas USTs				
NW-5	129	RESIDENCE	139 STAFFORD STREET NW	FINDS	110006366280	FINDS provides a single point of access for sites regulated or monitored by the EPA.
				RCRA-NonGen	GAR000008060	No violations found.
NW-6	127	1055 OLLIE CIRCLE	1055 OLLIE CIRCLE	SPILLS	S105597801 [†]	9/21/2002: spill no. 18985, unknown quantity of raw sewage.
NW-7	125	1099 WASHINGTON HEIGHTS TER NW	1099 Washington Heights Terrace NW	FINDS	110037165965	FINDS provides a single point of access for sites regulated or monitored by the EPA.
NW-8	118	BMTS/MADDOX PARK SATELLITE STATION	1120 NORTH AVENUE NW	UST	600281	As of 3/30/1999: (1) 20,000-gal Diesel, (1) 12,000-gal Gas, (1) 1,000-gal Used Oil USTs currently in use.
						10/1/1998: Removed (1) 6,000-gal Empty, (2) 6,000-gal Gas, (1) 20,000-gal Diesel, (1) 3,000-gal Oil, (1) 500-gal Used Oil USTs.

3.0 Affected Environment
Section 3.9 Contaminated and Hazardous Materials

Final REC ID No.	EDR Ref. No.	Site Name/Owner	Address/Location	Database(s)	Facility/Case ID No.	Comments/Area of Concern(s)
				FINDS	110013488804	FINDS provides a single point of access for sites regulated or monitored by the EPA.
				LUST	600281	7/29/1993: Confirmed Release-Monitoring Only NFA. 6/8/1993: Confirmed Release-Monitoring Only NFA.
	118	NORTH AVENUE CSO	1150 North Ave.	TIER 2	FATR2008252V5302DJV4	Date Tier 2 Signed: 2/25/2009.
	118	1151 NORTH AVENUE NW	1151 NORTH AVENUE NW	FINDS	110037166054	FINDS provides a single point of access for sites regulated or monitored by the EPA.
NW-9	115	DRUM FIND	Bankhead / Marietta Blvd.	SPILLS	S101532832 [†]	12/23/1993: Contents, type and size not provided.
NW-10	115	CSX RAILROAD	860 Marietta Blvd. (between Bankhead)	SPILLS	S101528317 [†]	7/19/1994: Gravel mixed with oil. Amount not provided.
	103		860 Marietta Blvd. NW in front of Bldg.	ERNS	94382498	7/19/1994: Caller states that the material was dumped from the rail car.
NW-11	114	MARTA: BANKHEAD PARCEL No. 05000		GA NON-HSI	S103439826 [†]	Contamination: Tetrachloroethylene; Acetone; Chloroform; Methylene Chloride; cis-1,2-Dichloroethene
NW-12	109	Britt Carpet Laying Co Inc.	673 Rice St. NW	UST	600672	4/9/1989: Removed (1) 3,000-gal Gas UST.
NW-13	109	SMITH EQUIPMENT CO	751 RICE STREET NW	FINDS	110005685507	FINDS provides a single point of access for sites regulated or monitored by the EPA.
				RCRA-NonGen	GAD981268212	No violations found.
NW-14	109	1210 LOVELESS AVENUE	1210 LOVELESS AVENUE	FINDS	110037166161	FINDS provides a single point of access for sites regulated or monitored by the EPA.
NW-15	101	FULTON COUNTY CENTRAL MAINTENANCE	895 MARIETTA BOULEVARD	RCRA-SQG	GAD984313932	No violations found.
				FINDS	110009357784	FINDS provides a single point of access for sites regulated or monitored by the EPA.
				UST	9060122	As of 12/01/1998: (2) 12,000-gal Gas, (1) 12,000-gal Diesel, (1) 2,000-gal Kerosene, (3) 2,000-gal Other, (1) 4,000-gal Other USTs in use. 3/11/2003: (1) 6,000-gal Used Oil UST temporarily out of use. 3/1/1999: Removed (1) 2,000-gal Other UST.
				LUST	09060122	4/1/1999: Confirmed Release-NFA.
NW-15 <i>continued</i>	101	FULTON COUNTY JAIL	901 RICE STREET	AST	A100331007	(1) 30,000-gal above ground storage tank in use.
				FINDS	110013481464	FINDS provides a single point of access for sites regulated or monitored by the EPA.

3.0 Affected Environment
Section 3.9 Contaminated and Hazardous Materials

Final REC ID No.	EDR Ref. No.	Site Name/Owner	Address/Location	Database(s)	Facility/Case ID No.	Comments/Area of Concern(s)	
				LUST	09060773	10/15/2003: Confirmed Release-NFA.	
				UST	9060773	7/3/2003: Removed (1) 15,000-gal Diesel UST. As of 8/22/2003: (1) 15,000-gal Diesel UST currently in use.	
						12/4/1999: Spill into Proctor Creek.	
	101	CITY OF ATLANTA 902 RICE STREET	901 RICE STREET 902 RICE STREET	SPILLS FINDS	S104885172† 110037165484	FINDS provides a single point of access for sites regulated or monitored by the EPA.	
NW-16	103	829 MARIETTA BOULEVARD NW	829 MARIETTA BOULEVARD NW	FINDS	110037171146	FINDS provides a single point of access for sites regulated or monitored by the EPA.	
NW-17	109	FORMER AZS CORP AZS CORP SURFACE IMPOUNDMENTS	762 MARIETTA BOULEVARD NW	GA NON-HSI	S104819398†	Contamination: Not reported.	
				RCRA-SQG	GAD981237225	Facility has received multiple notices of violations.	
				FINDS	110013761143	FINDS provides a single point of access for sites regulated or monitored by the EPA.	
				RCRA-TSDF	GAD981237225	Handler is engaged in the treatment, storage or disposal of hazardous waste.	
				CORRACTS	GAD981237225	CORRACTS Action Dates from 1/9/1985 to 9/8/2006.	
				FTTS	Not Provided	Final Order Date: 11/30/1995. Proposed Penalty: \$145,000. Final Assessment: \$55,000.	
				HIST FTTS	Not Provided	Final Order Date: 11/30/1995. Proposed Penalty: \$145,000. Final Assessment: \$55,000.	
				AZS CORP	TSCA	Not Provided	Facility manufactures or imports multiple toxic chemicals on the TSCA list.
				CARGILL INC	TSCA	115-77-5	Facility manufactures or imports toxic chemicals on the TSCA list: 1,3-Propanediol, 2,2-bis(hydroxymethyl)-Pentaerythritol.
					CERCLIS	401497	CERCLIS Report indicates that, "Compliance with RCRA post-closure requirements is questionable with this facility."
					FINDS	110003603459	FINDS provides a single point of access for sites regulated or monitored by the EPA.
				CORRACTS	GAD057288144	CORRACTS activity began 11/8/1991.	
				CERC-NFRAP	0401497	Not on the NPL.	
				GA NON-HSI	Not Provided	Report Date: 3/1/1995. Contamination: Methylene Chloride.	
	RCRA-NonGen	GAD057288144	Facility has received notices of violations.				
	NY MANIFEST	GAD057288144	32,900 lbs of Methyl Methacrylater (L,T) transported and incinerated.				

3.0 Affected Environment
Section 3.9 Contaminated and Hazardous Materials

Final REC ID No.	EDR Ref. No.	Site Name/Owner	Address/Location	Database(s)	Facility/Case ID No.	Comments/Area of Concern(s)	
NW-18	98	BROWNING FERRIS INDUSTRIES	920 MARIETTA BOULEVARD NW	FINDS	110005668919	FINDS provides a single point of access for sites regulated or monitored by the EPA.	
				CERC-NFRAP	0401540	7/18/1990: No further action.	
				RCRA-NonGen	GAD069210342	No violations found.	
				RCRA-NonGen	GAD981233091	No violations found.	
NW-19	89	RAYLOC	1270 WEST MARIETTA ST NW	UST	600259	10/15/1989: Removed (2) 8,000-gal Empty USTs.	
NW-20	98	998 MARIETTA BOULEVARD NW	998 MARIETTA BOULEVARD NW	FINDS	110037165616	FINDS provides a single point of access for sites regulated or monitored by the EPA.	
NW-21	85	MACMILLAN BLOEDEL BUILDING MATERIALS	1350 MARIETTA BOULEVARD	LUST	09060748	1/15/1999: Confirmed Release-NFA.	
				UST	9060748	1/7/1999: Removed (1) 2,000-gal Diesel UST.	
NW-22	85	SPECIALTY FINISHES INC	1251 MARIETTA BOULEVARD NW	FINDS	110005282835	FINDS provides a single point of access for sites regulated or monitored by the EPA.	
				RCRA-NonGen	GAD981278344	No violations found.	
NW-23	85	ANDERSON-MCGRUFF CO	1335 MARIETTA BOULEVARD	FINDS	110001422096	FINDS provides a single point of access for sites regulated or monitored by the EPA.	
				LUST	09000178	2/13/1989: Confirmed Release-In Remediation.	
				UST	9000178	(1) 1,000-gal Gas and (1) 500-gal Gas USTs Permanently out of use.	
				AIRS	041312100302	State Facility Identifier: 312100302.	
				GA NON-HSI	S104906597 [†]	Report Date: 4/1/2001. Contamination: 1,1-Dichloroethene.	
NW-24	85	ALLIED READYMIX, INC.	1360 MARIETTA BOULEVARD	FINDS	110001420123	FINDS provides a single point of access for sites regulated or monitored by the EPA.	
		NORTH ATLANTA READY MIX - DOWNTOWN		AIRS	041312100724	State Facility Identifier: 312100724.	
				TIER2	FATR200846SGQ901YGD2	Date Tier 2 Signed: 2/2/2009.	
				TIER2	FATR200822AZDF00LXY7	Date Tier 2 Signed: 2/2/2009.	
NW-25	62	FLINT GROUP	1339 ELLSWORTH INDUSTRIAL BOULEVARD	GA NON-HSI	S109261574 [†]	Report Date: 7/8/2008. Contamination: Lead.	
		FLINT INK CORPORATION		ERNS	2007842835	7/18/2007: 50 to 100 gals of Diesel fuel spilled from motor vehicle accident.	
				AIRS	041312100336	State Facility identifier: 312100336.	
				FTTS	19940825OH029	Inspection Date: 08/25/1994.	
				HIST FTTS	19940825OH029	Permitted Disposer - Alternative Methods.	
		SINCLAIR AND VALENTINE CO INC			SPILLS	S102230569 [†]	3/13/1996: Amount and type not identified.
		FINDS			110000357676	FINDS provides a single point of access for sites regulated or monitored by the EPA.	
		CERC-NFRAP			0401482	4/13/1989: No further action.	
		NY MANIFEST			GAD054215652	550 gals of non-listed ignitable wastes.	
RCRA-NonGen	GAD054215652	Facility has received notices of violations.					

3.0 Affected Environment
Section 3.9 Contaminated and Hazardous Materials

Final REC ID No.	EDR Ref. No.	Site Name/Owner	Address/Location	Database(s)	Facility/Case ID No.	Comments/Area of Concern(s)
		OVERNIGHT TRANSPORTATION		SPILLS	S104548587 [†]	1/6/2000: Spill into storm drains. Quantity and material not provided.
NW-26	68	REYNOLDS ALUMINUM SUPPLY CO	1441 ELLSWORTH IND DRIVE NW	UST	600056	5/25/1987: Removed (1) 10,000-gal Empty UST.
NW-27	63	1415 Howell Mill Rd.	1415 Howell Mill Rd.	BROWNFIELDS	S108988947 [†]	Cleanup Plan Date: 1/28/2008.
NW-28	63	SUNBELT RENTALS PC #055	1450 HOWELL MILL ROAD	SPILLS	S106487807 [†]	04/27/2004: A diesel taste was reported in the water fountain.
				SPILLS	S106487735 [†]	04/13/2004: Diesel fuel was spilled on 04/12/2004 and into storm drain.
				TIER2	FATR20085MND60001TTF	Date Tier 2 Signed: 2/2/2009.
				FINDS	110037166278	FINDS provides a single point of access for sites regulated or monitored by the EPA.
NW-29	63	1465 HOWELL MILL ROAD PROPERTY	1465 HOWELL MILL ROAD	GA NON-HSI	S108782045 [†]	Report Date: 10/7/2007. Contamination: Trichloroethene.
NW-30	63	S J AUTOMOTIVE INC	1491 HOWELL MILL ROAD	FINDS	110005680539	FINDS provides a single point of access for sites regulated or monitored by the EPA.
				RCRA-NonGen	GAD981237506	No violations found.
NW-31	66	CITY OF ATLANTA	711 Trabert Ave.	SPILLS	S102272916 [†]	7/21/92: spill no. 0123, unknown material, quantity, affected media.
NW-32	66	VINTAGE MILL WORKS	670 Trabert Ave.	GA NON-HSI	S104819477 [†]	Ground water pathway score: 3.25; PCE.
NW-33	63	782 TRABERT AVENUE NW	782 Trabert Ave. NW	FINDS	110037170995	FINDS provides a single point of access for sites regulated or monitored by the EPA.
NW-34	65	613 TRABERT AVENUE NW	613 Trabert Ave. NW	FINDS	110037170548	FINDS provides a single point of access for sites regulated or monitored by the EPA.
NW-35	54	CECIL MALONE CO	696 Antone St. NW	UST	9060044	4/18/1990: Removed (3) 1,000-gal Gas USTs.
NW-36	54	WOOSTER PROPERTY	644 Antone St. NW	GA NON-HSI	S104819480 [†]	Contamination: Not reported.
NW-37	58	ESSELTE PENDAFLEX - DYMO DIVISION	1590 NORTHSIDE DRIVE NW	FINDS	110005669213	FINDS provides a single point of access for sites regulated or monitored by the EPA.
				RCRA-NonGen	GAD075939082	No violations found.
NW-38	58	BMTS NORTHSIDE DRIVE SERVICE CENTER	1540 NORTHSIDE DRIVE NW	FINDS	110013499026	FINDS provides a single point of access for sites regulated or monitored by the EPA.
				LUST	00600284	6/30/1998: Confirmed Release-NFA.
				UST	600284	8/26/1998: Removed (1) 12,000-gal Gas UST. 6/28/1998: Installed (1) 12,000-gal Used Oil, (1) 12,000-gal Diesel, (1) 12,000-gal Gas USTs.
						6/28/1998: Removed (1) 12,000-gal Gas, (1) 5,000-gal Empty, (1) 6,000-gal Empty, (1) 500-gal Used Oil, (1) 1,000-gal Other USTs.
		CITY OF ATLANTA		RCRA-SQG	GAD981240898	Facility has received notices of violations.

3.0 Affected Environment
Section 3.9 Contaminated and Hazardous Materials

Final REC ID No.	EDR Ref. No.	Site Name/Owner	Address/Location	Database(s)	Facility/Case ID No.	Comments/Area of Concern(s)	
				FINDS	110005680806	FINDS provides a single point of access for sites regulated or monitored by the EPA.	
				SPILLS	1000440385	6/19/1997: 1,200 gals sewage spill.	
NW-39	58	POTTER & RAYFIELD	1570 NORTHSIDE DRIVE	FINDS	110001421596	FINDS provides a single point of access for sites regulated or monitored by the EPA.	
		MICRO VIEW		SPILLS	S101643808 [†]	8/17/1994: Aqueous Ammonia.	
				AIRS	41312100046	State Facility Identifier: 312100046.	
NW-40	58	400 NORTHSIDE CIRCLE NW	400 NORTHSIDE CIRCLE NW	FINDS	110037167188	FINDS provides a single point of access for sites regulated or monitored by the EPA.	
NW-41	50	LECRAW JULIAN & COMPANY (STE 200)	1575 NORTHSIDE DRIVE NW	FINDS	110009358998	FINDS provides a single point of access for sites regulated or monitored by the EPA.	
					RCRA-NonGen	GAR000013235	No violations found.
				JULIAN LECRAW & CO INC/ WINTERSET APT (PO BOX 4208)	FTTS	199512135687	Inspection Date: 12/13/1995.
				USF&G	HIST FTTS	199512135687	Investigation Type: Section 6 PCB Federal Conducted.
					FINDS	110009358854	FINDS provides a single point of access for sites regulated or monitored by the EPA.
					RCRA-NonGen	GAR000010322	No violations found.
				200-400 Atlanta Tech Ctr.	FINDS	110009358694	FINDS provides a single point of access for sites regulated or monitored by the EPA.
					RCRA-NonGen	GAR000009043	No violations found.
				Atlanta Tech Ctr.	GA NON-HSI	S104819360 [†]	Contamination: Not reported.
				700 Atlanta Tech Ctr.	GA NON-HSI	S104819348 [†]	Contamination: Not reported.
				COLOR EXPRESS INC (STE 475)	FINDS	110009358408	FINDS provides a single point of access for sites regulated or monitored by the EPA.
					RCRA-NonGen	GAR000004994	No violations found.
				SPAUSCHUS ASSOCIATES INC	FINDS	110005698021	FINDS provides a single point of access for sites regulated or monitored by the EPA.
			RCRA-NonGen	GAD984300350	No violations found.		
NW-42	41	UNKNOWN	1593 Walthall Ct.	SPILLS	S102273301 [†]	Spill Date: 4/13/1993.	
NW-43	33	BIOMED SOUTHEAST	COLLIER ROAD @ ARDMORE ROAD	SPILLS	S101530621 [†]	2/25/1995: diesel spill to nearby stormdrain and creek.	
NW-44	15	COLONIAL HOMES	240 COLONIAL HOMES DRIVE	SPILLS	S105229614 [†]	11/20/2001: Draining swimming pool water into stormdrain which discharges to nearby stream.	
					BROWNFIELDS	S105229614 [†]	4/6/2006: Cleanup completed 17 acres.
					GA NON-HSI	S105229614 [†]	Report Date: 3/5/2005: Contaminants: Vinyl Chloride and PCE.
NW-45	11	KISS CLEANERS	2140 PEACHTREE ROAD NW # 250B	DRYCLEANER	664443173	Dry cleaning and laundry services.	

3.0 Affected Environment
Section 3.9 Contaminated and Hazardous Materials

Final REC ID No.	EDR Ref. No.	Site Name/Owner	Address/Location	Database(s)	Facility/Case ID No.	Comments/Area of Concern(s)
NW-46	11	TRITON FACILITY	2166 PEACHTREE ROAD	LUST	09000351	2/10/1989: Confirmed release - cleanup initiated.
				UST	9000351	One UST permanently out of use, unknown contents and capacity.
		BUCKHEAD BROOKWOOD ASSOC LP		FINDS	110005707388	FINDS provides a single point of access for sites regulated or monitored by the EPA.
		RCRA-NonGen		GAR000000398	No violations found.	
NW-47	11	NATIONSBANK OF GA AND ELLIOTT GOLDS	75 BENNETT STREET	GA NON-HSI	S105872226 [†]	Report Date: 3/1/1994.
NW-48	11	2105 TULA STREET NW	2105 TULA STREET NW	FINDS	110037167044	FINDS provides a single point of access for sites regulated or monitored by the EPA.
				LUST	10000200	12/10/2002: Confirmed release - NFA.
NW-49	11	BENNETT STREET, LTD.	2110 Peachtree St	GA NON-HSI	S104240223 [†]	Ground water pathway score: 3.25.
NW-50	11	PALMERS FOOD STORE	2060 PEACHTREE ROAD NW	FINDS	110013518452	FINDS provides a single point of access for sites regulated or monitored by the EPA.
				LUST	00600959	4/5/1995: Confirmed release - NFA.
				UST	600959	5/22/1978: (4) 10,000-gal Gas USTs installed.
NW-51	11	CLC ENTERPRISES INC/PROPOSED TGI	2065 PEACHTREE STREET NE	LUST	09060299	10/6/1993: Confirmed release - NFA.
				UST	9060299	9/28/1993: (2) 4,500-gal Gas USTs removed.
NW-52	20	CITY OF ATLANTA	385 CAMDEN ROAD	SPILLS	S104885110 [†]	4/26/1999: unknown quantity raw sewage discharged to Peachtree Creek.
NW-53	13	260 KINSEY COURT NE	260 KINSEY COURT NE	SPILLS	S108118143 [†]	8/2/2006: spill no. 40777, unknown quantity of material.
NW-55	35	COMPASS COLLECTIVE	165 OTTLEY DRIVE	FINDS	110005718697	FINDS provides a single point of access for sites regulated or monitored by the EPA.
				RCRA-CESQG	GAR000020479	No violations found.
NW-56	30	215 OTTLEY DRIVE NE	215 OTTLEY DRIVE NE	HMIRS	2005030677	3/9/2005: spill, unknown quantity and material.
NW-57	30	NATIONAL STARCH & CHEMICAL CORP	195 OTTLEY DRIVE NE	UST	600002	6/1/1988: Removed (1) 7,500-gal Heating Oil UST.
				FINDS	110002101546	FINDS provides a single point of access for sites regulated or monitored by the EPA.
				CERC-NFRAP	401301	8/1/1980: Discovery; 5/20/1986: PA.
				RCRA-NonGen	GAD001884220	No violations found.
NW-58	O 5	LAFARGE BUILDING MATERIALS, INC.	842 ARMOUR DRIVE	AIRS	041312100607	State Facility ID: 312100607.
NW-61	26	SOUTHERN SIGNATURES INC	201 ARMOUR DRIVE	FINDS	110001752096	FINDS provides a single point of access for sites regulated or monitored by the EPA.
				RCRA-NonGen	GAD984307298	No violations found.

3.0 Affected Environment
Section 3.9 Contaminated and Hazardous Materials

Final REC ID No.	EDR Ref. No.	Site Name/Owner	Address/Location	Database(s)	Facility/Case ID No.	Comments/Area of Concern(s)
				AIRS	041312100718	State Facility ID: 312100718.
NW-62	21	ATLANTA SEWER DEPT	269 ARMOUR DRIVE	SPILLS	S104548744 [†]	4/13/2000: spill no. 5, unknown quantity of raw sewage into north fork of Peachtree Creek.
NW-63	107	FULTON CO FIRE/BELLWOOD GARAGE	1101 JEFFERSON STREET NW	UST	600534	(1) 2,500-gal Gas UST permanently out of use unknown date; (1) 3,000-gal Gas UST permanently out of use unknown date; 1/1/1981: (1) 12,000-gal Gas UST permanently out of use; (1) 300-gal kerosene UST permanently out of use unknown date.
					9060102	2/25/1997: Removed (2) 10,000-gal Diesel USTs and (2) 550-gal Used Oil USTs. 9/25/1990: Removed (1) 8,000-gal Diesel UST, (1) 6,000-gal Diesel UST, and (1) 6,000-gal Gas UST. 1/1/1990: Removed (1) 550-gal used oil UST.
				LUST	09060102	3/24/1999: Confirmed release - NFA; 4/14/1997: Confirmed release - NFA.
NW-64	107	DAVIDSON-KENNEDY CO INC	1090 JEFFERSON STREET NW	UST	600029	4/1/1990: Removed (1) 1,000-gal gas UST.
				FINDS	110001422390	FINDS provides a single point of access for sites regulated or monitored by the EPA.
				AIRS	041312100683	State Facility ID: 312100683.
NW-65	107	1058 JEFFERSON STREET NW	1058 JEFFERSON STREET NW	FINDS	110037165876	FINDS provides a single point of access for sites regulated or monitored by the EPA.
NW-68	99	1075 BAYLOR ST NW	1075 BAYLOR STREET NW	FINDS	110037165885	FINDS provides a single point of access for sites regulated or monitored by the EPA.
NW 76	115	RAYLOC INC	1130 BANKHEAD AVENUE NW	LUST	00600552	3/25/1996: Confirmed Release-No Further Action (NFA).
				UST	600552	01/11/1990: Removed (1) 8,000-gal Diesel UST.
NW 77	113	BANKHEAD ENTERPRISES	1080 BANKHEAD AVENUE NW	FINDS	110005675331	FINDS provides a single point of access for sites regulated or monitored by the EPA.
				RCRA-NonGen	GAD981221062	No violations found.
				UST	600785	9/15/2000: Removed (1) 8,000-gal Gas UST; (1) 3,000-gal Diesel UST; (1) 500-gal Used Oil UST; (1) 2,000-gal Diesel UST.
NW-81	91	MEED PACKING CORP	1105 HERNDON STREET NW	SPILLS	S102918542 [†]	Nitric Oxide.
				FINDS	110012597573	FINDS provides a single point of access for sites regulated or monitored by the EPA.
				RCRA-CESQG	GAD000814483	12/16/1987: Generators-General violation, regulation not reported, 3/21/1989: achieved

3.0 Affected Environment Section 3.9 Contaminated and Hazardous Materials

Final REC ID No.	EDR Ref. No.	Site Name/Owner	Address/Location	Database(s)	Facility/Case ID No.	Comments/Area of Concern(s)
						compliance; 1/16/1986: Generators-General violation, regulation not reported, 4/7/1986: achieved compliance.
				AIRS	041312100070	State Facility Identifiers: 312100070 and 12100070.
				UST	670529	11/30/1988: (1) 12,000-gal UST unknown contents removed.
				ICIS	FRS 110012597573	Enforcement Action ID: 04-2007-1775.
				SPILLS	2583	9/21/1990: Material, quantity, and affected media not reported.
NW-107	78	NOTTINGHAM - ATLANTA	1303 BOYD AVENUE NW	TSCA	1005931059	Manufacturer: CAS #110-30-5, CAS #61791-30-8, CAS #61790-60-1, CAS #67762-90-7, CAS #64754-93-4, CAS #68153-66-2, CAS #68910-93-0, CAS #68608-26-4, CAS #70955-35-0.
				FINDS	110001751239	FINDS provides a single point of access for sites regulated or monitored by the EPA.
				GA NON-HSI	GAR000007823	Report Date: 8/1/1999.
				RCRA-CESQG	GAR000007823	No violations found.
				AIRS	041312100661	State Facility Identifier: 312100661.
				TIER 2	FATR20083KL81V002W2Q	Date Tier 2 signed: 2/27/2009.
				SPILLS	10440	4/16/2001: Spilled 1,470 gallons: polyether, distilled fatty acid, non-ionic surfactant.
				TRIS	30318NTTNG13	No further information provided.
				FINDS	110038270830	FINDS provides a single point of access for sites regulated or monitored by the EPA.
				PERFORMANCE PROCESS, INC		SPILLS

Note: Information is preliminary and locations should be considered approximate. All sites were reviewed and verified using the Google Earth® or similar geo-referencing program. However, field verification, except where noted, of all sites is required for more accurate locations.

†: State and/or Federal case identifying numbers are provided. EDR's report numbers were used when State or Federal case numbers not known.

NA: No EDR Reference Number provided. Information obtained from the Orphan Sites List from the respective EDR DataMap™ Corridor Study or via Field Survey.

Sources: 1. EDR DataMap™ Corridor Study, Inquiry Numbers: 02244958.3r, dated June 17, 2008, 02517938.1r, dated June 15, 2009, 02517938.2r, dated June 16, 2009, and 02558078.1r dated August 10, 2009. 2. Information obtained from the United States Environmental Protection Agency's Multisystem Envirofacts Query Form (<http://www.epa.gov/enviro/html/multisystem.html>) accessed and reviewed on June 18, 2008. 3. Information obtained from the United States Environmental Protection Agency's Superfund Information Systems Superfund Site Information website (<http://cfpub.epa.gov/superfund/cursites/srchrsit.cfm?Start=51&sortby=site>) accessed and reviewed on July 21, 2008. 4. Information obtained from the GEPD Application for Limitation of Liability under the Georgia Hazardous Site Reuse and Redevelopment Act Response Actions (Non-HIS and HSI Properties) dated 05/05/2008.

3.0 Affected Environment Section 3.10 Utilities

Table 3.10-1: Electrical Facilities

Zone	Electric Facility Location
Northeast	<ul style="list-style-type: none"> • Underground primary and network electrical lines cross or run parallel to the railroad ROW and in-street segments between the MARTA Orange Line at Lindbergh Center and the MARTA Blue and Green Lines. • Railroad ROW crossings occur at Monroe Drive (network line) and Ralph McGill Boulevard. • Lines run parallel within the railroad ROW in the vicinity of Monroe Drive and Ponce De Leon Avenue, Ralph McGill Boulevard and Freedom Parkway, Freedom Parkway and John Wesley Dobbs Avenue. • Along the in-street alignment, both at Edgewood Avenue and network lines cross along Boulevard.
Southeast	<ul style="list-style-type: none"> • Underground primary and network electrical lines cross or run parallel to the GDOT railroad ROW and in-street segments of the Build Alternatives between MARTA Blue and Green Lines and the MARTA Orange Line. • Along the railroad ROW, crossings occur on the westbound ramp to I-20 and eastbound ramp from I-20, between I-20 and Sanders Avenue, Ormewood Avenue, and Murphy Street. • Lines run parallel within the railroad ROW along Memorial Drive and I-20, between Sanders Avenue and Glenwood Avenue, south of Confederate Avenue, and west of Murphy Avenue. • Along the in-street alignment of the Preferred Alternatives, underground primary and network electrical lines run along Memorial Drive and the ROW of Ralph David Abernathy Boulevard near the MARTA Orange Line and Norfolk Southern railroad ROWs.
Southwest	<ul style="list-style-type: none"> • Between the MARTA Orange Line and MARTA Blue and Green Line under Lena Street • Underground primary lines cross or run parallel to the CSX ROW • In-street segments of the Preferred Alternatives at two locations. Along the railroad ROW, there is a crossing north of Lawton Street and a line running along the CSX ROW between Mayson Turner Road and Westmoor Drive • Along the in-street alignments of the Preferred Transit Alternative, underground primary lines run along the Mayson Turner Road ROW between Martin Luther King Jr. Drive and Harwell Street.
Northwest	<ul style="list-style-type: none"> • Between MARTA Blue and Green Line under Lena Street and MARTA Orange Line at Lindbergh Center • Underground primary and network electrical lines cross or run parallel to the CSX ROW • Along in-street segments of the Preferred Transit Alternative at 21 locations. • A primary line runs along the existing CSX Line near Archer Way and Temple Street. • A network line crosses the CSX ROW west of the Rice Street and Marietta Boulevard intersection. In the same vicinity, primary lines run parallel to the CSX ROW. • Along the in-street portion, primary lines run parallel to Marietta Boulevard for a short distance north of Niles Avenue. • In the Lindbergh Center area of the northwest zone, primary electrical lines cross the in-street Preferred Transit Alternative along Garson Drive at Plasters Avenue west of Armour Drive, and at Lindbergh Way near the MARTA ROW. Primary line runs along Piedmont Road between I-85 and Lindbergh Way. • Potential electrical utility impacts exist along the Preferred Transit Alternative between West Marietta Boulevard and Lindbergh Center. • Along the proposed alignments of the Preferred Transit Alternative utilizing the CSX rail corridor, primary lines run inside of the CSX ROW in several locations: south of Kennesaw Drive, west of Northside Drive through 26th Street near I-75, and east and west of Peachtree Road. • Network lines cross on Peachtree Road and run along the alignment west of Peachtree Road.

3.0 Affected Environment Section 3.10 Utilities

Table 3.10-2: Communication Facilities

Zone	Communication Facility Location
Northeast	<ul style="list-style-type: none"> • Railroad ROW at Irwin Street • Between I-85 and Parkway Drive to DeKalb Avenue • South of Wylie Street • Edgewood Avenue between Grant Street and Delta Place • Grant Street between Edgewood Avenue and the CSX railroad ROW
Southeast	<ul style="list-style-type: none"> • Wylie Street between Boulevard and Walthall Street • Glenwood Memorial Connector between Memorial Drive and Glenwood Avenue as well as under Memorial Drive • GDOT railroad ROW between Lawton Street and Glenwood Avenue • In-street portion of the Preferred Alternatives on Allene Avenue (potential conflict at this latter location would be avoided, if possible, as a large relocation effort would be needed)
Southwest	<ul style="list-style-type: none"> • In-street portion of the Preferred Alternatives on Lee Street • GDOT and CSX railroad ROW between Simpson Street and Lawton Street
Northwest	<ul style="list-style-type: none"> • CSX ROW for a ¼-mile between Armour Drive and Peachtree Hills Road • Joseph E. Lowery Boulevard as they cross the proposed alignment of the Preferred Transit Alternative • CSX ROW between south of North Street and Foster Place • ROW between Hornady Street and Finley Street that runs along the shared Norfolk Southern and CSX railroad ROW parallel to Jefferson Street • Jefferson Street and across the ROW near Joseph E. Lowery Boulevard • Lindbergh Center area along Armour Drive and in the vicinity of the concrete plant, crossing the CSX ROW • The Preferred Alternatives at the Amour Drive and Plasters Road intersection • Monroe Drive west of Armour Drive

Table 3.10-3: Natural Gas Facilities

Zone	Natural Gas Location
Northeast	<ul style="list-style-type: none"> • Occurs in-street along Montgomery Ferry Drive, Piedmont Avenue, Monroe Drive, Virginia Avenue, Lake Avenue, Edgewood Avenue, and DeKalb Avenue • Crosses under the former railroad ROW between I-85 and DeKalb Avenue
Southeast	<ul style="list-style-type: none"> • Occurs in-street along Wylie Street, Kirkwood Avenue, Memorial Drive, Glenwood Avenue, Ormewood Avenue, East Confederate Avenue, Boulevard, Milton Avenue, Ridge Avenue, Allene Avenue, and Murphy Avenue
Southwest	<ul style="list-style-type: none"> • Occurs in-street along Ralph David Abernathy Boulevard, Hunter Place, Harwell Street, and Lena Street
Northwest	<ul style="list-style-type: none"> • Occurs in-street along Joseph E. Lowery Boulevard, parallel to and west of Archer Way, Jefferson Street, West Marietta Street, Howell Road, and Northside Drive

3.0 Affected Environment Section 11 Air Quality

Table 3.11-1: National and Georgia Ambient Air Quality Standards

Pollutant	Standard Type	Averaging Period	Standard Value ^a
Carbon Monoxide (CO)	Primary and Secondary ^b Primary and Secondary	8-hour average	9 ppm (10 mg/m ³) ^c
		1-hour average	35 ppm (40 mg/m ³)
Nitrogen Dioxide (NO ₂)	Primary and Secondary	Annual arithmetic mean	0.053 ppm (100 µg/m ³) ^c
Ozone (O ₃)	Primary and Secondary	8-hour average	0.075 ppm (155 µg/m ³) ^d
Sulfur Dioxide (SO ₂)	Primary Primary Secondary	Annual arithmetic mean	0.03 ppm (80 µg/m ³)
		24-hour average ^f	0.14 ppm (365 µg/m ³)
		3-hour average	0.5 ppm (1300 µg/m ³)
Particulate Matter (PM ₁₀)	Primary and Secondary	24-hour average	150 µg/m ³ ^e
Particulate Matter (PM _{2.5})	Primary and Secondary	Annual arithmetic mean	15 µg/m ³
		24-hour average	35 µg/m ³
Lead (Pb)	Primary and Secondary	Rolling 3-month average ^f	0.15 µg/m ³
		Quarterly average	1.5 µg/m ³

a: Short-term standards (1 to 24 hours) are not to be exceeded more than once per calendar year.

b: Former national secondary standards for carbon monoxide have been repealed.

c: Concentrations are shown in parts per million (ppm), milligrams per cubic meter (mg/m³) or micrograms per cubic meter (µg/m³). Georgia utilizes the 2nd maximum measured concentration to determine conformance with the NAAQS.

d: Maximum daily one-hour (eight-hour) average. The ozone standard is attained when the expected number of days with maximum hourly (eight-hourly) average concentrations above the value of the standard, averaged over a three year period, is less than or equal to one. Georgia utilizes the 2nd maximum measured concentration to determine conformance with the NAAQS. The O₃ criterion was updated by the EPA on May 27, 2008 from 0.08 to 0.075 ppm. Georgia utilizes the fourth maximum measured concentration to determine conformance with the NAAQS. Georgia also sets a less-stringent standard of 0.085 ppm as compared to the federal standard of 0.075 ppm.

e: For each particle size, the annual PM standard is met when the three-year average of the annual mean concentration is less than or equal to the value of the standard. The 24-hour PM₁₀ (PM_{2.5}) standard is met when the three-year average of the annual 99th (98th) percentile values of the daily average concentrations is less than or equal to the value of the standard. Georgia utilizes the 2nd maximum measured concentration for PM₁₀ and the 98th percentile values for PM_{2.5} to determine conformance with the NAAQS.

f: National standards are block averages rather than moving averages.

g: Final rule signed October 15, 2008.

Source: 40 CFR 50, National Primary and Secondary Ambient Air Quality Standards.

3.0 Affected Environment Section 11 Air Quality

Table3.11-2: Recently Monitored Ambient Air Quality in the Region

Criteria	Averaging		2005		2006		2007		2008	
Pollutant	Period	NAAQS	4 th Max ^a	#Day >Std ^b	4 th Max	#Day >Std	4 th Max	#Day >Std	4 th Max	#Day >Std
Ozone (O ₃)	8-hour	0.075	0.092	20	0.092	21	0.098	22	0.084	12
	Site	ppm	Confederate Avenue, Atlanta (Fulton County)							
	8-hour	0.075	0.087	12	0.096	24	0.096	24	0.096	24
	Site	ppm	South DeKalb, Decatur (DeKalb County)							
			1 st Max ^a	2 nd Max ^a	1 st Max	2 nd Max	1 st Max	2 nd Max	1 st Max	2 nd Max
Carbon Monoxide (CO)	1-hour	35.0	--	2.6	--	3.2	--	2.1	--	2.1
	8-hour	9.0	--	1.8	--	1.8	--	1.4	--	1.2
	Site	ppm	4434 Roswell Road, Atlanta, Atlanta (Fulton County)							
Sulfur Dioxide (SO ₂)	3-hour	0.03	0.053	0.051	0.074	0.073	0.077	0.067	0.044	0.041
	24-hour	0.14	0.02	0.019	0.019	0.018	0.021	0.018	0.019	0.015
	Annual	0.5	0.003	--	0.003	--	0.003	--	0.003	--
	Site	ppm	Georgia Institute of Technology, Ford ES&T Building, 311 Ferst Street, Atlanta (Fulton County)							
Particulate Matter (PM ₁₀)	24-hour	150	--	47	--	42	--	47	--	146
	Site	µg/m ³	Fulton County Health Department, 99 Butler Street SE, Atlanta (Fulton County)							
	24-hour	150	--	57	--	53	--	89	--	46
	Site	µg/m ³	Georgia Institute of Technology, Ford ES&T Building, 311 Ferst Street, Atlanta (Fulton County)							
			Ann. Mean	#Day >Std ^b	Ann. Mean	#Day >Std	Ann. Mean	#Day >Std	Ann. Mean	#Day >Std
Nitrogen Dioxide (NO ₂)	Annual	0.053	0.017	0	0.018	0	0.017	0	0.015	0
	Site	ppm	Georgia Institute of Technology, Ford ES&T Building, 311 Ferst Street, Atlanta (Fulton County)							
			98 th %ile ^a	3-yr ^a Mean	98 th %ile	3-yr Mean	98 th %ile	3-yr Mean	98 th %ile	3-yr Mean
Particulate Matter (PM _{2.5})	24-hour	35	34.3	--	32	--	30.8	--	34.9	--
	Annual	15	--	15.86	--	15.30	--	16.05	--	15.72
	Site	µg/m ³	E. Rivers School, 8 Peachtree Battle Avenue NW, Atlanta (Fulton County)							

^a The concentrations used to determine attainment with the NAAQS are reported (e.g., 4th highest 8-hour ozone concentration).

^b The number of days that the pollutant standard was exceeded.

Source: U.S. Environmental Protection Agency AIRData website (<http://www.epa.gov/air/data/geosel.html>).

3.0 Affected Environment
Section 3.15 Biological Resources

Table 3.15-1: Listed Plant and Animal Species in Fulton County

Species Name	Type of Species	Listing	Zone Where Species Observed
Bachman's Sparrow – <i>Aimophila aestivalis</i>	Bird	State Protected	Southwest - found approximately two miles south of the project site
Bald Eagle – <i>Haliaeetus leucocephalus</i>	Bird	Federally & State Protected	NA
Barren Strawberry – <i>Waldsteinia lobata</i>	Plant	State Protected – Threatened	NA
Bay Star-vine – <i>Schisandra glabra</i>	Plant	State Protected – Threatened	Northeast - found in three unspecified locations near the project site: 1.5 miles northeast of the project site, 2.5 miles east of the project site, and an occurrence 3 miles east of the project site
Bluestripe Shiner – <i>Cyprinella callitaenia</i>	Fish	State Protected – Threatened	NA
Chattahoochee Crayfish – <i>Cambarus howardi</i>	Aquatic Arthropod	State Protected	Northeast - found approximately two miles east of the project site in Peachtree Creek
Cherokee Darter – <i>Etheostoma scotti</i>	Fish	Federally & State Protected – Threatened	NA
Delicate Spike – <i>Elliptio arctata</i>	Mussel	State Protected	NA
Georgia Aster – <i>Symphotrichum georgianum</i>	Plant	Federally Protected – Candidate	Northwest - found approximately 2.5 miles northwest of project site.
Gulf Moccasinshell – <i>Medionidus penicillatus</i>	Mussel	Federally & State Protected – Endangered	NA
Highscale Shiner – <i>Notropis hypsilepis</i>	Fish	State Protected – Threatened	NA
Mountain Witch-alder – <i>Fothergilla major</i>	Plant	State Protected	NA
Peregrine Falcon – <i>Falco peregrinus</i>	Bird	State Protected	Northeast - found approximately two miles southwest of the project site
Pink Ladyslipper – <i>Cypripedium acaule</i>	Plant	State Protected	Southwest - found approximately 2.5 miles southwest of the project site
Shinyrayed Pocketbook – <i>Hamiota subangulata</i>	Mussel	Federally & State Protected – Endangered	NA
Sweet Pinesap – <i>Monotropsis odorata</i>	Plant	State Protected	NA

Source: GADNR, www.gadnr.org site accessed June 2008; USFWS, www.fws.gov site accessed June 2008

3.0 Affected Environment
Section 3.16 Geologic Resources


Table 3.16-1: Soil Types

Soil Series	Soil Characteristics
Cecil	Deep, well-drained, moderately permeable, red soils formed in residuum weathered from granite, gneiss, and schist. Found on ridgetops and side slopes.
Cartecay-Toccoa	The Cartecay Series is somewhat poorly drained, moderately rapidly permeable soils that formed in thick loamy alluvial sediments. Found on nearly level flood plains in narrow valleys of streams in the Piedmont Plateau and adjoining Major Land Resource Area (MLRA) where streams flow from the Piedmont. Toccoa is moderately well drained to well-drained, moderately rapidly permeable soils formed in loamy and sandy alluvium from igneous and metamorphic rocks in the Piedmont and Upper Coastal Plain valleys. Found on flood plains and natural levees.
Congaree	Deep, well- to moderately well drained, moderately permeable loamy soils that formed in fluvial sediments. Found on flood plains or at the base of slopes.
Congaree-Cartecay	The Congaree Series is deep, well- to moderately well drained, moderately permeable loamy soils that formed in fluvial sediments. Found on flood plains or at the base of slopes. The Cartecay is somewhat poorly drained, moderately rapidly permeable soils that formed in thick loamy alluvial sediments. Found on nearly level flood plains in narrow valleys of streams in the Piedmont Plateau and adjoining MLRAs where streams flow from Piedmont.
Rion	Very deep, well drained, moderately permeable soils that formed in material mostly weathered from acid crystalline rocks of the Piedmont Uplands. Found on gently sloping to very steep Piedmont uplands.
Wickham	Very deep, well drained, moderately permeable soils on stream terraces in the Piedmont and Coastal Plain and marine terraces in the Lower Coastal Plain terraces. The soil formed in fluvial and marine sediments. These soils are found on stream terraces in the Piedmont and Coastal Plain and marine terraces in the Lower Coastal Plain.

Source: (<http://ortho.ftw.nrcs.usda.gov/cgi-bin/osd/osdname.cgi> 2009).

3.0 Affected Environment Section 3.16 Geologic Resources

Figure 2.16-1: Geologic Formations

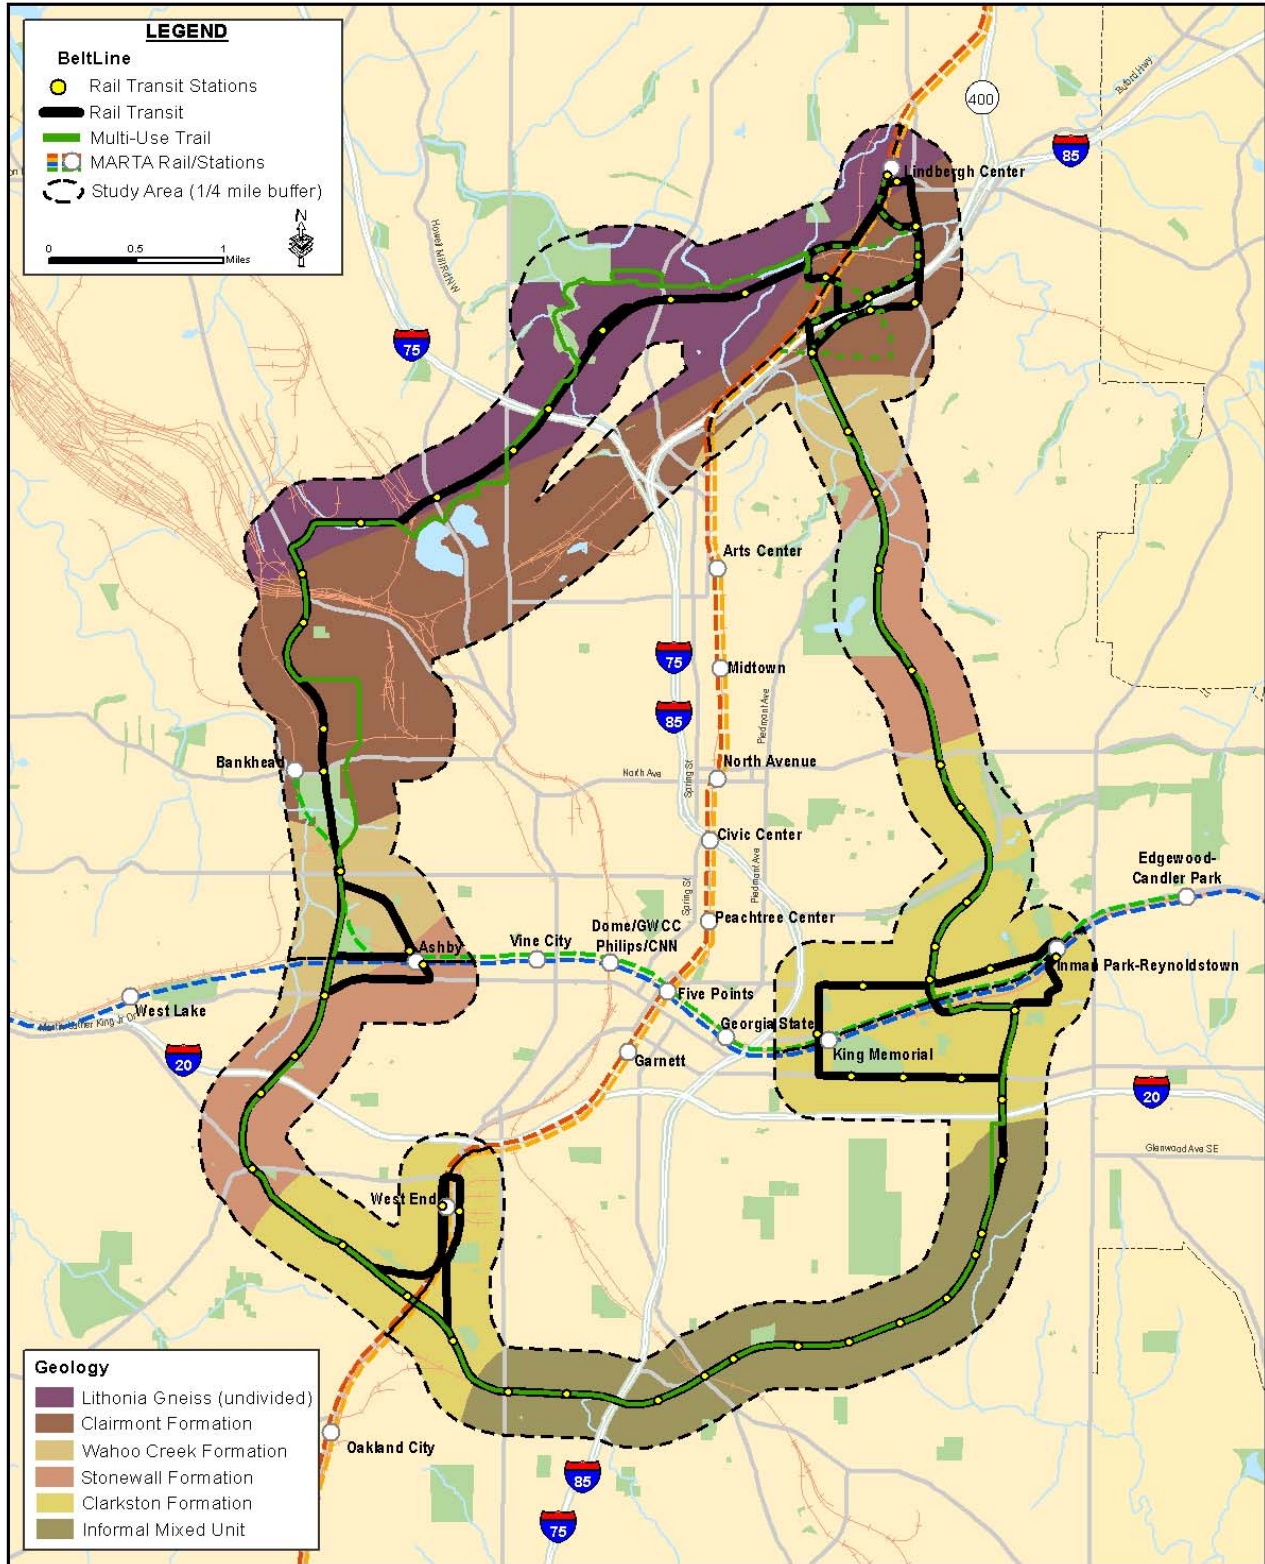

**6.0 Preliminary Section 4(f) Evaluation
Section 6.3 Affected Environment**

Table 6.3-1: Potential Effects to Parks and Recreational Resources

Park Name	Relation to Atlanta BeltLine Route	Potential Effects	Total Park Acreage	Acreage within 150 feet?	Possible ROW Need?
Northeast Zone					
Piedmont Park	Transit (existing rail tracks) and trail are adjacent to the resource Access provided by all Transit and Trail Alternatives	Direct effects unlikely; Proximity effects such as noise / vibration from transit service Improved bicycle and pedestrian connectivity to the park; Consistent with the <i>Piedmont Park Master Plan</i> expansion plans	170.95	Yes	No
Delta Park	Transit is adjacent to the resource (on-street) Access provided by all Transit and Trail Alternatives	Direct effects unlikely	0.22	Yes	No
Historic Fourth Ward Park	Transit is adjacent to the resource (on-street) Access provided by all Transit and Trail Alternatives	Direct effects unlikely	17.79	Yes	No
Freedom Park	Transit (existing rail tracks) and trail pass through the narrow trail portion of the park (within existing rail ROW) Access provided by all Transit and Trail Alternatives	Potential direct effects due to transit and trail crossing the existing Freedom Park trail system; Effects could include noise / vibration, disturbance to park trail, and connectivity to Freedom Park and the Freedom Park Trail	120.26	Yes	No
Selena S. Butler Park*	Transit is adjacent to the resource (on-street) Access provided by all Transit and Trail Alternatives	Direct effects unlikely	3.63	Yes	No
Springvale Park	Transit is adjacent to the resource (on-street) Access provided by all Transit and Trail Alternatives	Direct effects unlikely	4.27	Yes	No
Southeast Zone					
Adair Park II	Transit is adjacent to the resource (existing rail tracks); Access provided by all Transit and Trail Alternatives	Direct effect unlikely	10.01	Yes	No
Boulevard Crossing	Transit is adjacent to the resource (on-street) Access provided by all Transit and Trail Alternatives	Direct effects unlikely	22.01	Yes	No

**6.0 Preliminary Section 4(f) Evaluation
Section 6.3 Affected Environment**

Daniel Stanton Park	Transit (existing rail tracks) and trail are adjacent to the resource; Access provided by all Transit and Trail Alternatives	Direct effect unlikely; Improved bicycle and pedestrian connectivity to the park is a positive direct effect	8.12	Yes	No
Southwest Zone					
Gordon-White Park	Transit (existing rail tracks) and trail are near (across White Street) to the resource Access provided by all Transit and Trail Alternatives	Improved bicycle and pedestrian connectivity, though safety of pedestrians and bicyclists crossing White Street is an important consideration	1.85	Yes	No
Green Leaf Circle	Transit (existing rail tracks) and trail are adjacent to the resource Access provided by all Transit and Trail Alternatives	Proximity effects such as noise / vibration from transit service Improved bicycle and pedestrian connectivity to the park	0.99	Yes	No
Napoleon Circle	Transit (existing rail tracks) and trail are near the resource Access provided by all Transit and Trail Alternatives	Direct effect unlikely	0.05	Yes	No
Rose Circle Park	Transit is adjacent to the resource; Access provided by all Transit and Trail Alternatives	Proximity effects such as noise / vibration from transit service	2.85	Yes	No
Rose Circle Triangle	Transit is adjacent to the resource (on-street); Access provided by all Transit and Trail Alternatives	Proximity effects such as noise / vibration from transit service.	0.21	Yes	No
South Gordon Triangle	Transit (existing rail tracks) and trail are adjacent to the resource Access provided by all Transit and Trail Alternatives	Direct effect unlikely	0.01	Yes	No
Stafford Street Park	Transit (existing rail tracks) and trail are adjacent to the resource Access provided by all Transit and Trail Alternatives	Proximity effects such as noise / vibration from transit service; Improved bicycle and pedestrian connectivity to the park	0.12	Yes	No
Northwest Zone					
Preferred Transit Alternative					
Ardmore Park	Transit (existing rail tracks) adjacent to the resource Transit access to the park provided	Proximity effects such as noise / vibration from transit service	1.68	Yes	No

**6.0 Preliminary Section 4(f) Evaluation
Section 6.3 Affected Environment**

Bobby Jones Golf Course	Transit is not adjacent to Bobby Jones Golf Course	N/A	149	No	No
Maddox Park	Transit (on existing rail ROW) adjacent to the resource, along the park's eastern edge Transit access to the park provided	Proximity effects such as noise / vibration from transit service	53.16	Yes	No
Mayson Turner-Ashby Street Triangle	Transit (on-street) adjacent to the resource Transit access to the park provided.	Proximity effects such as noise / vibration from transit service Narrow ROW on Mayson-Turner Road NW could lead to ROW acquisition from the park	1.27	Yes	No
Tanyard Creek Park	Transit (existing rail tracks) adjacent to the resource Transit access to the park provided.	Proximity effects such as noise / vibration from transit service	16.82	Yes	No
Washington Park*	Transit (on and off-street) adjacent to the resource Transit access to the park provided.	Proximity effects such as noise / vibration from transit service	19.92	Yes	No
Preferred. Trail Alternative					
Ardmore Park	Trail adjacent to the resource (existing rail tracks) Trail access to the park provided	Improved bicycle and pedestrian connectivity to the park	1.68	Yes	No
Bobby Jones Golf Course	Trail adjacent to the resource Trail access to the park provided	Improved bicycle and pedestrian connectivity to the park	149	Yes	No
Maddox Park	Trail adjacent to the resource (existing rail ROW) Trail access to the park provided	Improved bicycle and pedestrian connectivity to the park	53.16	Yes	No
Mayson Turner-Ashby Street Triangle	Trail is not adjacent of near the resource	N/A	1.27	No	No
Tanyard Creek Park	Trail extends through the middle of the resource	Improved bicycle and pedestrian connectivity to the park This option would likely require ROW from the park	16.82	Yes (both sides of the trail alignment)	No
Washington Park*	Trail adjacent to the resource (existing rail tracks) Trail access to the park provided	Improved bicycle and pedestrian connectivity to the park	19.92	Yes	No

*Denotes a recreation center in the park

Source: City of Atlanta Department of Parks, Recreation & Cultural Affairs

**6.0 Preliminary Section 4(f) Evaluation
Section 6.3 Affected Environment**

Table 6.3-2: Potentially Impacted Cultural Resources

Property Name	Status
Northeast Zone	
Martin Luther King Jr. Historic District	Listed
Inman Park Historic District	Listed
Ansley Park Historic District	Listed
Piedmont Park Historic District	Listed
Piedmont Heights Historic District	Eligible
Atlanta's Historic Apartment Complexes	Eligible
Krog Street-Southern Railway Historic District	Eligible
Ponce de Leon-Ralph McGill Historic District	Eligible
Pylant-Drewry-Greenwood Historic District	Eligible
Eifrid Building	Eligible
Historic Railroad Resources of the Atlanta BeltLine	Eligible
1904 Monroe Drive	Eligible
441 Armour Drive	Eligible
Atlanta Fire Department Station #29	Eligible
Orkin-Rollins Building	Eligible
2131 Old Plasters Bridge Road Commercial Building	Eligible
Trust Company Bank Building	Eligible
Old Fourth Ward Archaeological Sensitivity Area	Sensitive
Inman Park Archaeological Sensitivity Area	Sensitive
Plaster Farmstead Archaeological Sensitivity Area	Sensitive
Battle of Atlanta Site – 9Fu77	Sensitive
Southeast Zone	
Adair Park Historic District	Listed
Cabbagetown Historic District	Listed
Oakland Cemetery	Listed
Reynoldstown Historic District	Listed
Great Atlantic & Pacific Tea Company	Listed
Grant Park North Historic District	Listed
Murphy Triangle Historic District	AUDC Significant
Nextran Truck Center	AUDC Significant
Ormewood Park	AUDC Significant
Pittsburgh Plate Glass	AUDC Significant
Adair Park / Pittsburgh Industrial-Commercial District	Potentially Eligible
Boulevard Industrial District	Potentially Eligible
Grant Park Extension Residential District	Potentially Eligible
Grant Park North Addition Residential District	Potentially Eligible
Martin Luther King Jr. Drive Industrial District	Potentially Eligible
Memorial Drive – Woodward Avenue Historic District	Potentially Eligible
Memorial Drive Industrial District	Potentially Eligible
Mercer Street / Berne Street Historic District	Potentially Eligible
South Atlanta Industrial-Commercial District	Potentially Eligible
University Avenue Industrial-Commercial District	Potentially Eligible
Cabbagetown Archaeological Sensitivity Area	Sensitive

**6.0 Preliminary Section 4(f) Evaluation
Section 6.3 Affected Environment**

Property Name	Status
Reynoldstown Archaeological Sensitivity Area	Sensitive
Atlanta Asphalt Company Archaeological Sensitivity Area	Sensitive
Atlanta Cotton Company Archaeological Sensitivity Area	Sensitive
Oakland Cemetery Site (9Fu106)	Sensitive
Southwest Zone	
West End Historic District	Listed
Westview Historic District	AUDC Significant
Ashview Heights	AUDC Significant
Stafford Park Historic District	Potentially Eligible
Just Us Residential Historic District	Potentially Eligible
Westview Archaeological Sensitivity Area	Sensitive
Confederate Defensive Line Archaeological Sensitivity Area	Sensitive
Northwest Zone	
Historic Railroad Resources of the Atlanta BeltLine ¹	Eligible
Atlanta's Historic Apartment Complexes ¹	Eligible
Howell Interlocking Historic District	Listed
Howell Station Historic District	Listed
Berkeley Park Historic District	Listed
Brookwood Hills Historic District	Listed
King Plow Company	Listed
Peachtree Hills Residential Historic District	Eligible
Loring Heights Residential Historic District	AUDC District
Ardmore Park Residential Historic District	AUDC Significant
Collier Hills Residential Historic District	AUDC Significant
Brookwood Hills Addition Residential Historic District	Potentially Eligible
Jefferson Street Industrial District	Potentially Eligible
Maddox Park	Potentially Eligible
Mead Corporation Industrial District	Potentially Eligible
West Marietta Street Commercial District	Potentially Eligible
Bishop Street Industrial –Commercial District	Potentially Eligible
Bobby Jones Golf Course	Potentially Eligible
Northside / Trabert / Howell Mill Industrial Commercial District	Potentially Eligible
Archaeological Sites and Areas of Archaeological Sensitivity	
Maddox Park Dump (9Fu114) Archaeological Site	Eligible
Federal Position near Elliot's Mill Archaeological Sensitivity Area	Potentially Eligible
Federal Advance Positions of August 7, 1864	Potentially Eligible
Federal Siege Lines	Potentially Eligible
Elliot's Mill	Potentially Eligible
Howell Station Community	Potentially Eligible
Colliers Mill Archaeological Site (9Fu548)	Potentially Eligible
Prehistoric Sensitivity Areas	Potentially Eligible
Metal Works Manufacturing	Potentially Eligible
Atlanta Paper Company	Potentially Eligible
Western and Atlantic Railroad	Potentially Eligible
Deavenport Antebellum Farmstead	Potentially Eligible

6.0 Preliminary Section 4(f) Evaluation
Section 6.3 Affected Environment

Property Name	Status
Thrasher Antebellum Farmstead	Potentially Eligible
Atlanta Water Works	Potentially Eligible
Foundry	Potentially Eligible
Narjo Timber Company site	Potentially Eligible

¹Resource occurs in more than one zone.